

Mitsubishi Programmable Controller



MELSEC-L CPU Module User's Manual (Built-In I/O Function)

- -L02SCPU
- -L02SCPU-P
- -L02CPU
- -L02CPU-P
- -L06CPU
- -L06CPU-P
- -L26CPU -L26CPU-P
- -L26CPU-BT -L26CPU-PBT





(Read these precautions before using this product.)

Before using this product, please read this manual and the relevant manuals carefully and pay full attention to safety to handle the product correctly.

In this manual, the safety precautions are classified into two levels: "/N WARNING" and "/N CAUTION".

!WARNING

Indicates that incorrect handling may cause hazardous conditions, resulting in death or severe injury.

!CAUTION

Indicates that incorrect handling may cause hazardous conditions, resulting in minor or moderate injury or property damage.

Under some circumstances, failure to observe the precautions given under "_____CAUTION" may lead to serious consequences.

Observe the precautions of both levels because they are important for personal and system safety.

Make sure that the end users read this manual and then keep the manual in a safe place for future reference.

[Design Precautions]

WARNING

- Configure safety circuits external to the programmable controller to ensure that the entire system
 operates safely even when a fault occurs in the external power supply or the programmable controller.
 Failure to do so may result in an accident due to an incorrect output or malfunction.
 - (1) Emergency stop circuits, protection circuits, and protective interlock circuits for conflicting operations (such as forward/reverse rotations or upper/lower limit positioning) must be configured external to the programmable controller.
 - (2) Machine OPR (Original Point Return) of the positioning function is controlled by two kinds of data: an OPR direction and an OPR speed. Deceleration starts when the near-point dog signal turns on. If an incorrect OPR direction is set, motion control may continue without deceleration. To prevent machine damage caused by this, configure an interlock circuit external to the programmable controller.
 - (3) When the CPU module detects an error during control by the positioning function, the motion slows down and stops.
 - (4) When the programmable controller detects an abnormal condition, it stops the operation and all outputs are:
 - Turned off if the overcurrent or overvoltage protection of the power supply module is activated.
 - Held or turned off according to the parameter setting if the self-diagnostic function of the CPU module detects an error such as a watchdog timer error.
 - (5) All outputs may be turned on if an error occurs in a part, such as an I/O control part, where the CPU module cannot detect any error. To ensure safety operation in such a case, provide a safety mechanism or a fail-safe circuit external to the programmable controller. For a fail-safe circuit example, refer to "General Safety Requirements" in the MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection).
 - (6) Outputs may remain on or off due to a failure of a component such as a transistor in an output circuit. Configure an external circuit for monitoring output signals that could cause a serious accident.
- In an output circuit, when a load current exceeding the rated current or an overcurrent caused by a load short-circuit flows for a long time, it may cause smoke and fire. To prevent this, configure an external safety circuit, such as a fuse.
- Configure a circuit so that the programmable controller is turned on first and then the external power supply. If the external power supply is turned on first, an accident may occur due to an incorrect output or malfunction.
- For the operating status of each station after a communication failure, refer to relevant manuals for each network. Incorrect output or malfunction due to a communication failure may result in an accident.

[Design Precautions]

! WARNING

- When changing data from a peripheral device connected to the CPU module during operation, configure an interlock circuit in the program to ensure that the entire system will always operate safely. For other forms of control (such as program modification or operating status change) of a running programmable controller, read the relevant manuals carefully and ensure that the operation is safe before proceeding. Especially, when a remote programmable controller is controlled by an external device, immediate action cannot be taken if a problem occurs in the programmable controller due to a communication failure. To prevent this, configure an interlock circuit in the program, and determine corrective actions to be taken between the external device and CPU module in case of a communication failure.
- An absolute position restoration by the positioning function may turn off the servo-on signal (servo off) for approximately 20ms, and the motor may run unexpectedly. If this causes a problem, provide an electromagnetic brake to lock the motor during absolute position restoration.

[Design Precautions]

CAUTION

- Do not install the control lines or communication cables together with the main circuit lines or power cables. Keep a distance of 100mm or more between them. Failure to do so may result in malfunction due to noise.
- During control of an inductive load such as a lamp, heater, or solenoid valve, a large current (approximately ten times greater than normal) may flow when the output is turned from off to on. Therefore, use a module that has a sufficient current rating.
- After the CPU module is powered on or is reset, the time taken to enter the RUN status varies
 depending on the system configuration, parameter settings, and/or program size. Design circuits so
 that the entire system will always operate safely, regardless of the time.

[Installation Precautions]

WARNING

Shut off the external power supply (all phases) used in the system before mounting or removing a
module. Failure to do so may result in electric shock or cause the module to fail or malfunction.

[Installation Precautions]

CAUTION

- Use the programmable controller in an environment that meets the general specifications in the MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection). Failure to do so may result in electric shock, fire, malfunction, or damage to or deterioration of the product.
- To interconnect modules, engage the respective connectors and securely lock the module joint levers until they click. Incorrect interconnection may cause malfunction, failure, or drop of the module.
- Do not directly touch any conductive parts and electronic components of the module. Doing so can cause malfunction or failure of the module.
- Securely connect an extension cable to the connectors of a branch module and an extension module.
 After connections, check that the cable is inserted completely. Poor contact may cause malfunction.
- When using an SD memory card, fully insert it into the SD memory card slot. Check that it is inserted completely. Poor contact may cause malfunction.
- Do not directly touch any conductive parts and electronic components of the module or SD memory card. Doing so can cause malfunction or failure of the module.

[Wiring Precautions]

WARNING

- Shut off the external power supply (all phases) used in the system before wiring. Failure to do so may
 result in electric shock or cause the module to fail or malfunction.
- After installation and wiring, attach the included terminal cover to the module before turning it on for operation. Failure to do so may result in electric shock.

[Wiring Precautions]

! CAUTION

- Individually ground the FG terminal of the programmable controller with a ground resistance of 100Ω or less. Failure to do so may result in electric shock or malfunction.
- Use applicable solderless terminals and tighten them within the specified torque range. If any spade solderless terminal is used, it may be disconnected when a terminal block screw comes loose, resulting in failure.
- Check the rated voltage and terminal layout before wiring to the module, and connect the cables correctly. Connecting a power supply with a different voltage rating or incorrect wiring may cause a fire or failure.
- Connectors for external devices must be crimped or pressed with the tool specified by the manufacturer, or must be correctly soldered. Incomplete connections may cause short circuit, fire, or malfunction.
- Securely connect the connector to the module.
- Do not install the control lines or communication cables together with the main circuit lines or power cables. Failure to do so may result in malfunction due to noise.
- Place the cables in a duct or clamp them. If not, dangling cable may swing or inadvertently be pulled, resulting in damage to the module or cables or malfunction due to poor contact.
- Check the interface type and correctly connect the cable. Incorrect wiring (connecting the cable to an
 incorrect interface) may cause failure of the module and external device.
- Tighten the terminal block screws within the specified torque range. Undertightening can cause short circuit, fire, or malfunction. Overtightening can damage the screw and/or module, resulting in drop, short circuit, or malfunction.
- When disconnecting the cable from the module, do not pull the cable by the cable part. For the cable with connector, hold the connector part of the cable. For the cable connected to the terminal block, loosen the terminal screw. Pulling the cable connected to the module may result in malfunction or damage to the module or cable.
- Prevent foreign matter such as dust or wire chips from entering the module. Such foreign matter can cause a fire, failure, or malfunction.
- A protective film is attached to the top of the module to prevent foreign matter, such as wire chips, from entering the module during wiring. Do not remove the film during wiring. Remove it for heat dissipation before system operation.
- To use the high-speed counter function, ground the shield cable on the encoder side (relay box).
 Always ground the FG and LG terminals to the protective ground conductor. Failure to do so may cause malfunction.
- Mitsubishi programmable controllers must be installed in control panels. Connect the main power supply to the power supply module in the control panel through a relay terminal block. Wiring and replacement of a power supply module must be performed by qualified maintenance personnel with knowledge of protection against electric shock.
 For wiring methods, refer to the MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection).

[Startup and Maintenance Precautions]

WARNING

- Do not touch any terminal while power is on. Doing so will cause electric shock or malfunction.
- Correctly connect the battery connector. Do not charge, disassemble, heat, short-circuit, solder, or throw the battery into the fire. Also, do not expose it to liquid or strong shock.
 Doing so will cause the battery to produce heat, explode, ignite, or leak, resulting in injury and fire.
- Shut off the external power supply (all phases) used in the system before cleaning the module or retightening the terminal block screws. Failure to do so may result in electric shock.

[Startup and Maintenance Precautions]

CAUTION

- Before performing online operations (especially, program modification, forced output, and operating status change) for the running CPU module from the peripheral device connected, read relevant manuals carefully and ensure the safety. Improper operation may damage machines or cause accidents.
- Do not disassemble or modify the module. Doing so may cause failure, malfunction, injury, or a fire.
- Use any radio communication device such as a cellular phone or PHS (Personal Handy-phone System) more than 25cm away in all directions from the programmable controller. Failure to do so may cause malfunction.
- Shut off the external power supply (all phases) used in the system before mounting or removing a module. Failure to do so may cause the module to fail or malfunction.
- Tighten the terminal block screws within the specified torque range. Undertightening can cause drop
 of the component or wire, short circuit, or malfunction. Overtightening can damage the screw and/or
 module, resulting in drop, short circuit, or malfunction.
- After the first use of the product (module, display unit, and terminal block), the number of connections/disconnections is limited to 50 times (in accordance with IEC 61131-2). Exceeding the limit may cause malfunction.
- After the first use of the SD memory card, do not insert/remove the memory card more than 500 times.
 Exceeding the limit may cause malfunction.
- Do not drop or apply shock to the battery to be installed in the module. Doing so may damage the battery, causing the battery fluid to leak inside the battery. If the battery is dropped or any shock is applied to it, dispose of it without using.
- Before handling the module, touch a conducting object such as a grounded metal to discharge the static electricity from the human body. Failure to do so may cause the module to fail or malfunction.
- Before testing the operation by the positioning function, set a low speed value for the speed limit parameter so that the operation can be stopped immediately upon occurrence of a hazardous condition.

[Disposal Precautions]

<u>^</u>CAUTION

When disposing of this product, treat it as industrial waste. When disposing of batteries, separate
them from other wastes according to the local regulations. (For details on battery regulations in EU
member states, refer to the MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance
and Inspection).)

[Transportation Precautions]

<u>^</u>CAUTION

 When transporting lithium batteries, follow the transportation regulations. (For details on the regulated models, refer to the MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection).)

CONDITIONS OF USE FOR THE PRODUCT

- (1) Mitsubishi programmable controller ("the PRODUCT") shall be used in conditions;
 - i) where any problem, fault or failure occurring in the PRODUCT, if any, shall not lead to any major or serious accident; and
 - ii) where the backup and fail-safe function are systematically or automatically provided outside of the PRODUCT for the case of any problem, fault or failure occurring in the PRODUCT.
- (2) The PRODUCT has been designed and manufactured for the purpose of being used in general industries.

 MITSUBISHI SHALL HAVE NO RESPONSIBILITY OR LIABILITY (INCLUDING, BUT NOT LIMITED TO ANY AND ALL RESPONSIBILITY OR LIABILITY BASED ON CONTRACT, WARRANTY, TORT, PRODUCT LIABILITY) FOR ANY INJURY OR DEATH TO PERSONS OR LOSS OR DAMAGE TO PROPERTY CAUSED BY the PRODUCT THAT ARE OPERATED OR USED IN APPLICATION NOT INTENDED OR EXCLUDED BY INSTRUCTIONS, PRECAUTIONS, OR WARNING CONTAINED IN MITSUBISHI'S USER, INSTRUCTION AND/OR SAFETY MANUALS, TECHNICAL BULLETINS AND GUIDELINES FOR the PRODUCT.

("Prohibited Application")

Prohibited Applications include, but not limited to, the use of the PRODUCT in;

- Nuclear Power Plants and any other power plants operated by Power companies, and/or any other cases in which the public could be affected if any problem or fault occurs in the PRODUCT.
- Railway companies or Public service purposes, and/or any other cases in which establishment of a special quality assurance system is required by the Purchaser or End User.
- Aircraft or Aerospace, Medical applications, Train equipment, transport equipment such as Elevator and Escalator, Incineration and Fuel devices, Vehicles, Manned transportation, Equipment for Recreation and Amusement, and Safety devices, handling of Nuclear or Hazardous Materials or Chemicals, Mining and Drilling, and/or other applications where there is a significant risk of injury to the public or property.

Notwithstanding the above restrictions, Mitsubishi may in its sole discretion, authorize use of the PRODUCT in one or more of the Prohibited Applications, provided that the usage of the PRODUCT is limited only for the specific applications agreed to by Mitsubishi and provided further that no special quality assurance or fail-safe, redundant or other safety features which exceed the general specifications of the PRODUCTs are required. For details, please contact the Mitsubishi representative in your region.

INTRODUCTION

Thank you for purchasing the Mitsubishi MELSEC-L series programmable controllers.

This manual describes the functions of the external I/O interface of the LCPU and programming.

Before using this product, please read this manual and the relevant manuals carefully and develop familiarity with the functions and performance of the MELSEC-L series programmable controller to handle the product correctly. When applying the program examples introduced in this manual to an actual system, ensure the applicability and confirm that it will not cause system control problems.

Please make sure that the end users read this manual.

■ Relevant CPU modules

CPU module	Model					
LCPU	L02SCPU, L02SCPU-P, L02CPU, L02CPU-P, L06CPU, L06CPU-P, L26CPU, L26CPU-P,					
	L26CPU-BT, L26CPU-PBT					



- This manual describes only built-in I/O functions for the CPU module. For the functions except for built-in I/O functions of the CPU module, refer to the following.
 - MELSEC-L CPU Module User's Manual (Function Explanation, Program Fundamentals)
 - MELSEC-L CPU Module User's Manual (Built-In Ethernet Function)
 - QnUDVCPU/LCPU User's Manual (Data Logging Function)
- Unless otherwise specified, this manual describes examples of assigning from X0 to XF for input numbers and from Y0 to Y7 for output numbers in each function. For I/O number assignment, refer to the following.
 MELSEC-L CPU Module User's Manual (Function Explanation, Program Fundamentals)
- Unless otherwise specified, Chapter 7 POSITIONING FUNCTION in this manual is described as using examples of the setting, special relay, special register, dedicated instruction, error code and warning code supported for Axis 1.
- Unless otherwise specified, Chapter 8 HIGH-SPEED COUNTER FUNCTION in this manual is described as using examples of the setting, special relay, special register, dedicated instruction, error code and warning code supported for CH1.

RELEVANT MANUALS

(1) CPU module user's manual

Manual name <manual (model="" code)="" number=""></manual>	Description		
MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection) <sh-080890eng, 13jz36=""></sh-080890eng,>	Specifications of the CPU modules, power supply modules, display unit, branch module, extension module, SD memory cards, and batteries, information on how to establish a system, maintenance and inspection, and troubleshooting		
MELSEC-L CPU Module User's Manual (Function Explanation, Program Fundamentals) <sh-080889eng, 13jz35=""></sh-080889eng,>	Functions and devices of the CPU module, and programming		
MELSEC-L CPU Module User's Manual (Built-In Ethernet Function) <sh-080891eng, 13jz37=""></sh-080891eng,>	The built-in Ethernet function of the CPU module		
QnUDVCPU/LCPU User's Manual (Data Logging Function) <sh-080893eng, 13jz39=""></sh-080893eng,>	The data logging function of the CPU module		

(2) Programming manual

Manual name <manual (model="" code)="" number=""></manual>	Description	
MELSEC-Q/L Programming Manual (Common Instruction) <sh-080809eng, 13jw10=""></sh-080809eng,>	Detailed description and usage of instructions used in programs	

(3) Operating manual

Manual name <manual (model="" code)="" number=""></manual>	Description		
GX Works2 Version 1 Operating Manual (Common) <sh-08077< td=""><td>9ENG, 13JU63></td><td>System configuration, parameter settings, and online operations of GX Works2, which are common to Simple projects and Structured projects</td></sh-08077<>	9ENG, 13JU63>	System configuration, parameter settings, and online operations of GX Works2, which are common to Simple projects and Structured projects	
GX Developer Version 8 Operating Manual <sh-080< td=""><td>0373E, 13JU41></td><td>Operating methods of GX Developer, such as programming, printing, monitoring, and debugging</td></sh-080<>	0373E, 13JU41>	Operating methods of GX Developer, such as programming, printing, monitoring, and debugging	

(4) I/O module and intelligent function module manual

Manual name <manual (model="" code)="" number=""></manual>	Description	
MELSEC-L I/O Module User's Manual <sh-080888eng, 13jz<="" td=""><td>Specifications and troubleshooting of the I/O module</td></sh-080888eng,>	Specifications and troubleshooting of the I/O module	

Memo

CONTENTS

CONDITION INTRODUCE RELEVAN MANUAL	ONS OF U CTION IT MANUA PAGE OR	IONS USE FOR THE PRODUCT ALS USGANIZATION	
CHAPTER	R 1 OVE	RVIEW	20
CHAPTER	R 2 EXT	ERNAL I/O SPECIFICATIONS	22
CHAPTER	R 3 GEN	ERAL-PURPOSE INPUT FUNCTION	31
CHARTE) 4 OEN	EDAL DUDDOCE OUTDUT FUNCTION	22
CHAPTER	K 4 GEN	ERAL-PURPOSE OUTPUT FUNCTION	33
CHAPTER	R 5 INTE	RRUPT INPUT FUNCTION	35
CHAPTER	R 6 PUL	SE CATCH FUNCTION	39
CHAPTER	R 7 POS	ITIONING FUNCTION	42
7.	.1 Over	view	42
	7.1.1	Procedure for performing the positioning function	50
7.	.2 Conn	ection to External Devices	51
	7.2.1	I/O signals	
	7.2.2	Wiring	
7.	3 Parai	meter Setting	56
	7.3.1	Positioning parameters	
7.	4 Spec	ifications	61
7.	5 Chec	king Current Position and Operation Status	63
7.	6 OPR	Control	64
	7.6.1	Machine OPR	
	7.6.2	Fast OPR	
	7.6.3	Forced off of Axis 1 OPR request (SM1842)	
	7.6.4	Precautions on Axis 1 OPR request (SM1842)	
7.	7 Posit	ioning Control	91
	7.7.1	Start of positioning control	
	7.7.2	Position control	
	7.7.3	Speed/position switching control	
	7.7.4	Current value change	
	7.7.5	Speed control	
7.	.8 Multip	ole Axes Simultaneous Start Control	102
7.	9 JOG	Operation	104
7.	.10 Sub I	=unction	109
	7.10.1	OPR retry function	
	7.10.2	Speed limit function	


	7.10.3	Speed change function	
	7.10.4	Software stroke limit function	
	7.10.5	Hardware stroke limit function	
	7.10.6	Target position change function	
	7.10.7	Acceleration/deceleration processing function	
	7.10.8	Stop processing function	
	7.11 Abs	olute Position Restoration Function	133
	7.12 Ded	icated Instructions	137
	7.12.1	Details of dedicated instructions	
	7.12.2	Precautions on dedicated instructions	
	7.13 Prog	gramming	163
	7.14 Erro	rs and Warnings	173
	7.15 Mon	itoring with a Programming Tool	178
CHA	APTER 8 HIG	H-SPEED COUNTER FUNCTION	179
		Procedure for performing the high speed counter function	
	8.1.1	Procedure for performing the high-speed counter function	
		necting to External Devices	
	8.2.1	I/O signals	
	8.2.2	Wiring	
		ameter Settings	
	8.3.1	Common settings	
		mal Mode	
	8.4.1	Preset	
	8.4.2	Coincidence output	
	8.4.3	Coincidence detection	
	8.4.4	Counter function selection	
	8.5 Fred	uency Measurement Mode	220
	8.6 Rota	ation Speed Measurement Mode	226
	8.7 Puls	e Measurement Mode	232
	8.8 PWI	VI Output Mode	235
	8.9 Spe	cifications	238
	8.10 Ded	icated Instructions	241
	8.10.1	Details of dedicated instructions	242
	8.10.2	Precautions on dedicated instructions	257
	8.11 Prog	gramming	258
	8.12 Erro	rs and Warnings	265
	8.13 Whe	en the LCPU Stops Operation	267
		itoring with a Programming Tool	
APP	PENDICES		269
	Annendiy 1	Processing Time of Each Instruction	260
		Connection Examples with Servo Amplifiers	
		ndix 2.1 Connection examples with servo amplifiers manufactured by Mitsubishi	
	∠hhei	Mix 2.1 Confidencial examples with serve amplifiers manufactured by Mitsubishi	

Appendix 2.2	Connection examples with stepping motors manufactured by ORIENTAL MOTOR
	CO.,LTD
Appendix 2.3	Connection examples with servo amplifiers manufactured by Panasonic Corporation
	277
Appendix 2.4	Connection examples with servo amplifiers manufactured by SANYODENKI CO.,LTD
	279
Appendix 2.5	Connection examples with servo amplifiers manufactured by YASKAWA Electric
	Corporation
INDEX	281
INSTRUCTION INDEX	284
REVISIONS	
WARRANTY	
TRADEMARKS	288


MANUAL PAGE ORGANIZATION

In this manual, pages are organized and the symbols are used as shown below.

The following illustration is for explanation purpose only, and should not be referred to as an actual documentation.

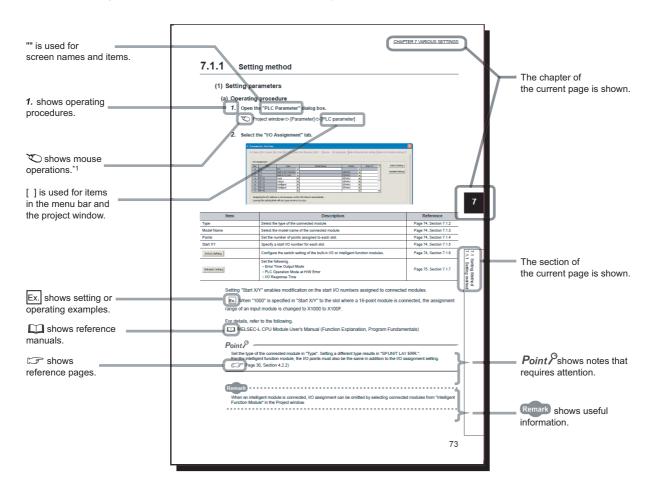


*1 The mouse operation example (for GX Works2) is provided below.

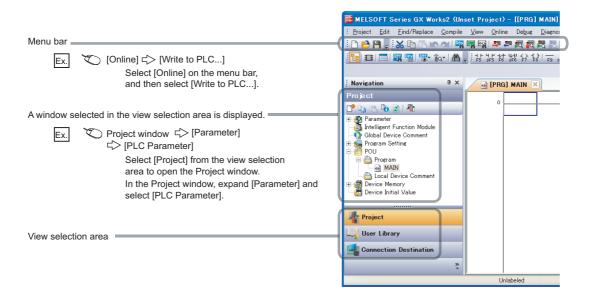

Pages describing instructions are organized as shown below.

The following illustration is for explanation purpose only, and should not be referred to as an actual documentation.

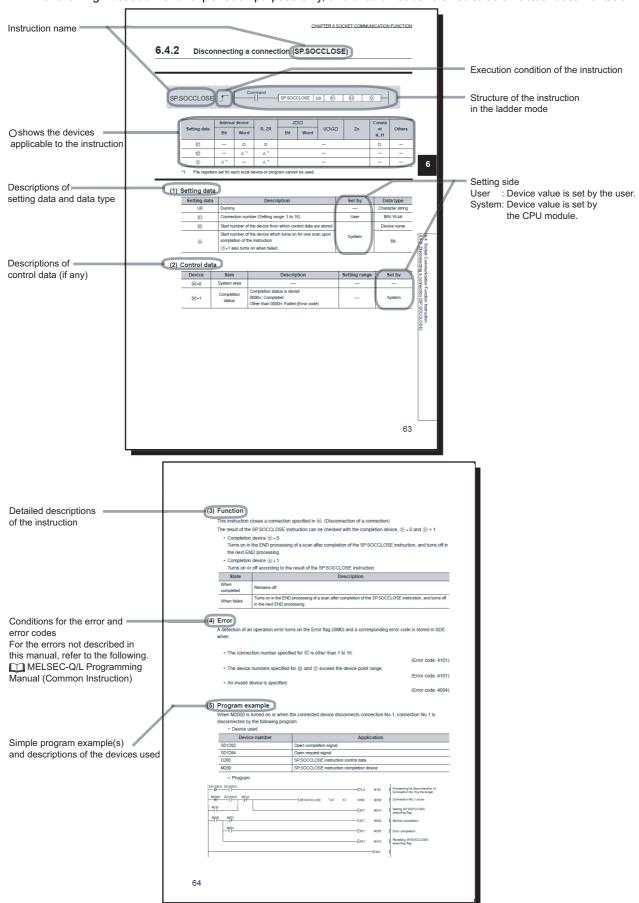

• Instructions can be executed under the following conditions.

Execution condition	Any time	During on	On the rising edge	During off	On the falling edge	
Symbol	No symbol				—	

· The following devices can be used.

Setting		l device n, user)	File	Link direct device J□\□		Intelligent function module	Index register Zn	Constant *3	Others
data	Bit	Word	register	Bit	t Word device U□\G□				*3
Applicable device*1	X, Y, M, L, S, M, F, B, SB, FX, FY *2	T, ST, C, D, W, SD, SW, FD, @□	R, ZR	_		U=\G=	Z	K, H, E, \$	P, I, J, U, D, X, DY, N, BL, TR, BL\S,V

- *1 For details on each device, refer to the following.
 - MELSEC-L CPU Module User's Manual (Function Explanation, Program Fundamentals)
- *2 FX and FY can be used for bit data only, and FD for word data only.
- *3 In the "Constant" and "Others" columns, a device(s) that can be set for each instruction is shown.
 - The following data types can be used.

Data type	Description				
Bit	Bit data or the start number of bit data				
BIN 16-bit	6-bit binary data or the start number of word device				
BIN 32-bit	2-bit binary data or the start number of double-word device				
BCD 4-digit	Four-digit binary-coded decimal data				
BCD 8-digit	Eight-digit binary-coded decimal data				
Real number	Floating-point data				
Character string	Character string data				
Device name	Device name data				

TERMS

Unless otherwise specified, this manual uses the following terms.


Term	Description
CPU module	The abbreviation for the MELSEC-L series CPU module
Power supply module	The abbreviation for the MELSEC-L series power supply module
Branch module	The abbreviation for the MELSEC-L series branch module
Extension module	The abbreviation for the MELSEC-L series extension module
END cover	A cover to be attached to the right side of the rightmost MELSEC-L series module
Display unit	A liquid crystal display to be attached to the CPU module
Extension cable	The abbreviation for the MELSEC-L series extension cable
LCPU	Another term for the MELSEC-L series CPU module
Programming tool	A generic term for GX Works2 and GX Developer
GX Works2	The product name of the software package for the MELSEC programmable controllers
GX Developer	The product name of the software package for the MELSEC programmable controllers
Encoder	One of the pulse generators that converts input data into binary data (on and off)
Near-point dog	A switch used in positioning systems, placed in front of the starting point of a workpiece When this switch turns on, the feed speed is switched to creep speed. Therefore, the deceleration time is required while this switch is on.
Servo on	A signal that indicates the normal status of a servo amplifier. A servo amplifier is operable only when this signal is on.
Servo motor	A motor that rotates according to a command. This motor is highly responsive, therefore frequent and rapid start and stop are available with high precision. DC and AC type motors are available. Feedback control is available with the included pulse generator that detects the number of rotations.
Stepping motor	A motor that rotates by the predetermined angle for every pulse. The number of rotations is proportional to the number of pulses. A small power motor is applied, and it rotates accurately without feedbacks. Do not overload the motor, otherwise it will be out of step.
Zero signal	PG0 of a pulse generator (encoder), that is detected once in one rotation
Drive unit (servo amplifier)	A unit used to amplify the power and control the motor in the operation by the positioning function since the signals, such as pulses, that are output from the CPU module are low voltage and small current. The unit, also called a servo amplifier, is provided with a servomotor and step motor.
Pulse generator	A device that generates pulses. For example, by attaching this device on a motor axis, pulses can be generated by the rotation of the axis.
Warning	Different from an error, a warning is a minor error that does not terminate or stop the operation even if it is detected.
PWM	The abbreviation for pulse-width modulation, a method of changing a ratio of on width to off width of a pulse wave

Memo

CHAPTER 1 OVERVIEW

The LCPU supports the following built-in I/O functions. The built-in I/O functions allow constructing a small-scale system using the LCPU alone because dedicated modules for these functions are not required. Therefore, the system cost can be reduced.

- · General-purpose input function
- · General-purpose output function
- · Interrupt input function
- · Pulse catch function
- · Positioning function
- · High-speed counter function

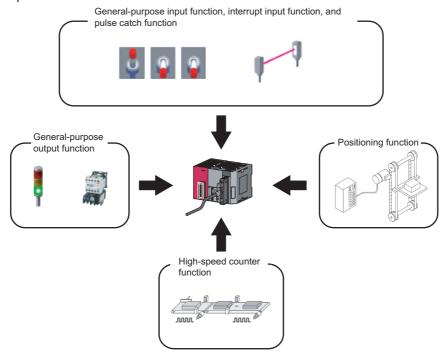

(1) Number of points used for each function

X0 to XF and Y0 to Y7 are sorted for each function.

Function	Available range	Number of points		
runction	Available range	Input	Output	
General-purpose input function	0 to 16 points (input signal)	0 to 16 points	_	
General-purpose output function	0 to 8 points (output signal)	_	0 to 8 points	
Interrupt input function	0 to 16 points (input signal)	0 to 16 points	_	
Pulse catch function	0 to 16 points (input signal)	0 to 16 points	_	
High-speed counter function*1	O to 2CH Input signal: 0 to 5 points (points/channel) (depending on settings) Output Signal: 0 to 2 points (points/channel) (depending on settings)	When using only one channel: 0 to 5 points When using two channels simultaneously: 0 to 10 points	When using only one channel: 0 to 2 points When using two channels simultaneously: 0 to 4 points	
Positioning function*1	0 to 2 axes Input signal: 0 to 6 points (points/axis) (depending on settings) Output signal: 2 to 3 points (points/axis) (depending on settings)	When using only one axis: 0 to 6 points When using two axes simultaneously: 0 to 12 points	When using only one axis: 2 to 3 points When using two axes simultaneously: 4 to 6 points	

^{*1} Assignment of some signals used for the high-speed counter function and positioning function (such as A phase, B phase, and near-point dog) are fixed. When using these functions, no signal can be assigned in place of the signals.

CHAPTER 2 EXTERNAL I/O SPECIFICATIONS


This chapter describes internal circuits, pin numbers and corresponding signal names, and specifications of external I/O interface. For connectors used for external wiring, refer to MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection).

(1) Input specifications

Item			Specifications		
Cignal name		High-speed inp	Standard input (IN6 to INF)		
Signal name		24V input	Differential input	24V input	
Rated input volta	age	24VDC (+20%/-15%, ripple ratio within 5%)	EIA Standard RS-422-A	24VDC (+20%/-15%, ripple ratio within 5%)	
Rated input curr	ent	6.0mA (TYP.) (at 24VDC)	Differential line driver level	4.1mA (TYP.) (at 24VDC)	
ON voltage/ON	current	19.0V or higher/5.0mA or higher (AM26LS31 (Manufactured by Texas Instruments Incorporated)		19.0V or higher/3.5mA or higher	
OFF voltage/OF	F current	8V or lower/1.5mA or lower	or equivalent)	8V or lower/1.0mA or lower	
Input resistance		3.8kΩ	, ,	5.6kΩ	
Response time	$\begin{array}{c} \text{Off} \rightarrow \text{On} \\ \\ \text{On} \rightarrow \text{Off} \end{array}$		Depending on the setting value of the input response time setting (0.01ms*2/0.1ms/0.2ms/0.4ms/0.6ms/1ms)		
Withstand voltage 510VAC for 1 minute between input terminal and internal power			supply (altitude: 0 to 2000m)		
Insulation resista	ance	$10M\Omega$ or higher between input terminals and internal power supply (500VDC insulation resistance tes			
Wiring method for	or common	Independent common	_	10 points/common	

^{*1} The response time at turning on → off of input devices can take 0.2ms even if the input response time is set to "0.1ms".

The following shows a temperature derating curve for the input signal.

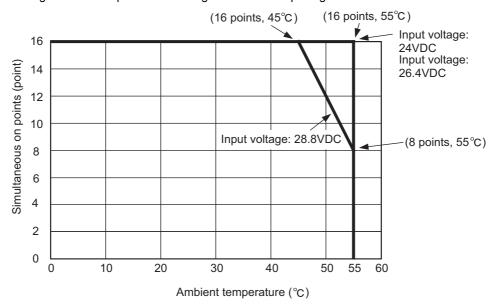



^{*2} The response time can take 0.02ms even if the input response time is set to "0.01ms".

(2) Output specifications

Item		Specifications	
Signal name		Output (OUT0 to OUT7)	
Rated load voltage	9	5 to 24VDC	
Maximum load cui	rent	0.1A/point	
Maximum voltage	drop at ON	0.2V (TYP.)	
Leakage current a	t OFF	0.1mA or lower	
Decrease time	On	1μs or less (rated load, resistive load)	
Response time Off		1μs or less (rated load, resistive load)	
Withstand voltage		510VAC for 1 minute between output terminal and internal power supply (altitude: 0 to 2000m)	
Insulation resistance		$10 M\Omega$ or higher between output terminals and internal power supply (500VDC insulation resistance tester)	
Wiring method for common		L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT: 8 points/common (sink type) L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT: 8 points/common (source type)	

(3) Signal assignment of the connector for external devices

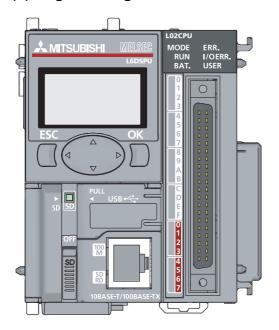



Viewed from the front of the module

(4) Internal circuits

(a) L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT

		D:			Signal name*2	
Classification	External wiring	Pin n	umber	Internal circuit	B line	A line
	24VDC - +	B20	A20	3.6kΩ	High-speed 24V input (IN0-24V)	High-speed 24V input (IN2-24V)
	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	B19	A19	1/2W 680Ω 220Ω * * * * *	High-speed differential input (IN0-DIFF)	High-speed differential input (IN2-DIFF)
		B18	A18	1/10W	High-speed input common (IN0-COM)	High-speed input common (IN2-COM)
	24VDC - +	B17	A17	3.6kΩ	High-speed 24V input (IN1-24V)	High-speed 24V input (IN3-24V)
		B16	A16	1/2W 220Ω * * * * * * * * * * * * * * * * * * *	High-speed differential input (N1-DIFF)	High-speed differential input (IN3-DIFF)
	127.7	B15	A15	1/10WU	High-speed input common (IN1-COM)	High-speed input common (IN3-COM)
	24VDC - +	B14	A14	3.6kΩ	High-speed 24V input (IN4-24V)	High-speed 24V input (IN5-24V)
Input	**	B13	A13	1/2W 680Ω 1/10W 220Ω 4 ¥ ‡	High-speed differential input (IN4-DIFF)	High-speed differential input (IN5-DIFF)
	[]	B12	A12	1/10WU # # #	High-speed input common (IN4-COM)	High-speed input common (IN5-COM)
	24VDC - + + -	B11	A11		Standard in (INC	
	1	B10	A10	1kΩ 1/10w 4 ± 5.6kΩ	Standard input (IN6)	Standard input (IN7)
	•	B09	A09	1/3W 1/10W 1/2 ± ζ 1/3W 1/3W 1/3W 1/3W 1/3W 1/3W 1/3W 1/3W	Standard input (IN8)	Standard input (IN9)
	•	B08	A08	1/10W ΔΨ ± ζ 5.6kΩ 1/3W 1kΩ 1 + δ ± ζ	Standard input (INA)	Standard input (INB)
	•	B07	A07	1/10W 4 + 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	Standard input (INC)	Standard input (IND)
		B06	A06	1/10W [144 + 4] 5.6kΩ 1/3W	Standard input (INE)	Standard input (INF)
	Load	B05	A05	Insulating element	Output (OUT0)	Output (OUT1)
	Load	B04	A04	Insulating element	Output (OUT2)	Output (OUT3)
Output	Load	B03	A03	Insulating element	Output (OUT4)	Output (OUT5)
	Load Fuse + ,-	B02	A02	Insulating element	Output (OUT6)	Output (OUT7)
	5 to 24VDC	B01	A01		Output commo	on (OUTCOM)

High-speed inputs can be connected based on the 24V input mode or differential input mode.

For signal names when using the positioning function or high-speed counter function, refer to the following.

<sup>Positioning function: Page 51, Section 7.2.1
High-speed counter function: Page 182, Section 8.2.1</sup>

(b) L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT

		D:			Signal name⁺²	
Classification	External wiring	Pin number		Internal circuit	B line	A line
	24VDC - +	B20	A20	3.6kΩ	High-speed 24V input (IN0-24V)	High-speed 24V input (IN2-24V)
		B19	A19	1/2W 680Ω 220Ω * * * * * *	High-speed differential input (IN0-DIFF)	High-speed differential input (IN2-DIFF)
	[\sum_{\sym_{\sym_{\sum_{\sym_{\sum_{\sym_\}\s\s\s\s\s\s\s\s\s\s\s\s\s\sum_\sym_\sym_\sym_\sym_\sym_\sym_\sym_\sy	B18	A18	1/10W T T T T	High-speed input common (IN0-COM)	High-speed input common (IN2-COM)
	24VDC - +	B17	A17	3.6kΩ	High-speed 24V input (IN1-24V)	High-speed 24V input (IN3-24V)
	\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\	B16	A16	1/2W 680Ω 220Ω * * * * *	High-speed differential input (IN1-DIFF)	High-speed differential input (IN3-DIFF)
		B15	A15	1/10W	High-speed input common (IN1-COM)	High-speed input common (IN3-COM)
	24VDC - +	B14	A14	3.6kΩ	High-speed 24V input (IN4-24V)	High-speed 24V input (IN5-24V)
Input		B13	A13	1/2W 220Ω ¥ ≠ 1/20W	High-speed differential input (IN4-DIFF)	High-speed differential input (IN5-DIFF)
		B12	A12	1/10W	High-speed input common (IN4-COM)	High-speed input common (IN5-COM)
	24VDC	B11	A11			out common OM)
	\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	B10	A10	1/10W 4 ± ξ	Standard input (IN6)	Standard input (IN7)
	•	B09	A09	1/3W 1/10W 4 ± ζ 5.6kΩ	Standard input (IN8)	Standard input (IN9)
	<u> </u>	B08	A08	1/3W 1/10W 4 ± ξ 5.6kΩ 1/3W 1kΩ 1 ± ξ	Standard input (INA)	Standard input (INB)
	•	B07	A07	1/3W 1/10W 4Ψ ± ξ 5.6kΩ 1/3W 1kΩ 1 try ± ξ	Standard input (INC)	Standard input (IND)
		B06	A06	1/10W 4 ± 5 5.6kΩ 1/3W	Standard input (INE)	Standard input (INF)
	Load	B05	A05	Insulating element	Output (OUT0)	Output (OUT1)
	Load	B04	A04	A Insulating element	Output (OUT2)	Output (OUT3)
Output	Load	B03	A03	Insulating element	Output (OUT4)	Output (OUT5)
	Load	B02	A02	Insulating element	Output (OUT6)	Output (OUT7)
	5 to 24VDC	B01	A01			common 724V)

^{*1} High-speed inputs can be connected based on the 24V input mode or differential input mode.

^{*2} For signal names when using the positioning function or high-speed counter function, refer to the following.

[•] Positioning function: 🖾 Page 51, Section 7.2.1

[•] High-speed counter function: Page 182, Section 8.2.1

(5) I/O connector pin numbers and corresponding I/O signals

Pin	Cate-	Туре	Correspondence	Corresponding	Pin	Cate-	Туре	Correspondence	Corresponding
number	gory	.,,,,,	for line driver	I/O signal	number	gory	-71	for line driver	I/O signal
B20		High-			A20		High-		
B19		speed	0	X0	A19		speed	0	X2
B18		ороса			A18		ороса		
B17		1.15 1-			A17		L C -d-		
B16		High- speed	0	X1	A16		High- speed	0	Х3
B15		эрсси			A15		эрсси		
B14					A14	,			
B13	Input	High- speed	0	X4	A13	Input	High- speed	0	X5
B12		speed			A12		speed		
B11		Input common			A11			Input commor	1
B10		Standard	_	X6	A10		Standard	_	X7
B09		Standard	_	X8	A09	,	Standard	_	X9
B08		Standard	_	XA	A08	,	Standard	_	XB
B07		Standard	_	XC	A07	,	Standard	_	XD
B06		Standard	_	XE	A06		Standard	_	XF
B05		High- speed	_	Y0	A05		High- speed	_	Y1
B04		High- speed	_	Y2	A04		High- speed	_	Y3
B03	Output	High- speed	_	Y4	A03	Output	High- speed	_	Y5
B02		High- speed	_	Y6	A02		High- speed	_	Y7
B01			Output commor	n*1	A01			Output commo	n ^{*1}

^{*1} B01 and A01 are used as negative common on the L02SCPU, L02CPU, L06CPU, L26CPU, and L26CPU-BT, while they are used as positive common on the L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, and L26CPU-PBT.

(6) Input signal assignment

 \bigcirc : Selectable, \times : No combination

F 4				Function	
External input signal	General- purpose input	Interrupt input	Pulse catch	High-speed counter	Positioning
X0 (High- speed)	0	O*1	0	Counter CH1 A Phase*1	×*3
X1 (High- speed)	0	O*1	0	Counter CH1 B Phase*1	×*3
X2 (High- speed)	0	O*1	0	Counter CH2 A Phase*1	×*3
X3 (High- speed)	0	O*1	0	Counter CH2 B Phase*1	×*3
X4 (High- speed)	0	0	0	Counter CH1 Z Phase*2	Axis #1 Zero Signal*2
X5 (High- speed)	0	0	0	Counter CH2 Z Phase*2	Axis #2 Zero Signal*2
X6 (Standard)	0	0	0	Counter CH1 Function Input ^{*2}	Axis #1 External Command Signal*2
X7 (Standard)	0	0	0	Counter CH2 Function Input*2	Axis #2 External Command Signal*2
X8 (Standard)	0	0	0	Counter CH1 Latch Counter*2	Axis #1 Drive Module READY Signal*2
X9 (Standard)	0	0	0	Counter CH2 Latch Counter*2	Axis #2 Drive Module READY Signal*2
XA (Standard)	0	0	0	×*3	Axis #1 Near-point Dog Signal*2
XB (Standard)	0	0	0	×*3	Axis #2 Near-point Dog Signal*2
XC (Standard)	0	0	0	×*3	Axis #1 Upper Limit Signal*2
XD (Standard)	0	0	0	×*3	Axis #2 Upper Limit Signal*2
XE (Standard)	0	0	0	×*3	Axis #1 Lower Limit Signal*2
XF (Standard)	0	0	0	×*3	Axis #2 Lower Limit Signal*2

^{*1} When using CH1 for the high-speed counter function, X0 and X1 cannot be used as interrupt inputs. Also, when using CH2 for the high-speed counter function, X2 and X3 cannot be used as interrupt inputs. Other functions such as the general-purpose input can be used.

^{*2} When this signal is not used, the input signal can be used for other functions such as the general-purpose input.

^{*3} When the high-speed counter function or positioning function is selected, this signal is not used for that function. This signal can be used for another function such as the general-purpose input function.

(7) Output signal assignment

○: Selectable, ×: No combination

	Function				
External output signal	General- purpose output	High-speed counter	Positioning		
Y0	0	CH1 Coincidence Output No.1*1	×*3		
Y1	0	CH2 Coincidence Output No.1*1	×*3		
Y2	0	CH1 Coincidence Output No.2*2	Axis #1 Deviation Counter Clear*1		
Y3	0	CH2 Coincidence Output No.2*2	Axis #2 Deviation Counter Clear*1		
Y4	0	×*3	Axis #1 CW/PULSE/A Phase Output ^{*1}		
Y5	0	×*3	Axis #2 CW/PULSE/A Phase Output*1		
Y6	0	×*3	Axis #1 CCW/SIGN/B Phase Output ^{*1}		
Y7	0	×*3	Axis #2 CCW/SIGN/B Phase Output*1		

^{*1} This signal must be used depending on parameter settings. When this signal is not used, the output signal can be used for the general-purpose output function.

^{*2} When this signal is not used, the output signal can be used for the general-purpose output function.

^{*3} When the high-speed counter function or positioning function is selected, this signal is not used for that function. This signal can be used for the general-purpose output function.

(8) Simplified chart of I/O signals

The following shows a simplified chart of I/O signals for the high-speed counter function and positioning function.

High-spee	ed counter	Positioning		
CH1	CH2	Axis #1	Axis #2	
		X4	X5	
X0	X2	X6	X7	
X1	X3	X8	X9	
X4	X5	XA	ХВ	
X6	X7	XC	XD	
X8	X9	XE	XF	
Y0	Y1	Y2	Y3	
Y2	Y3	Y4	Y5	
		Y6	Y7	

(9) External input signals (X0 to XF) when using the functions

The on/off status of the external input signals (X0 to XF) are reflected to the input device (X0 to XF) in the program when any built-in I/O functions (except the pulse catch function) is used. When the pulse catch function is used, the input device turns on for one scan by detecting the rising edge of the external input signal (Page 39, CHAPTER 6). When selecting positioning function or high-speed counter function, an input signal that is not used due to settings of the functions operates as the general-purpose input.



The IN0 to IN F LEDs indicate status of the external input signals (X0 to XF). However, the indicating status is not affected by turning on or off the input device (X0 to XF) in the program.

(10)External output signals (Y0 to Y7) when using the functions

The external output signals (Y0 to Y7) reflect the output status of the function selected from the general-purpose output, positioning, and high-speed counter functions. Therefore, the output status are not affected by turning on or off the output device (Y0 to Y7) in the program when the output signals are used for the positioning or high-speed counter function.

The output device (Y0 to Y7) do not reflect the status of the output signals used for the positioning or high-speed counter function.




The OUT 0 to OUT 7 LEDs indicate status of the external output signals. So the output status of the output device (Y0 to Y7) are indicated when the output signals are used for the general-purpose output function. Actual output status of the positioning or high-speed counter function are indicated when the output signals are used for those functions. (The indicating status is not affected by turning on or off the output device in the program.)

(11) Monitoring by the programming tool

To check the I/O settings, open the "I/O Monitor" window by using the programming tool.

[Tool] ⇒ [Built-in I/O Module Tool]

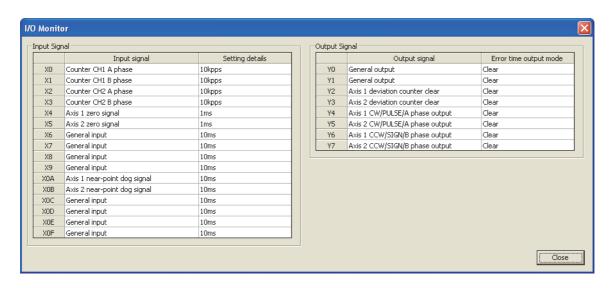

For details, refer to the followings. GX Works2 Version 1 Operating Manual (Common)

CHAPTER 3 GENERAL-PURPOSE INPUT FUNCTION

This function uses the built-in external input signals (16 points) as general-purpose inputs to read the on/off status of external devices such as switches and sensors. The on/off status of the external input signals are refreshed to the input device (X0 to XF) and used in programs.

(1) Parameter setting

Set the input signals and input response time values.


Project window

[Parameter]

[PLC Parameter]

"Built-in I/O Function Setting" tab

Select a response time.

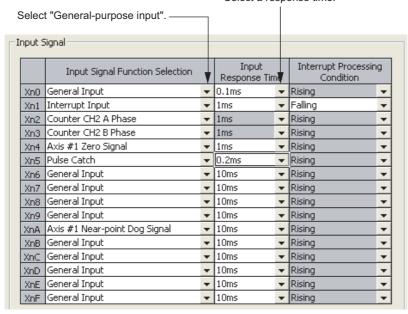

(2) External input signal types

The following two types are available.

- · High-speed input: X0 to X5 (6 points)
- Standard input: X6 to XF (10 points)

(3) Read timing of external input signals

The on/off status of the external input signals are refreshed to the input device (X0 to XF) at execution of the END instruction. Therefore, a delay for one scan (maximum) occurs from when an external input signal changes until when the input device turns on.

(4) Direct input

By using the direct input device (DX0 to DXF) for the external input signals, the external input status can be loaded at execution of sequence instructions using the direct input device.

(5) Partial refresh

The LCPU can read the current external input status by executing partial refresh using the RFS instruction to the input device (X0 to XF). For the RFS instruction, refer to the following.

MELSEC-Q/L Programming Manual (Common Instruction)

(6) Performance specifications

The following is the performance specifications of the general-purpose output function.

	Item		Description	
	Points		10	
	Input voltage/current		24VDC, 4.1mA (TYP.)	
Standard input	Minimum input response time		Depending on the setting value of the input response time	
	Input response time setting		0.1ms ^{*2} /1ms/5ms/10ms/20ms/70ms	
	Points		6	
		DC input	24VDC, 6.0mA (TYP.)	
High-speed input	Input voltage/current	Differential input	EIA Standard RS-422-A Differential line driver level (AM26LS31 (manufactured by Texas Instruments Incorporated) or equivalent)	
	Minimum input response time		Depending on the setting value of the input response time	
	Input response time setting*1		0.01ms ^{*3} /0.1ms/0.2ms/0.4ms/0.6ms/1ms	

^{*1} The shorter the input response time is, the more the module is susceptible to noise. When setting the input response time, check that the module will not be affected by noise. For details on measures against noise, refer to the following.

MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection)

^{*2} The response time at turning on → off of input devices can take 0.2ms even if the input response time is set to "0.1ms".

^{*3} The response time can take 0.02ms even if the input response time is set to "0.01ms".


CHAPTER 4 GENERAL-PURPOSE OUTPUT FUNCTION

This function uses the built-in external output signals (8 points) as general-purpose outputs for external devices such as lamps. By turning on/off the output device (Y0 to Y7) in programs, the LCPU can output the signals externally.

(1) Parameter setting

Set the output signals and error time output mode.

Project window ⇒ [Parameter] ⇒ [PLC Parameter] ⇒ "Built-in I/O Function Setting" tab

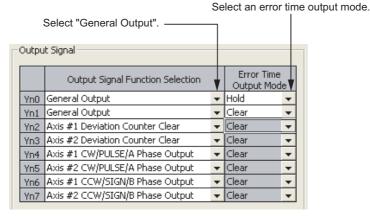

(2) External output timing

On/off status of the output device are refreshed to the external outputs (Y0 to YF) at execution of the END instruction. Therefore, a delay for one scan (maximum) occurs from when an external device turns on/off in programs until when the on/off status is refreshed to the external output.

(3) Direct output

When using the output device (Y0 to Y7) for the direct output device (DY0 to DY7), on/off status of the device are refreshed to the external outputs by using the instruction such as the SET instruction.

(4) Partial refresh

The output device status (only specified range) is refreshed to the external output by executing partial refresh using the RFS instruction to the output device (Y0 to Y7) (MELSEC-Q/L Programming Manual (Common Instruction)).

(5) Error time output mode

Select the output mode (Hold or Clear) for the output status of the output device (Y0 to Y7) when an error to stop the program occurs. (This is not the setting for outputs to the output modules and the intelligent function modules. For details on the error time output mode setting for modules, refer to the following. MELSEC-L CPU Module User's Manual (Function Explanation, Program Fundamentals)

(6) Performance specifications

The following is the performance specifications of the general-purpose output function.

ltem		Description			
		L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT	L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT		
Output type		Sink type	Source type		
Points		8			
Output voltage/current 5 to 24VDC, 0.1A			DC, 0.1A		
On On		1μs or less (rated load, resistive load)			
Response time	Off	1μs or less (rated load, resistive load)			


CHAPTER 5 INTERRUPT INPUT FUNCTION

This function executes an interrupt program when triggered by the input signal (X0 to XF).

(1) Parameter setting

Set the input signals, input response time values, and interrupt processing condition.

Project window ⇒ [Parameter] ⇒ [PLC Parameter] ⇒ "Built-in I/O Function Setting" tab

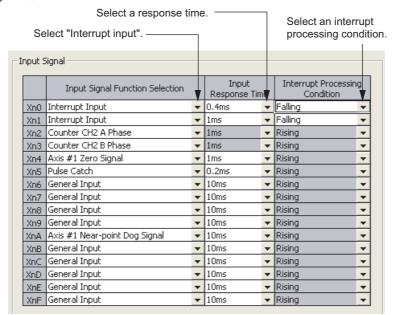

(2) Interrupt pointer assignment and interrupt priority

The following shows interrupt pointers corresponding to input signals (X0 to XF).


I/O signal	Interrupt pointer	Priority ^{*1}
X0	10	5
X1	I1	6
X2	I2	7
Х3	13	8
X4	14	9
X5	15	10
X6	16	11
X7	17	12
X8	18	13
Х9	19	14
XA	I10	15
ХВ	I11	16
XC	l12	17
XD	l13	18
XE	l14	19
XF	I15	20

^{*1} The priority 1 to 4 are used for interrupt pointers I28 to I31 (interrupt by build-in timers).

Interrupt pointer numbers can be changed. (Fig. Page 37, (2) (a))

(a) Changing the interrupt pointer numbers

- 1. Click the Interrupt Pointer Setting button in the "PLC System" tab.
 - Project window ⇒ [Parameter] ⇒ [PLC Parameter] ⇒ "PLC System" tab
- 2. Set the interrupt pointer start No., interrupt pointer count, start I/O No., and start SI No.
- 3. Click the _____ button to exit.
- Ex. When assigning the interrupt inputs X0 and X1 to the interrupt pointers I50 and later

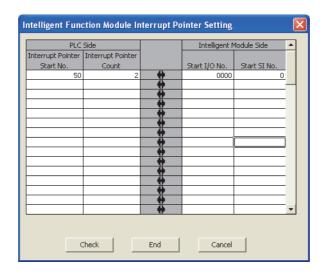


· Precautions

When the range of interrupt input that is specified in the "Intelligent Function Module Interrupt Pointer Setting" and the interrupt input is not selected for the built-in I/O function in the range, "PARAMETER ERROR" (error cord: 3000) occurs. The following shows a correct example and an incorrect example of assigning the interrupt inputs to the interrupt pointers I50 and later as shown above.

Correct example
 As shown below, the interrupt inputs are set within the range specified in "Intelligent Function Module Interrupt Pointer Setting", so the error will not occur.


Input signal function selection: Interrupt input is set to X0 and X1.



· Incorrect example

As shown below, input signal X2 and X3 are set to the interrupt inputs, but no interrupt input is set within the range specified in "Intelligent Function Module Interrupt Pointer Setting", so the error will occur.

Input signal function selection: X2 and X3 are set to the interrupt inputs.



(3) Interrupt processing condition

The following table lists three types of conditions to execute the interrupt programs by the interrupt inputs.

Interrupt processing condition	Description	
Rising edge	The interrupt program is executed at the rising edge of the interrupt input signal.	
Falling edge	The interrupt program is executed at the falling edge of the interrupt input signal.	
Rising edge + Falling edge	The interrupt program is executed at both the rising edge and the falling edge of the interrupt input signal.	

When the condition is set to "Rising edge + Falling edge", an interrupt factor occurred during execution of an interrupt program is held only once, and the second and subsequent factors are ignored. When the second rising edge (falling edge) of the signal is detected after the falling edge (rising edge) during execution of the interrupt program due to the first one, the second one cannot execute the interrupt program. To avoid this, keep an enough interval between on and off of the interrupt input.

In addition, a continuous interrupt input of signals with a short ON width and OFF width causes frequent halts of the main routine program. Adjust the ON width and OFF width for interrupt input not to interfere with the execution of the main routine program.

(4) Interrupt enable/disable

Use the EI instruction to enable the interrupt. Also, use the DI instruction to disable interrupt, and the IMASK instruction to mask the interrupt program. (MELSEC-Q/L Programming Manual (Common Instruction))

(5) Performance specifications

The following is the performance specifications of the interrupt input function.

	Item		Description	
	Points		10	
	Input voltage/current		24VDC, 4.1mA (TYP.)	
Standard input	Minimum input response time		Depending on the setting value of the input response time setting	
	Input response time setting		0.1ms ^{*1} /1ms/5ms/10ms/20ms/70ms	
	Points		6	
		DC input	24VDC, 6.0mA (TYP.)	
High-speed input	Input voltage/current	Differential input	EIA Standard RS-422-A Differential line driver level (AM26LS31 (manufactured by Texas Instruments Incorporated) or equivalent)	
	Minimum input response time		Depending on the setting value of the input response time setting	
	Input response time setting		0.01ms ^{*2} /0.1ms/0.2ms/0.4ms/0.6ms/1ms	

^{*1} The response time at turning on → off of input devices can take 0.2ms even if the input response time is set to "0.1ms".

^{*2} The response time can take 0.02ms even if the input response time is set to "0.01ms".

CHAPTER 6 PULSE CATCH FUNCTION


This function can catch pulse signals that the general-purpose input function cannot catch because the on time is shorter than the scan time.

(1) Parameter setting

Set the input signals and input response time values.

Project window

□ [Parameter] □ [PLC Parameter] □ "Built-in I/O Function Setting" tab

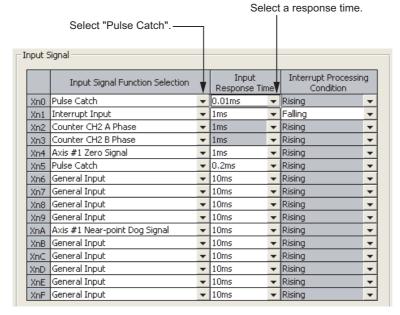


(2) Basic operation of the pulse catch function

The function turns on the input device for one scan after detecting a pulse signal, and turns off the input device during the END processing.


(a) Operation when using an input signal (X0) as the pulse catch function

The input device turns on for one scan after detecting a rising edge of the external input signal (X0).

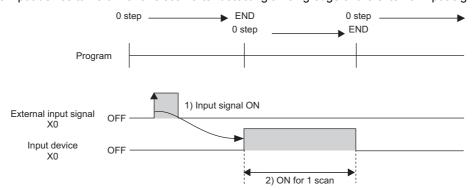


(b) Operation when detecting more than one pulse in one scan

Second pulse and later are ignored. Input pulse signals at intervals of one scan or more.

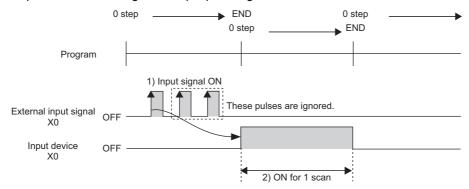


Point P

To count the second and third pulse inputs, use the interrupt input function. However, if the third pulse is detected before the end of the execution of the interrupt program, the pulse cannot be counted.

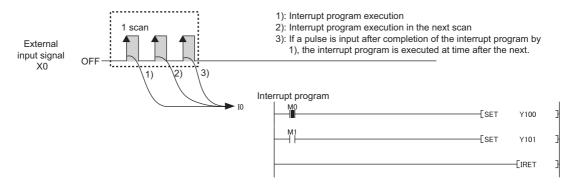


(c) Operation when detecting same pulse in two scans or more

The input device turns on for scans by the number of detected pulses. Input pulse signals at intervals of one scan or more.

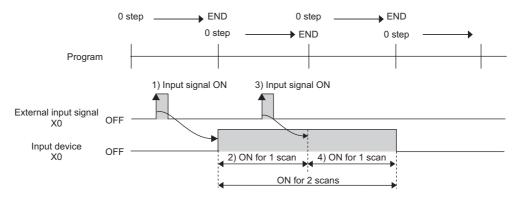

(d) Operation when detecting a pulse that has on width of two scans or more

The input device turns on for one scan.

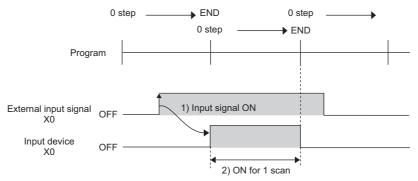

(3) Detectable pulse width

Pulse width that meets the following condition can be detected.

ON or OFF width of the pulse input > Input response time

When the condition is not met, the pulse cannot be detected correctly. Set the input response time values to meet the condition.

(4) Precautions

Avoid the following actions for the input device (X0 to XF) that is set to the pulse catch function.

Otherwise, the input device does not turn on correctly for one scan after detecting a pulse.

- · Use of the direct device (DX)
- Execution of the instruction that performs input refresh at execution, such as RFS, COM, CCOM(P), and MTR

(5) Performance specifications

The following is the performance specifications of the pulse catch function.

Item			Description	
	Points		10	
	Input voltage/current		24VDC, 4.1mA (TYP.)	
Standard input	Minimum input response time		Depending on the setting value of the input response time setting	
	Input response time setting		0.1ms ^{*1} /1ms/5ms/10ms/20ms/70ms	
	Points		6	
		DC input	24VDC, 6.0mA (TYP.)	
High-speed input	Input voltage/current	Differential input	EIA Standard RS-422-A Differential line driver level (AM26LS31 (manufactured by Texas Instruments Incorporated) or equivalent)	
	Minimum input response time		Depending on the setting value of the input response time setting	
	Input response time setting		0.01ms ^{*2} /0.1ms/0.2ms/0.4ms/0.6ms/1ms	

The response time at turning on \rightarrow off of input devices can take 0.2ms even if the input response time is set to "0.1ms".

^{*2} The response time can take 0.02ms even if the input response time is set to "0.01ms".

CHAPTER 7 POSITIONING FUNCTION


7.1 Overview

(1) Definition

This function is used to move a table, machining target, tool, or other moving body (workpiece) at a specified speed with the purpose of stopping it accurately at a target position.

(2) Features

The positioning function is controlled by dedicated instructions.

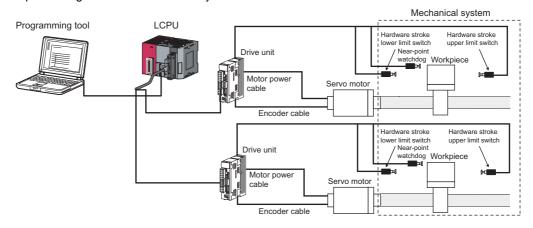

(a) 2-axis control

Two drive units (two motors) can be connected and two coordinates can be controlled independently or simultaneously.

(b) OPR (Original point return)

Six types of OPR methods are available. A near-point dog (OP sensor) can be used to establish the OP (position that becomes the starting point of each control) and "address" of this position. (Machine OPR) OPR can also be performed automatically within the range defined by the upper and lower limit switches. (OPR retry function)

(c) Target position and speed

- The workpiece can be moved to the target position based on a specified address or movement amount.
 (Position control)
- · The workpiece can be moved until a stop instruction is executed. (Speed control)
- The current position can be changed to a specified value. (Current value change function)
- The target position can be changed while the workpiece is moving. (Target position change function)
- · The speed can be changed while the workpiece is moving. (Speed change function)

(d) Limitation of the moving range of the workpiece

Desired positions can be set as the logical upper limit and lower limit of the moving range of the workpiece, without using switches. (Software stroke limit function)

Also, upper and lower limit switches can be used to limit the moving range. (Hardware stroke limit function)

(e) JOG operation

The workpiece can be moved to a desired position according to the pulses that are output continuously while a JOG operation instruction is executed. (JOG operation function)

(f) Absolute position detection

A servomotor with absolute position detector can be used to restore the current position after a power failure. (Absolute position restoration function)


(3) Function list

The following table lists and describes functions available for the positioning function.

	Item	Description	Reference
ODD souted	Machine OPR	A function to mechanically establish the reference point (OP) for positioning control using a near-point dog or stopper	Page 71, Section 7.6.1
OPR control	Fast OPR	A function to execute positioning control to the OP address stored by machine OPR or standby address that has been set	Page 89, Section 7.6.2
	Position control (1-axis linear control)	A function to execute positioning control to a specified position according to the address or movement amount set by positioning data	Page 97, Section 7.7.2
Positioning control	Speed/position switching control	A function to start under speed control and then switch to position control (positioning control based on specified movement amount) via an external command signal	Page 98, Section 7.7.3
Control	Current value change function	A function to change the address (current feed value)	
	Speed control	A function to implement positioning control via operation at a specified speed	Page 101, Section 7.7.5
Multiple axes	simultaneous start control	A function to start two axes simultaneously at the pulse output level	Page 102, Section 7.8
JOG o	operation function	A function to output pulses only while a JOG start instruction(IPJOG1) is executed to move the workpiece to a desired position	Page 104, Section 7.9
	OPR retry function	A function to perform machine OPR automatically by detecting an off edge of the limit signal and moving to a position where machine OPR is possible, even when the OP is not located in the OPR direction	Page 110, Section 7.10.1
	Speed limit function	A function to limit the speed to within the setting range of speed limit when the operating speed exceeds the positioning parameter "Speed Limit Value"	Page 114, Section 7.10.2
	Speed change function	A function to change the speed during operation	Page 115, Section 7.10.3
Sub function	Software stroke limit function	A function to not start operation when a start instruction is given to move to the target position which is outside the range set by the upper stroke limit and lower stroke limit. The limit function also stops operation when the current position (current feed value) deviates from the setting range.	Page 120, Section 7.10.4
	Hardware stroke limit function	A function to decelerate the axis to a stop using a limit switch connected to the connector for external devices	Page 123, Section 7.10.5
	Target position change function	A function to change the address or movement amount during positioning control	Page 124, Section 7.10.6
	Acceleration/deceleration processing function	A function to adjust the acceleration/deceleration processing as part of control	Page 128, Section 7.10.7
	Stop processing function	A function to control the stopping method to be applied when a stop cause occurs during operation	Page 130, Section 7.10.8
Absolute position restoration function		A function to restore the current position (current feed value) using a servomotor with absolute position detector, without executing machine OPR, in the event such as a momentary power failure or emergency stop. (Connectable servo amplifiers are limited to those products in the general-purpose AC servo MEL SERVO series (pulse-train type) supporting absolute position detection systems.)	Page 133, Section 7.11


(4) Mechanism of a positioning control system

Positioning control is implemented based on pulses output from the LCPU. In a positioning system, software and external devices are used to perform the roles shown below.

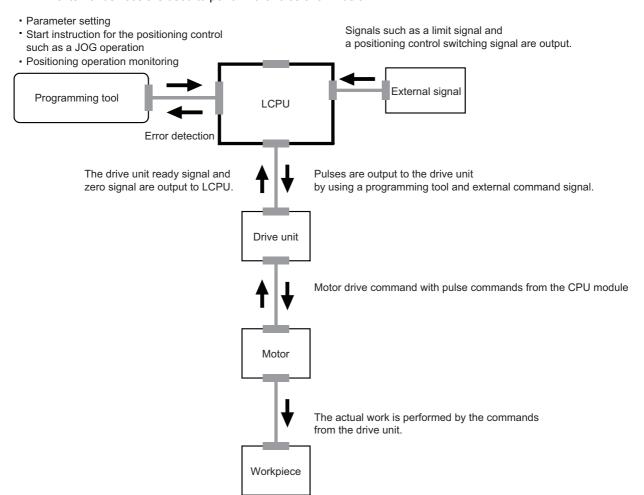

(5) Operation inside the drive unit

After receiving a pulse input from the LCPU, the following operations occur in the drive unit.

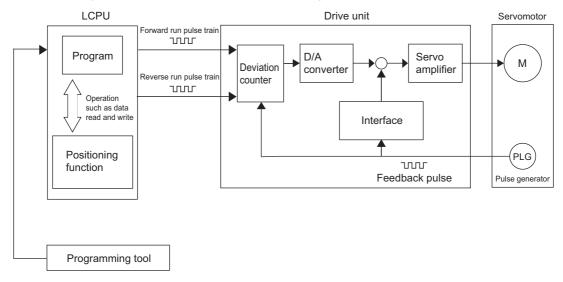

(a) Starting

When pulses are output from the LCPU, the input pulses are retained in the deviation counter of the drive unit. The integration value of this pulse (droop pulse) is converted to an analog DC voltage by the D/A converter to give a speed command for the servomotor (M). The servomotor starts rotating by the speed command from the drive unit.

(b) During operation

As the servomotor rotates, the pulse generator (PLG) supplied with the servomotor generates feedback pulses in proportion to the speed. The generated feedback pulses are fed back to the drive unit and the deviation counter droop pulse are decremented accordingly. The servomotor continues to rotate with the deviation counter maintaining a certain amount of droop pulses.

(c) Stopping

When the command pulse output from the LCPU stops, the deviation counter droop pulse decrease and the speed drops. The servomotor stops once the droop pulses become 0.

The rotation speed of the servomotor is proportional to the command pulse frequency, while the rotation angle of the servomotor is proportional to the number of output command pulses. Therefore, the workpiece can be fed to a position proportional to the number of pulses in the pulse train by specifying the movement amount per pulse beforehand. Note that the pulse frequency defines the rotation speed of the servomotor (feed speed).

(6) Principles of position control and speed control

(a) Position control


The total No. of pulses needed to move a specified distance can be obtained by the formula below.

*1 Encoder resolution

Give the calculated total No. of pulses to the drive unit from the LCPU, and the workpiece will be controlled to move the specified distance. Note that the movement amount of the machine when one pulse is output to the drive unit is called "movement amount per pulse." This value corresponds to the minimum movement of the workpiece and determines the accuracy of electrical positioning control.

(b) Speed control

The speed is controlled by the "pulse frequency" output to the drive unit from the LCPU.

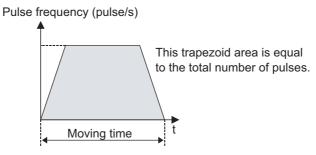


Point P

- The value of "movement amount per pulse" is determined by the machine.
- The LCPU controls the position and speed based on the "total No. of pulses" and "pulse frequency," respectively.


(7) Pulses output from the LCPU

- Pulse trains are sparse when the servomotor is accelerating, and become denser as the servomotor approaches the stable speed that has been set.
- At the stable speed, constant pulse trains are output.
- When the pulses output from the LCPU become sparse, the servomotor decelerates until pulses are no
 longer output. There is a slight delay from the LCPU command pulses to the time the servomotor
 decelerates and stops. This difference is necessary to ensure sufficient stopping accuracy and is referred to
 as the "stop setting time"

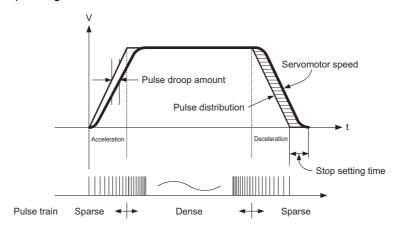


(8) Movement amount and speed of a worm gear system

This section describes methods of calculations required for positioning control by using worm gear system. The worm gear consists of a balls lined up in an engagement part, just like a ball bearing. The ball screw has no backlash and can rotate with a small force.



The calculations are performed based on the system described below.

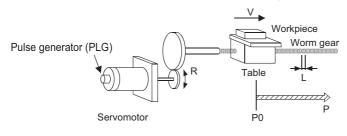

- A: Movement amount per pulse (mm/pulse)
- Vs : Command pulse frequency (pulse/s)
- n: Pulse generator resolution (pulse/rev)
- L: Worm gear lead (mm/rev)
- R: Deceleration ratio
- / : Movable section speed (mm/s)
- N: Motor speed (r/min)
- K: Position loop gain (1/s)
- ε : Deviation counter droop pulse amount
- P0 : OP (pulse)
- P: Address (pulse)

(a) Movement amount per pulse

Calculated from the worm gear lead, deceleration ratio, and pulse generator resolution.

$$A = \frac{L}{R \times n}$$
 (mm/pulse)

The movement amount is calculated by (Number of output pulses) x (Movement amount per pulse).

(b) Command pulse frequency

Calculated from the movable section speed and movement amount per pulse.

$$Vs = \frac{V}{A}$$
 (pulse/s)


(c) Deviation counter droop pulse amount


Calculated from the command pulse frequency and position loop gain*1.

$$\varepsilon = \frac{Vs}{\kappa}$$
 (pulse

*1 Ratio of the command pulse frequency to the number of deviation counter droop pulses. A desired position loop gain can be set adjusting the drive unit. To improve the stopping accuracy, increase the gain. Note, however, that an excessively high gain may cause overshooting (beyond the target position) and make the operation unstable. An excessively low gain increases the stopping error, although the movement becomes smoother at stopping.

7.1.1 Procedure for performing the positioning function



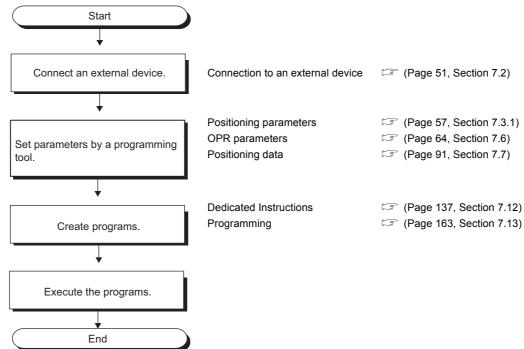


7.2 Connection to External Devices

7.2.1 I/O signals

The following shows the simplified diagrams of the internal circuits of LCPU external device connection interface. "□" in the signal name indicates either 1 (Axis 1) or 2 (Axis 2). For I/O signal settings, refer to 🖙 Page 56, Section 7.3.

(1) Input

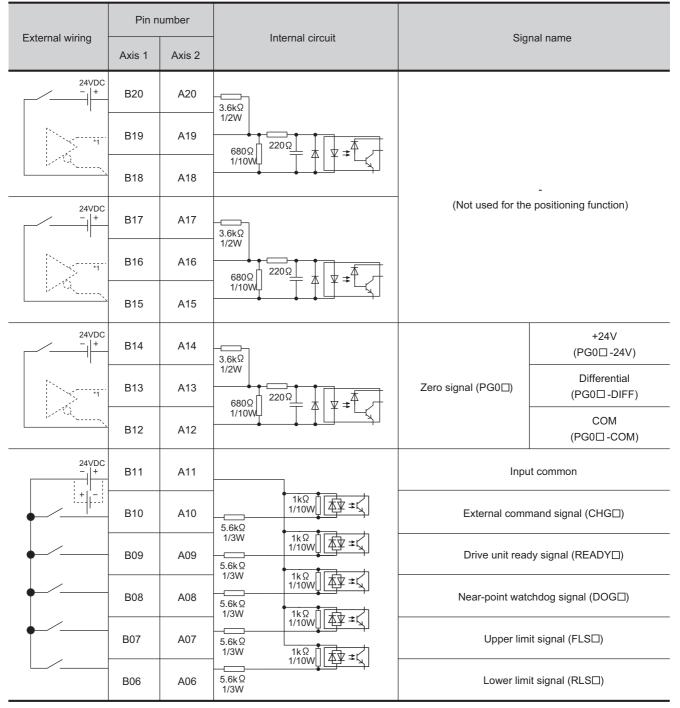

^{*1} High-speed inputs can be connected based on the 24V input mode or differential input mode.

(2) Output

(a) L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT

Pin nu	Pin number		Cinnal name
Axis 1	Axis 2	internal circuit	Signal name
B05	A05	Insulating element	- (Not used for the positioning function)
B04	A04	Insulating element	Deviation counter clear signal (CLEAR□)
B03	A03	Insulating element	CW/PULSE/A phase output (PULSE F□)
B02	A02	Insulating	CCW/SIGN/B phase output (PULSE R□)
B01	A01	element	Output common

(b) L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT

Pin nu	ımber	Internal circuit	Signal name
Axis 1	Axis 2	internal circuit	Signal name
B05	A05	Insulating element	- (Not used for the positioning function)
B04	A04	Insulating element	Deviation counter clear signal (CLEAR□)
B03	A03	Insulating element	CW/PULSE/A phase output (PULSE F□)
B02	A02	Insulating element	CCW/SIGN/B phase output (PULSE R□)
B01	A01		Output common

(3) Details of I/O signals

The following table lists and describes the I/O signals of the connector for LCPU external devices.

Category	Signal name	Description
	Zero signal (PG0□)	 The zero signal from the pulse generator is used to input the OP signal for performing the machine OPR. This signal is also used to indicate the completion of the machine OPR that uses a stopper method for the machine OPR method. This signal is detected at the leading edge.
	Input common	Common line for the external command signals, drive unit ready signal, near-point dog signal, upper limit signal and lower limit signal
	External command signal (CHG□)	Used to input control switching signals in speed/position switching control.
Input	Drive unit ready signal (READY□)	 This signal turns on when the drive unit is normal and able to accept pulses. The LCPU checks this signal and if the drive unit is not ready, it turns on the Axis 1 OPR request (SM1842). This signal turns off if the drive unit is inoperable, like when the control power supply of the drive unit failed. If this signal is turned off during positioning, the system stops. The system does not start even if this signal is turned on again. When this signal turns off, the Axis 1 OPR completion (SM1843) also turns off. If this signal is not selected for the input signal function selection, the signal is regarded as being on.
	Near-point dog signal (DOG□)	This signal is used to detect the near-point dog during machine OPR. The near-point dog signal is detected at the leading edge.
	Upper limit signal (FLS□)	 The signal is input from the limit switch installed at the upper limit position of the stroke. When this signal turns off, positioning stops. This signal defines the upper limit which is used to find the near-point dog when the OPR retry function is enabled. If this signal is not selected for the input signal function selection, the signal is regarded as being on.
	Lower limit signal (RLS□)	 The signal is input from the limit switch installed at the lower limit position of the stroke. When this signal turns off, positioning stops. This signal defines the lower limit which is used to find the near-point dog when the OPR retry function is enabled. If this signal is not selected for the input signal function selection, the signal is regarded as being on.
	Deviation counter clear signal (CLEAR□)	This signal is output during machine OPR. (Count 2 is excluded.) For the drive unit, use a model capable of resetting the internal deviation counter droop pulse amount when the LCPU turns this signal on.
Output	CW/PULSE/A phase output (PULSE F□) CCW/SIGN/B phase output (PULSE R□)	- These signals are output as positioning pulses with pulse code to the drive unit.
	Output common	Common line for the deviation counter clear signal, CW/PULSE/phase A outputs and CCW/SIGN/phase B outputs.

(4) On/off status of input signals

(a) On/off status of input signals

On/off status of input signals is determined according to external wiring.

Signal name	External wiring	Signal on/off status as viewed from LCPU
High-speed input	(Photocoupler OFF) 24VDC - +	OFF
INO to IN5	(Photocoupler ON) 24VDC - +	ON
Standard input	(Photocoupler OFF) 24VDC	OFF
IN6 to INF	(Photocoupler ON) INn 24VDC - + - IN - COM (n = 6 to F)	ON

In the context of the LCPU's positioning function, the status shown above are defined as representing the "negative logic".

(b) Internal circuit

With the LCPU, the "input signal OFF" status is defined as the off status of the corresponding internal circuit (photocoupler).

Voltage not applied: Photocoupler OFF

· Voltage applied: Photocoupler ON


7.2.2 Wiring

For connectors used for external wiring, refer to MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection). For examples of connection with servo amplifiers, refer to Page 271, Appendix 2.

7.3 Parameter Setting


Set parameters for each axis.

- 1. Click the Positioning Axis #1 Setting button in the "Built-in I/O Function Setting" tab.
 - Project window⇒[Parameter]⇒[PLC Parameter]⇒"Built-in I/O Function Setting" tab
- Select the "Use positioning function (Axis #1)" checkbox on the top left on the "Positioning Axis #1 Detailed Setting" window.
- 3. Configure required settings.
- 4. Click the End button to exit.

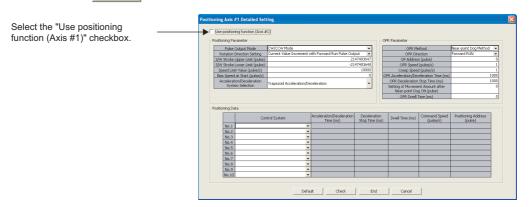

Item	Description	Reference
Positioning Parameter	These parameters define data that must be set upon system start-up according to the drive unit, motor and system configuration used.	Page 57, Section 7.3.1
OPR Parameter	These parameters define data used in OPR control.	Page 64, Section 7.6
Positioning Data	A group of data required in a single positioning operation.	Page 91, Section 7.7

When the setting is complete, the necessary external signals are assigned automatically. The drive unit ready signal and limit signals should be set as necessary. Set the input response time for input signals. The Error time output mode is fixed to "Clear.

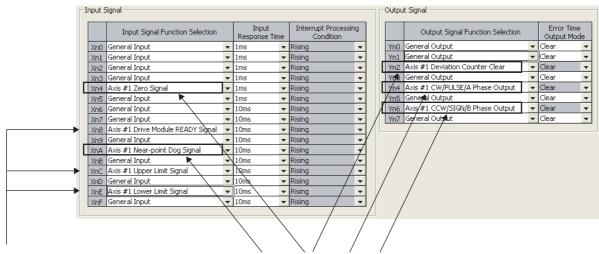

Select an option from the pull-down menu as necessary. According to the settings, external signals are assigned.

7.3.1 Positioning parameters

Positioning parameters are common to all controls. Set these parameters for each axis.

Setting item	Setting range	Default	
	CW/CCW Mode		
Pulgo Output Modo	PULSE/SIGN Mode	CW/CCW Mode	
Pulse Output Mode	A Phase/B Phase Mode (Multiple of 1)	CW/CCW Mode	
	A Phase/B Phase Mode (Multiple of 4)		
	Current Value Increment with Forward Run		
Rotation Direction Setting	Pulse Output	Current Value Increment with Forward	
Notation Direction detailing	Current Value Increment with Reverse Run	Run Pulse Output	
	Pulse Output		
S/W Stroke Upper Limit (pulse)	-2147483648 to 2147483647	2147483647	
S/W Stroke Lower Limit (pulse)	-2147400040 to 2147400047	-2147483648	
Speed Limit Value (pulse/s)	1 to 200000	10000	
Bias Speed at Start (pulse/s)	0 to 200000	0	
Appleration/Deceleration System Selection	Trapezoid Acceleration/Deceleration	Transpaid Assolutation/Decoloration	
Acceleration/Deceleration System Selection	S-curve Acceleration/Deceleration	Trapezoid Acceleration/Deceleration	

Executable controls and corresponding positioning parameters are shown below.

 \bigcirc : Must be set, \triangle : Set as necessary, —: Need not be set


		Positioning control			JOG	
Positioning parameter	OPR control	Position control	Speed control	Speed/position switching control	Current value change	operation
Pulse Output Mode	0	0	0	0	0	0
Rotation Direction Setting	0	0	0	0	0	0
S/W Stroke Upper Limit (pulse)	_	Δ	Δ	Δ	Δ	Δ
S/W Stroke Lower Limit (pulse)	_	Δ	Δ	Δ	Δ	Δ
Speed Limit Value (pulse/s)	0	0	0	0	_	0
Bias Speed at Start (pulse/s)	Δ	Δ	Δ	Δ	_	Δ
Acceleration/Deceleration System Selection	Δ	Δ	Δ	Δ	_	Δ

(1) Pulse output mode

Set the pulse output mode applicable to the drive unit used.

(a) CW/CCW mode


Forward run feed pulses (CW) are output when the motor is rotating forward. Reverse run feed pulses (CCW) are output when the motor is rotating in reverse.

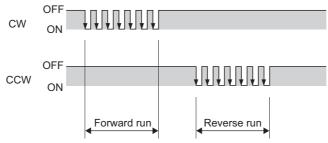


(b) PULSE/SIGN mode

Forward/reverse control is based on on/off of the direction sign (SIGN).

- · The direction sign turns on when the motor is rotating forward.
- The direction sign turns off when the motor is rotating in reverse.

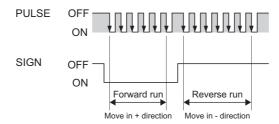


For CCW, pulses are output 100 µs after the direction sign turns off.

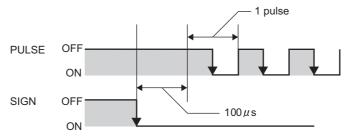


(c) A phase/B phase mode (multiple of 1), A phase/B phase mode (multiple of 4)

Forward/reverse control is based on the difference between phase A (A ϕ) and phase B (B ϕ).

- Phase B lags phase A by 90° when the motor is rotating forward.
- Phase A lags phase B by 90° when the motor is rotating in reverse.
 - When "A Phase/B Phase Mode (Multiple of 1)" is set

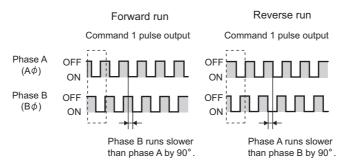

- Ex. When one command pulse output corresponds to 1 pulse/s, there are four leading/trailing edges per second.
 - · When "A Phase/B Phase Mode (Multiple of 4)" is set

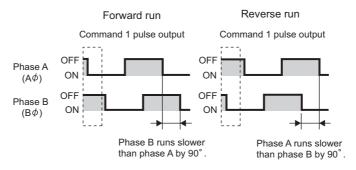


Ex. When one command pulse output corresponds to 1 pulse/s, there is one leading/trailing edge per second.

(2) Rotation direction setting

Set how the current position would increase/decrease in each rotation direction of the motor. Check the settings by JOG operation. (Page 104, Section 7.9)

- Set "Current Value Increment with Forward Run Pulse Output" for the rotation direction setting and perform forward JOG operation.
- 2. If the workpiece moves in the address decreasing direction defined by the system, set "Current Value Increment with Reverse Run Pulse Output" for the rotation direction setting to change the rotation direction. (If the workpiece moves in the address increasing direction defined by the system, the current setting need not be changed.)
- 3. Perform forward JOG operation again and if the workpiece (W) moves in the address increasing direction, the setting is complete.

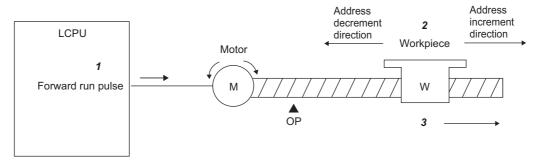


Point P

If Rotation Direction Setting was changed from "Current Value Increment with Forward Run Pulse Output" to "Current Value Increment with Reverse Run Pulse Output," perform JOG operation to check if the upper limit switch and lower limit switch operate correctly. If any operation problem was found, review the wirings.

(3) S/W stroke upper limit, S/W stroke lower limit

Set the upper/lower limits of the moving range of the workpiece.

- Set the software stroke limits according to the condition specified below:
 Software stroke lower limit < Software stroke upper limit
- To disable the software stroke limits, set the same value for both the upper limit and lower limit. (Desired
 values can be set as long as they are within the setting range.)

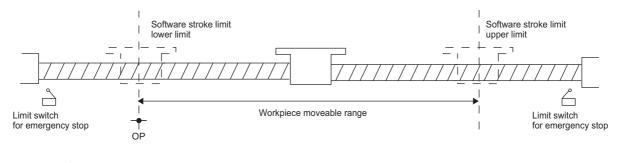

Remark

In general, the OP is set at the lower limit or upper limit of the software stroke.

(4) Speed limit value

Set the maximum speed for OPR control, positioning control and JOG operation. If any of the following settings exceeds the speed limit, the speed is limited to the specified limit.

- · OPR speed
- · Command speed
- · JOG speed
- · New speed value
- · Bias speed at start

The speed limit is determined by the two conditions below:

- · Motor speed
- · Moving speed of the workpiece


(5) Bias speed at start

Set the minimum speed for OPR control, positioning control, and JOG operation. When a stepping motor is used, set this speed to ensure smooth starting of the motor. (Stepping motors do not start smoothly if the motor speed at start is low. For the bias speed at start, set a value not exceeding the speed limit.

(6) Acceleration/deceleration system selection

Set "Trapezoid Acceleration/Deceleration" or "S-curve Acceleration/Deceleration" for acceleration/deceleration processing.

If S-curve Acceleration/Deceleration is set when a stepping motor is used, the motor does not operate normally.

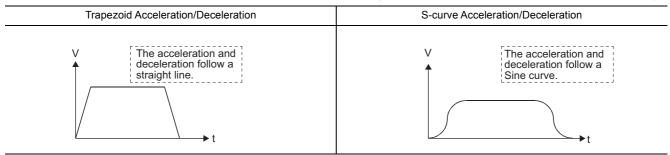

7.4 Specifications

(1) Performance specifications

The following is the performance specifications of the positioning function.

Item Number of controlled axes			Description			
			L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT	L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT		
			2			
Control unit			pulse			
Operation pattern		PTP*1 control	Available			
		Path control	Not usable			
	Number of positioni	ng data	10 data/axis			
	Desitioning control	PTP*1 control	ABS/INC			
	Positioning control method	Speed/position switching control	INC			
		PTP*1 control	-2147483648 to 2147483647 pulses			
Positioning control	Positioning range	Speed/position switching control	0 to 2147483647 pulses			
	Spee	d command	0 to 2	00k pulses/s		
	Acceleration/deceleration system selection		Automatic trapezoid acceleration/deceleration and S-curve acceleration/deceleration			
	Acceleration/deceleration time		0 to 32767 ms			
	OPR method	I	6 types			
	Starting time (1-axis linear control)		Trapezoid acceleration/deceleration (single-axis start): 30 μ s/axis S-curve acceleration/deceleration (single-axis start): 35 μ s/axis			
	Pulse output type		Sink type (5 to 24VDC)	Source type (5 to 24VDC)		
Command pulse output	Pulse output mode		4 modes			
puise output	Maximum output pulse		200k pulses/s			
	Maximum connection distance with drive unit		2 m			
		DC input	24VDC,	6.0mA (TYP.)		
	Zero signal	Differential input	EIA RS-422-A differential line driver level (AM26LS31 (by Texas Instruments Japan Limited.) or equiv			
	Speed/position	on switching signal				
External input	Near-po	int dog signal	24\\DC			
External input	Upper and	lower limit signal	24VDC, 4.1mA (TYP.)			
	Drive unit ready signal					
			Zero signal: 10μs			
	Minimum input response time		Speed/position switching signal, near-point dog signal: 100µs*2 Upper and lower limit signal, drive unit ready signal: 2ms			
Fortenest	Deviation counter clear signal		Sink type (5 to 24VDC, 0.1A)	Source type (5 to 24VDC, 0.1A)		
External output	Deepers dies	On	1μs or less (rated load, resistive load)			
	Response time	Off	1μs or less (rated load, resistive load)			

^{*1} Abbreviation for "Point to Point". This is a type of position control.

 $^{^{\}star}2$ The response time at turning on \rightarrow off of input devices takes 200 μs even if the input response time is set to "0.1ms"

(2) Special relay and special register

The following table lists the special relay (SM) and special register (SD) related to the positioning function. □ in the name indicates either 1 (Axis 1) or 2 (Axis 2). For details of the special relay and special register other than the Axis 1 axis operation status (SD1844) (Page 63, Section 7.5), refer to □MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection).

Special relay number		Name	Special register number		Name	
Axis 1	Axis 2	Name	Axis 1	Axis 2	ivallie	
SM1840	SM1860	Axis □ busy	SD1840	SD1860		
SM1841	SM1861	Axis □ positioning completion	SD1841	SD1861	Axis □ current feed value	
SM1842	SM1862	Axis □ OPR request	SD1842	SD1862	Axis □ current speed	
SM1843	SM1863	Axis □ OPR completed	SD1843	SD1863	Axis in current speed	
SM1844	SM1864	Axis □ speed 0	SD1844	SD1864	Axis □ axis operation status	
SM1845	SM1865	Axis □ error	SD1845	SD1865	Axis □ error code	
SM1846	SM1866	Axis □ warning	SD1846	SD1866	Axis □ warning code	
SM1847	SM1867	Axis ☐ start during operation	SD1847	SD1867	Axis □ external I/O signals	
SM1848	SM1868	Axis □ start instruction	SD1848	SD1868	Axis ☐ movement amount after	
SM1850	SM1870	Axis □ error reset	SD1849	SD1869	near-point dog ON	
SM1851	SM1871	Axis □ OPR request off			Avia 🖂 data Na lafa positionia a	
SM1852	SM1872	Axis □ speed/position switching	SD1850	SD1870	Axis □ data No. of positioning being executed	

7.5 Checking Current Position and Operation Status

The current position and operation status of the moving workpiece can be monitored in the special register.

(1) Checking a current position

Values indicating the current position are stored in the Axis 1 current feed value (SD1840, SD1841). The address established by machine OPR is used as the reference.

(2) Checking an operation status

The Axis 1 axis operation status (SD1844) indicates the operation status of the axis.

Stored value	Operating status	Description				
0	Standby	This is the status after the following operations: • (Successful) completion of operation • Power-on • When the CPU module is reset • Error reset				
		After JOG operationEnd of absolute position restoration				
1	Stopped	The axis has stopped successfully according to the Axis stop instruction (IPSTOP1).				
2	In JOG operation	JOG operation is in progress.				
3	In OPR	Machine OPR is in progress.				
4	In position control	Position control is in progress.				
5	In speed-position control (speed)	Speed control of speed/position switching control is in progress.				
6	In speed-position control (position)	Position control of speed/position switching control is in progress.				
7	Decelerating (axis stop ON)	The axis is decelerating according to the Axis stop instruction (IPSTOP1).				
8	Decelerating (JOG start OFF)	The axis is decelerating after the execution command for JOG start instruction (IPJOG1) turned off.				
9	In high-speed OPR	Fast OPR is in progress.				
10	In speed control	Speed control is in progress.				
11	Analyzing	Absolute position restoration is in progress.				
-1	Error occurring	An error is present.				

7.6 OPR Control

Two controls (machine OPR and fast OPR) are defined as OPR controls in line with the flow of OPR operation of the LCPU.

OPR control	Description	Reference
Machine OPR	This is control to establish the reference position (= OP) to be used when positioning control is started. This control is executed when requested by the LCPU at power-on. The OP is established by using a near-point dog or zero signal. Set machine OPR for the original position return type of the OPR start instruction (IPOPR1(P)) and execute the instruction to start the operation.	Page 71, Section 7.6.1
Fast OPR	Fast OPR is used to return the axis, which has stopped at a position other than the OP after positioning control, to the OP. After the machine OPR establishes the OP, the workpiece is moved to the OP address or standby address by the fast OPR without using a near-point dog or zero signal. Set fast OPR (OP address) or fast OPR (standby address) for the original position return type of the OPR start instruction (IPOPR1(P)) and execute the instruction to start the operation.	Page 89, Section 7.6.2

To implement OPR control, the OPR parameters must be set on the "Positioning Function Parameter Setting" window. The OPR parameters that have been set apply commonly to each axis. Setting details are explained below.

Setting item	Setting range	Default	
	Near-point Dog Method		
	Stopper 1		
	Stopper 2		
OPR Method	Stopper 3	Near-point Dog Method	
	Count 1		
	Count 2		
	No Method		
OPR Direction	Forward RUN	Forward RUN	
OF A Direction	Reverse RUN	r diward NON	
OP Address (pulse)	-2147483648 to 2147483647	0	
OPR Speed (pulse/s)	1 to 200000	1	
Creep Speed (pulse/s)	1 to 200000		
OPR Acceleration/Deceleration Time (ms)	0 to 32767	1000	
OPR Deceleration Stop Time (ms)	0 10 32707		
Setting of Movement Amount after Near-point Dog	0 to 2147483647	0	
ON (pulse)			
OPR Dwell Time (ms)	0 to 65535		


Note that the explanations in this section assume use of Axis 1. For the special relay, special register, dedicated instructions, and error codes for Axis 2, refer to the following.

- Special relay and special register: Page 62, Section 7.4 (2)
- Dedicated instructions: Page 137, Section 7.12
- Error codes: 🖙 Page 173, Section 7.14 (1)

(1) OPR method

Set the method of machine OPR. (This setting does not affect the fast OPR.) Operations under each method are explained below. For details of each method and applicable precautions, refer to (Fig. Page 71, Section 7.6.1).

Near-point dog method

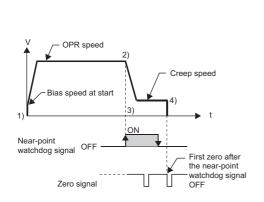

1) Start of machine OPR.


2) The axis starts to decelerate upon detection of turning on of the near-point dog.

 \downarrow

3) The axis decelerates to the creep speed and moves at the creep speed thereafter.

4) Pulse output from the LCPU stops when the first zero signal is issued after the near-point dog has turned off, and machine OPR is complete.

Stopper 1

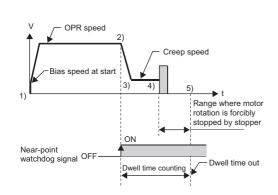

1) Start of machine OPR.


2) The axis starts to decelerate upon detection of turning on of the near-point dog.

3) The axis decelerates to the creep speed and moves at the creep speed thereafter.

4) The axis contacts the stopper at the creep speed and stops.

5) Upon elapse of the OPR dwell time after the near-point dog has turned on, pulse output from the LCPU stops and machine OPR is complete.

Stopper 2

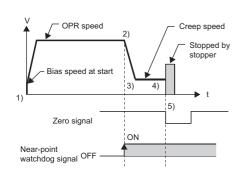

1) Start of machine OPR.

2) The axis starts to decelerate upon detection of turning on of the near-point dog.


 \downarrow

3) The axis decelerates to the creep speed and moves at the creep speed thereafter.

4) The axis contacts the stopper at the creep speed and stops.

5) When the zero signal is detected, pulse output from the LCPU stops and machine OPR is complete.

Stopper 3

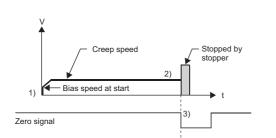

1) Start of machine OPR.


 \downarrow

2) The axis contacts the stopper at the creep speed and stops.

 \downarrow

3) When the zero signal is detected, pulse output from the LCPU stops and machine OPR is complete.

Count 1

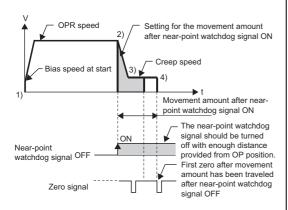

1) Start of machine OPR.

 \downarrow

2) The axis starts to decelerate upon detection of turning on of the near-point dog.


 \downarrow

3) The axis decelerates to the creep speed and moves at the creep speed thereafter.

.l.

4) Pulse output from the LCPU stops at the first zero signal after the near-point dog has turned on and the axis has moved the distance set by "Movement amount after near-point dog ON", and the machine OPR is complete.

Count 2

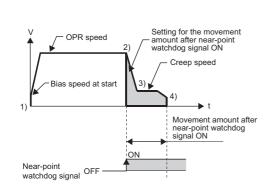

1) Start of machine OPR.

 \downarrow

2) The axis starts to decelerate upon detection of turning on of the near-point dog.

 \downarrow

3) The axis decelerates to the creep speed and moves at the creep speed thereafter.

 \downarrow

4) Pulse output from the LCPU stops after the axis has moved the distance set by "Movement amount after near-point dog ON" (the axis starts to decelerate from the creep speed over the OPR deceleration stop time), and the machine OPR is complete.

(a) OPR methods and OPR parameters

Different OPR parameters are required depending on each OPR method. The relationships are shown below. For the settings required for the fast OPR, refer to Page 89, Section 7.6.2.

O: Must be set, —: Need not be set

	OPR method					
OPR parameter	Near-point Dog Method	Stopper 1	Stopper 2	Stopper 3	Count 1	Count 2
OPR Direction	0	0	0	0	0	0
OP Address	0	0	0	0	0	0
OPR Speed	0	0	0	0	0	0
Creep Speed	0	0	0	0	0	0
OPR Acceleration/Deceleration Time	0	0	0	0	0	0
OPR Deceleration Stop Time	0	0	0	0	0	0
Setting of Movement Amount after Near-point Dog ON	_	_	_	_	0	0
OPR Dwell Time	O*1	0	_	_	O*1	O*1

¹ This setting becomes effective when OPR is retried.


(2) OPR direction

Set the direction in which to start machine OPR. (This setting does not affect the fast OPR.)

Forward RUN: The axis operates in the direction of increasing address (arrow 2)).

Reverse RUN: The axis operates in the direction of decreasing address (arrow 1)).

Normally the OP is set near the lower limit switch or upper limit switch. Accordingly, set the OPR direction as shown below.

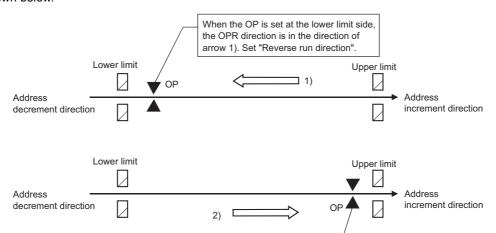

When the OP is set at the upper limit side, the OPR direction is in direction of arrow 2). Set "Forward run direction".

(3) OP address

Set the position that becomes the reference point of position control (ABS). Upon completion of machine OPR, the address of the stop position (Axis 1 current feed value (SD1840, SD1841) changes to the OP address that has been set.

(4) OPR speed


Set the speed of OPR control. The following condition must be met:

Bias speed at start \leq Creep speed \leq OPR speed \leq Speed limit

(5) Creep Speed

Set the low speed at which the axis moves immediately before stopping after decelerating from the OPR speed following the turning on of the near-point dog. The following condition must be met: (This setting does not affect the fast OPR.)

Bias speed at start \leq Creep speed \leq OPR speed \leq Speed limit

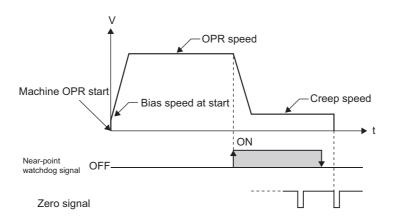




The creep speed affects the detection error in an OPR method using a zero signal, or degree of impact of collision in the OPR Method using a stopper method.

(6) OPR acceleration/deceleration time


Set the time required to reach the OPR speed from the bias speed at start, or creep speed from the OPR speed.

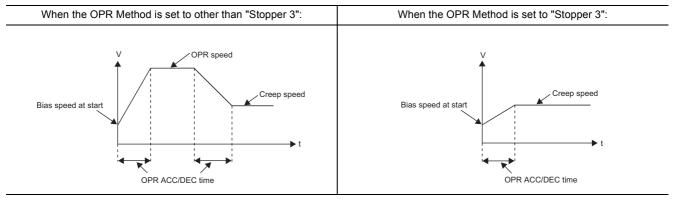

(7) OPR deceleration stop time

Set the time required for the following conditions.

- For "Count 2", this time is from when the axis decelerates the speed from the creep speed to when it stops at the bias speed at start.
- For all OPR method, this time is from when a stop cause occurs during OPR control to when the axis stops at the bias speed at start from the OPR speed.
- For the fast OPR, this time is from when the axis decelerates the speed from the OPR speed to when it stops at the bias speed at start. (Page 89, Section 7.6.2)

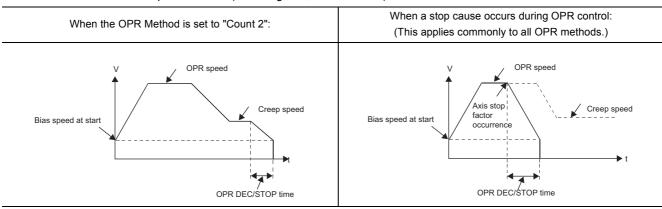


(8) Setting of movement amount after near-point dog ON

- Set the movement amount from the position at which the near-point dog turns on until a zero signal is input when the OPR Method is set to "Count 1.
- Set the movement amount from the position at which the near-point dog turns on to the OP when the OPR Method is set to "Count 2.

For "Setting of Movement Amount after Near-point Dog ON", set a value equal to or greater than the deceleration distance from the OPR speed to creep speed. (This setting does not affect the fast OPR.)

Ex. Calculation of "Movement Amount after Near-point Dog ON" when "OPR Speed" is set to 10 kpulses/s, "Creep Speed" to 2 kpulses/s, and "OPR Acceleration/Deceleration Time" to 320ms

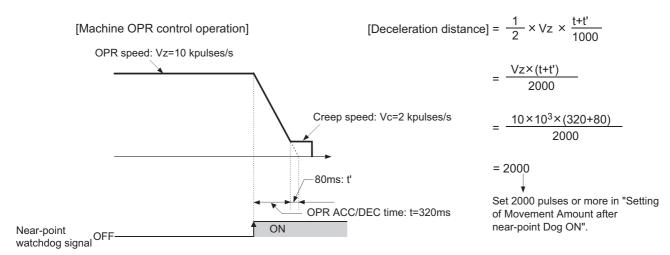

(9) OPR dwell time

Set this parameter in the conditions below. (This setting does not affect the fast OPR.)

(a) When the OPR Method is set to "Stopper 1":

Set the time required for machine OPR to complete after the near-point dog turns on. For the OPR dwell time, set a value equal to or greater than the moving time after the near-point dog turns on until the axis stops at the stopper.

(b) When the OPR retry function is enabled:

Set the stopping time after the axis decelerates to a stop. (Page 110, Section 7.10.1)

7.6.1 Machine OPR

The machine OPR establishes the machine OP using the OPR start instruction (IPOPR1(P)). (Page 146, Section 7.12.1 (4)) Once the machine OPR is complete, the mechanically established position becomes the "OP" which defines the starting point of positioning control. (No address information stored in the LCPU or servo amplifier is used.) How the OP is established by machine OPR varies depending on the "OPR method". Select one of the six methods that best suits your system.

(1) OPR method and I/O signal

Different I/O signals are used under each OPR method. A correspondence table of OPR methods and I/O signals is shown below.

○: Wiring required, △: Wire as necessary, —: Wiring not required

	OPR method						
I/O signal	Near-point dog method	Stopper 1	Stopper 2	Stopper 3	Count 1	Count 2	No method
Zero signal	0	*1	0	0	0	*1	*1
Near-point dog signal	0	0	0	*1	0	0	*1
Deviation counter clear signal	0	0	0	0	0	*1	*1
External command signal*1	_	_	_	_	_	_	_
CW/PULSE/A phase output	0	0	0	0	0	0	*1
CCW/SIGN/B phase output	0	0	0	0	0	0	*1
Drive unit ready signal*1	Δ	Δ	Δ	Δ	Δ	Δ	_
Upper limit signal*1*2	Δ	Δ	Δ	Δ	Δ	Δ	Δ
Lower limit signal*1*2	Δ	Δ	Δ	Δ	Δ	Δ	Δ

^{*1} When this signal is not required, it can be used for other functions such as the general-purpose input and general-purpose output.

(2) Sub function

The OPR retry function can be used when the upper and lower limit signals are input. (Fig. Page 110, Section 7.10.1)

^{*2} These signals are required when the OPR retry function or hardware stroke limit function is used.

Important

■OPR direction

- (1) The direction of the OP must always be the same when viewed from any arbitrary position in the moving area of the workpiece (= the OP must be positioned near the upper limit or lower limit of the machine).
- (2) Set the OPR direction correctly so that the workpiece moves toward the OP.

If the above two conditions are not met, the OPR retry function may actuate inadvertently.

The following situations may also result:

- The near-point dog is already off at the start of machine OPR.
- Machine OPR starts in the opposite direction of near-point dog.

In this case, no near-point dog is detected after machine OPR is started. As a result, the axis may continue to operate at the OPR speed until reaching the limit switch and damage the machine system. If this is the possibility, use the OPR retry function (Fig. Page 110, Section 7.10.1) or perform JOG operation (Fig. Page 104, Section 7.9) to move the workpiece until just before the near-point dog as viewed from the OPR direction.

■Deceleration stop time

If any of the following stop causes occurs during OPR operation, the axis decelerates to a stop over the "OPR deceleration stop time," not "OPR acceleration/deceleration time":


- · The program is stopped.
- The drive unit ready signal is turned off.
- A hardware stroke limit is reached. (If the OPR retry function is enabled, the axis decelerates to a stop and then starts moving in the opposite direction.)
- The Axis stop instruction (IPSTOP1) is executed.

When decelerating from the OPR speed, for example, the data to be used as the deceleration time varies between "deceleration due to near-point dog ON" and "deceleration by Axis stop instruction (IPSTOP1) execution command ON." Since the motor load changes according to the deceleration time, set this time properly by giving full consideration to the impact on the machine.

(3) Operations of near-point dog method and precautions

Under the near-point dog method, machine OPR completes when a zero signal is input after the near-point dog has turned off. The following operations take place.

Operation step	Description of operation
1)	Machine OPR starts upon execution of the OPR start instruction (IPOPR1(P)). The axis accelerates from the bias speed at start to the OPR speed in the OPR direction over the OPR acceleration/deceleration time and moves at the OPR speed.
2)	The axis starts to decelerate upon detection of turning on of the near-point dog. The axis decelerates to the creep speed and moves at the creep speed thereafter.
3)	When the first zero signal (signal for outputting one pulse per motor rotation) is issued after the near-point dog has turned off, the LCPU stops outputting pulses and outputs a deviation counter clear signal to the drive unit.
4)	Upon completion of output of the deviation counter clear signal (output for 10 ms), the Axis 1 OPR completion (SM1843) turns on and Axis 1 OPR request (SM1842) turns off.

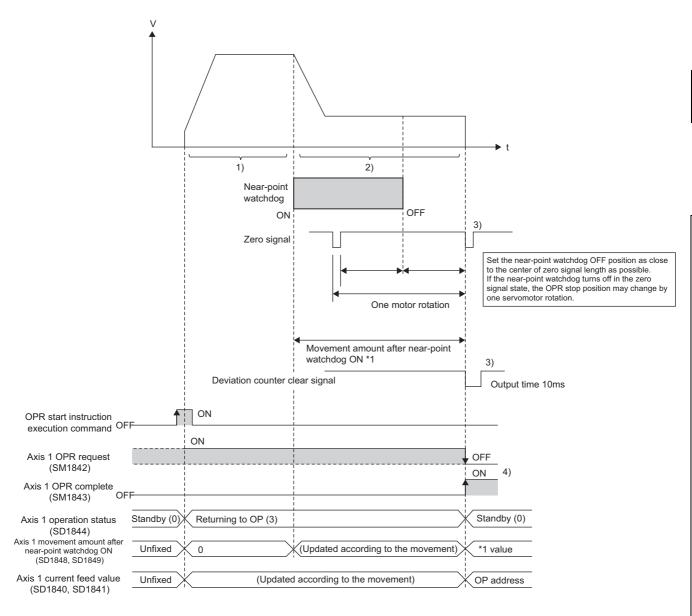


(a) Required pulse generator

Use a pulse generator with zero signal. If a pulse generator without zero signal is used, generate a zero signal using an external signal.

(b) Near-point dog length

The near-point dog length should be equal to or longer than the distance moved by the axis as it decelerates from the OPR speed to creep speed. If the length is short, the near-point dog turns off while the axis is still decelerating from the OPR speed to creep speed. When the zero signal turns on in this condition, the axis stops immediately to complete machine OPR. As a result, the OP position deviates and the motor load also increases because the axis stops suddenly at the creep speed or higher.

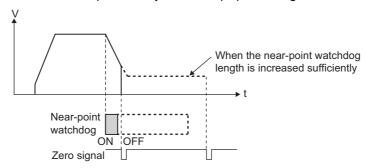


For the method to calculate the distance from the near-point dog ON position to OP, refer to Page 69, Section 7.6 (8).

(c) Advantages of using limit switches


The following functions can be used when the upper and lower limit signals are selected:

- · OPR retry function
 - When machine OPR is started in a position indicated as interval A (where the near-point dog is turned off and no near-point dog is found in the OPR direction) in the figure below, the axis continues to operate at the OPR speed until reaching the limit switch of the machine system because it cannot detect the near-point dog. When the limit signal in the OPR direction turns off, the OPR retry function actuates. As a result, the axis decelerates to a stop and then move in the opposite direction to complete machine OPR successfully. (Page 110, Section 7.10.1) This eliminates the need to perform JOG operation to return to the position before the near-point dog turns on.
- Hardware stroke limit function
 When the limit signal in the direction opposite the OPR direction turns off, the axis decelerates to a stop
 due to the hardware stroke limit function. (Page 123, Section 7.10.5) This prevents damage to the
 machine system.

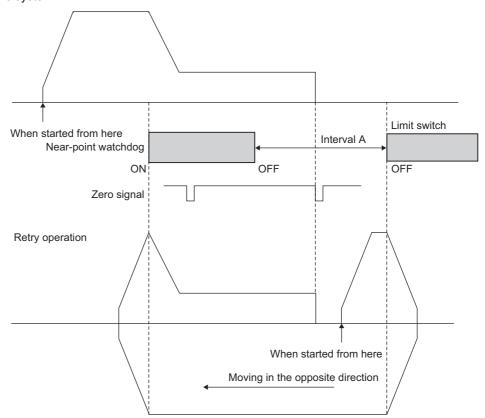

(d) Machine OPR from a position where the near-point dog is turned on


When machine OPR is started at a position indicated as interval B (where the near-point dog is turned on) in the figure below, the OPR retry function does not operate. The axis moves at the creep speed to complete machine OPR.

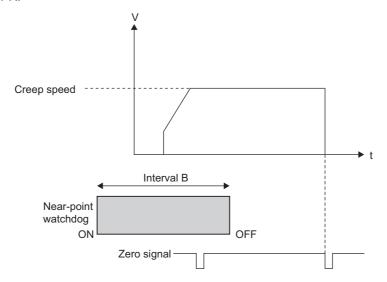

(4) Operations of stopper 1 and precautions

Under this method, machine OPR completes upon elapse of the OPR dwell time after the detection of near-point dog ON. The following operations take place.

Operation step	Description of operation
1)	Machine OPR starts upon execution of the OPR start instruction (IPOPR1(P)). The axis accelerates from the bias speed at start to the OPR speed in the OPR direction over the "OPR acceleration/deceleration time" and moves at the OPR speed.
2)	The axis starts to decelerate upon detection of turning on of the near-point dog. The axis decelerates to the creep speed and moves at the creep speed thereafter.
3)	The axis contacts the stopper at the creep speed and stops.
4)	Upon elapse of the OPR dwell time after the near-point dog has turned on, the LCPU stops outputting pulses and outputs a deviation counter clear signal to the drive unit.
5)	Upon completion of output of the deviation counter clear signal (output for 10 ms), the Axis 1 OPR completion (SM1843) turns on and Axis 1 OPR request (SM1842) turns off.

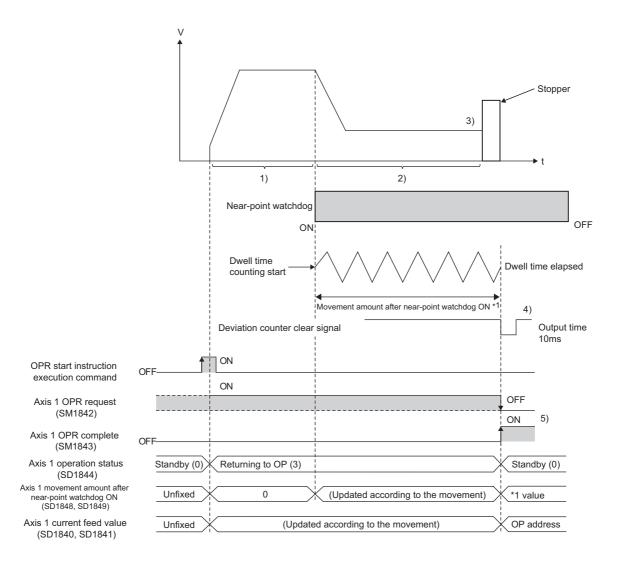


(a) Motor torque limit

Be sure to limit the motor torque after the creep speed is reached. If the torque is not limited, the motor may be damaged when the stopper is contacted. For limitation of torque, refer to the manual for the drive unit.


(b) Setting of OPR dwell time

For "OPR dwell time," set a value equal to or greater than the moving time from the near-point dog ON position until the stopper is contacted. If the OPR dwell time is short, machine OPR completes before the stopper is contacted and the OP position deviates. If the OPR dwell time is shorter than the OPR acceleration/deceleration time, the motor stops suddenly at the higher speed than the creep speed. As a result, load for motor is increased.

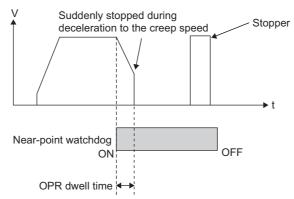


(c) Near-point dog and starting position

• When machine OPR is started in a position indicated as interval A (where the near-point dog is turned on) in the figure below, the axis moves at the creep speed to complete machine OPR.

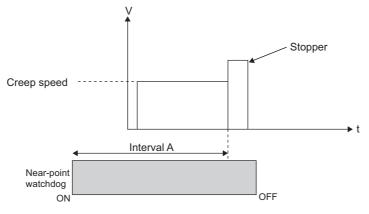

• When starting position is in interval B (between the near-point dog OFF position and stopper) in the figure below, no near-point dog is detected and thus the axis may collide with the stopper at the OPR speed.

Make sure the near-point dog is longer than the distance to the stopper.

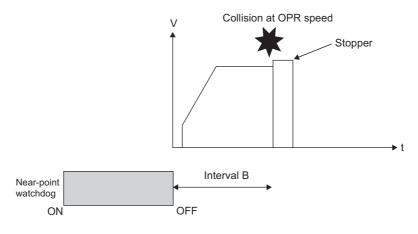


(d) OPR retry function

The OPR retry function cannot be used.

(5) Operations of stopper 2 and precautions

Under this method, machine OPR completes upon input of a zero signal via an external switch, following stopper contact. The following operations take place.

Operation step	Description of operation
1)	Machine OPR starts upon execution of the OPR start instruction (IPOPR1(P)). The axis accelerates from the bias speed at start to the OPR speed in the OPR direction over the "OPR acceleration/deceleration time" and moves at the OPR speed.
2)	The axis starts to decelerate upon detection of turning on of the near-point dog. The axis decelerates to the creep speed and moves at the creep speed thereafter.
3)	The axis contacts the stopper at the creep speed and stops.
4)	When a zero signal (output upon detection of stopper contact) is issued after the axis has stopped, the LCPU stops outputting pulses and outputs a deviation counter clear signal to the drive unit.
5)	Upon completion of output of the deviation counter clear signal (output for 10 ms), the Axis 1 OPR completion (SM1843) turns on and Axis 1 OPR request (SM1842) turns off.

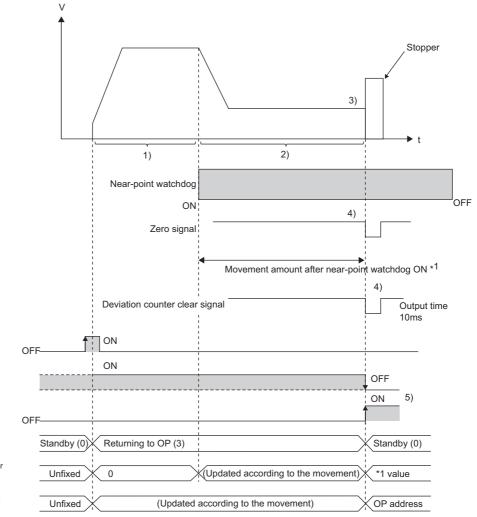

OPR start instruction execution command

Axis 1 OPR request (SM1842)

Axis 1 OPR complete (SM1843)

Axis 1 operation status (SD1844)

Axis 1 movement amount after near-point watchdog ON (SD1848, SD1849)


Axis 1 current feed value (SD1840, SD1841)

(a) Motor torque limit


Be sure to limit the motor torque after the creep speed is reached. If the torque is not limited, the motor may be damaged when the stopper is contacted. For limitation of torque, refer to the manual for the drive unit.

(b) Near-point dog and starting position

• When machine OPR is started in a position indicated as interval A (where the near-point dog is on) in the figure below, the axis moves at the creep speed to complete machine OPR.

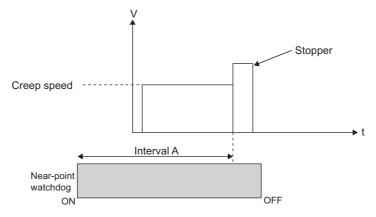

 When starting position of the machine OPR is in interval B (between the near-point dog OFF position and stopper) in the figure below, no near-point dog is detected and thus the axis may collide with the stopper at the OPR speed. Make sure the near-point dog is longer than the distance to the stopper.

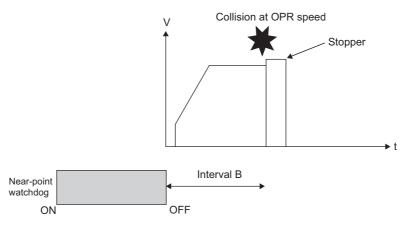


(c) OPR retry function

The OPR retry function cannot be used.

(d) Zero signal input

• Input a zero signal after the stopper has been contacted. If a zero signal is input before the stopper is contacted, machine OPR completes at that point. As a result, the OP position deviates and if a zero signal is input while the axis is decelerating to the creep speed, the motor load also increases because the axis stops suddenly at the creep speed or higher.

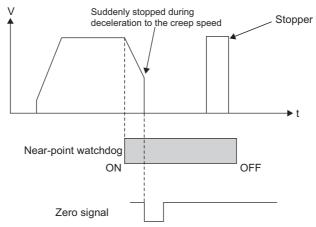


 Do not input a zero signal before machine OPR is started. If a zero signal is already input externally when machine OPR is started, a "Zero signal ON" error (Axis 1 error code: 1200) occurs and machine OPR is not performed.

(6) Operations of stopper 3 and precautions

Under this method, machine OPR completes upon input of a zero signal via an external switch, following stopper contact. This method is effective when no near-point dog is installed. Note, however, that it takes a longer time to complete machine OPR because the axis operates at the creep speed, not at the OPR speed. The following operations take place.

Operation step	Description of operation
1)	Machine OPR starts upon execution of the OPR start instruction (IPOPR1(P)). The axis accelerates from the bias speed at start to the creep speed in the OPR direction over the "OPR acceleration/deceleration time" and moves at the creep speed.
2)	The axis contacts the stopper at the creep speed and stops.
3)	When a zero signal (output upon detection of stopper contact) is issued after the axis has stopped, the LCPU stops outputting pulses and outputs a deviation counter clear signal to the drive unit.
4)	Upon completion of output of the deviation counter clear signal (output for 10 ms), the Axis 1 OPR completion (SM1843) turns on and Axis 1 OPR request (SM1842) turns off.

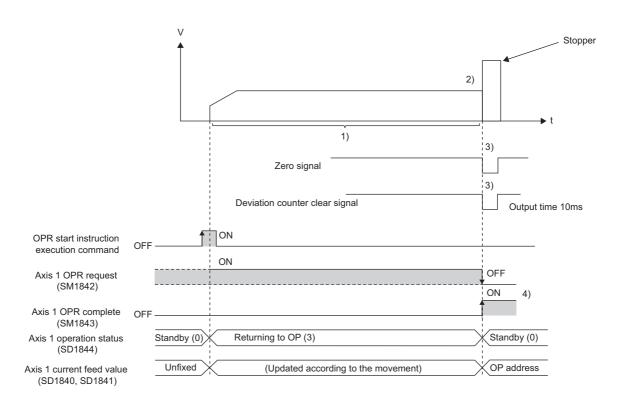

(a) Motor torque limit

Be sure to limit the motor torque after the creep speed is reached. If the torque is not limited, the motor may be damaged when the stopper is contacted. For limitation of torque, refer to the manual for the drive unit.

(b) OPR retry function

The OPR retry function cannot be used.


(c) Zero signal input

- Input a zero signal after the stopper has been contacted. If a zero signal is input before the stopper is contacted, machine OPR completes at that point and the OP position deviates.
- Do not input a zero signal before machine OPR is started. If a zero signal is already input externally when
 machine OPR is started, a "Zero signal ON" error (Axis 1 error code: 1200) occurs and machine OPR is
 not performed.

(7) Operations of count 1 and precautions

Under this method, machine OPR completes when the first zero signal is input after the axis has moved the distance set by "Movement amount after near-point dog ON" from the near-point dog ON point. The following operations take place.

Operation step	Description of operation
1)	Machine OPR starts upon execution of the OPR start instruction (IPOPR1(P)). The axis accelerates from the bias speed at start to the OPR speed in the OPR direction over the "OPR acceleration/deceleration time" and moves at the OPR speed.
2)	The axis starts to decelerate upon detection of turning on of the near-point dog. The axis decelerates to the creep speed and moves at the creep speed thereafter.
3)	When the first zero signal (signal for outputting one pulse per motor rotation) is issued after the axis has moved the distance set by "Movement amount after near-point dog ON," the LCPU stops outputting pulses and outputs a deviation counter clear signal to the drive unit.
4)	Upon completion of output of the deviation counter clear signal (output for 10 ms), the Axis 1 OPR completion (SM1843) turns on and Axis 1 OPR request (SM1842) turns off.

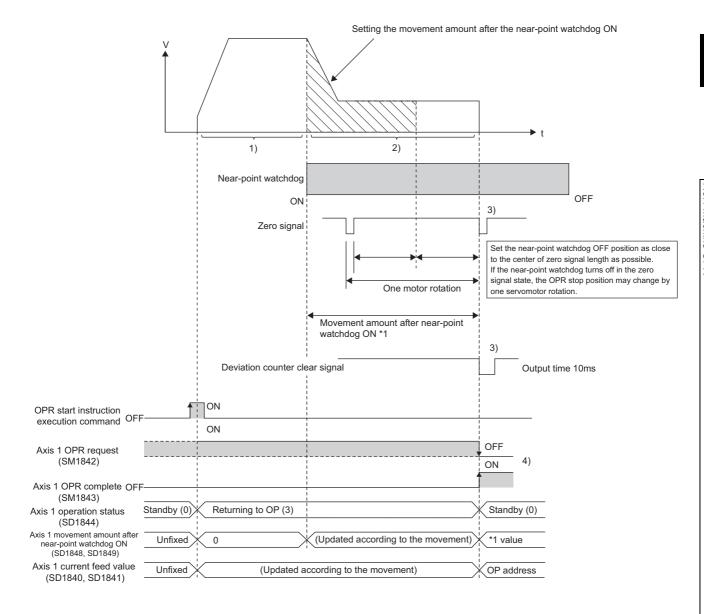


(a) Required pulse generator

A pulse generator with a zero signal is required. If a pulse generator without zero signal is used, generate a zero signal using an external signal.

(b) Movement amount after near-point dog ON

The "Movement amount after near-point dog ON" should be equal to or longer than the distance moved by the axis as it decelerates from the OPR speed to creep speed. (Page 69, Section 7.6 (8)) If a zero signal is input after the axis has moved the distance set by "Movement amount after near-point dog ON" while still decelerating from the OPR speed to creep speed, the axis stops immediately at that point to complete machine OPR. As a result, the OP position deviates and the motor load also increases because the axis stops suddenly at the creep


speed or higher.

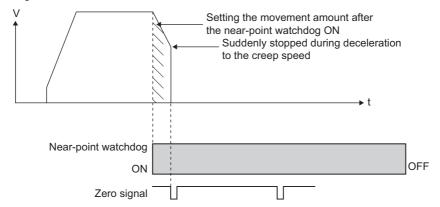

(c) Advantages of using limit switches

The following functions can be used when the upper and lower limit signals are selected:

- · OPR retry function
 - When machine OPR is started in a position indicated as interval A (where the near-point dog is turned off and no near-point dog is found in the OPR direction) in the figure below, the axis continues to operate at the OPR speed until reaching the limit switch of the machine system because it cannot detect the near-point dog. When the limit signal in the OPR direction turns off, the OPR retry function actuates. As a result, the axis decelerates to a stop and then move in the opposite direction to complete machine OPR successfully. (Fig. Page 110, Section 7.10.1) This eliminates the need to perform JOG operation to return to the position before the near-point dog turns on.
- Hardware stroke limit function
 When the limit signal in the direction opposite the OPR direction turns off, the axis decelerates to a stop
 due to the hardware stroke limit function. (Page 123, Section 7.10.5) This prevents damage to the
 machine system.

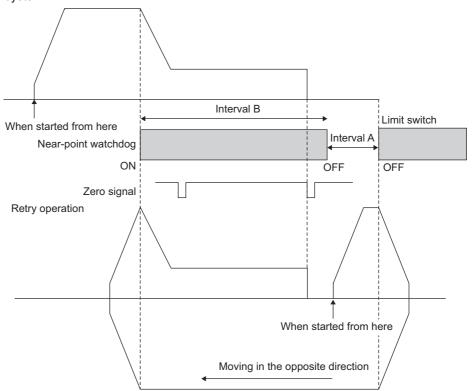


(d) Machine OPR from a position where the near-point dog is turned on

When machine OPR is started in a position indicated as interval B (where the near-point dog is turned on) in the figure above, the axis starts moving at the OPR speed in the direction opposite the OPR direction due to the OPR retry function to perform machine OPR. (Page 113, Section 7.10.1 (4))

(8) Operations of count 2 and precautions

Under this method, the position achieved by moving the distance set by "Movement amount after near-point dog ON" from the near-point dog ON point is set as the OP. This method is effective when a stepping motor is used so that a zero signal cannot be issued. Note that the stop position varies more than when the count 1 method is used. The following operations take place.

Operation step	Description of operation
1)	Machine OPR starts upon execution of the OPR start instruction (IPOPR1(P)). The axis accelerates from the bias speed at start to the OPR speed in the OPR direction over the OPR acceleration/deceleration time and moves at the OPR speed.
2)	The axis starts to decelerate upon detection of turning on of the near-point dog. The axis decelerates to the creep speed and moves at the creep speed thereafter.
3)	After the axis has moved the distance set by "Movement amount after near-point dog ON," the LCPU stops outputting pulses (the axis starts decelerating from the creep speed over the OPR deceleration stop time). The Axis 1 OPR completion (SM1843) turns on, while the Axis1 OPR request (SM1842) turns off.

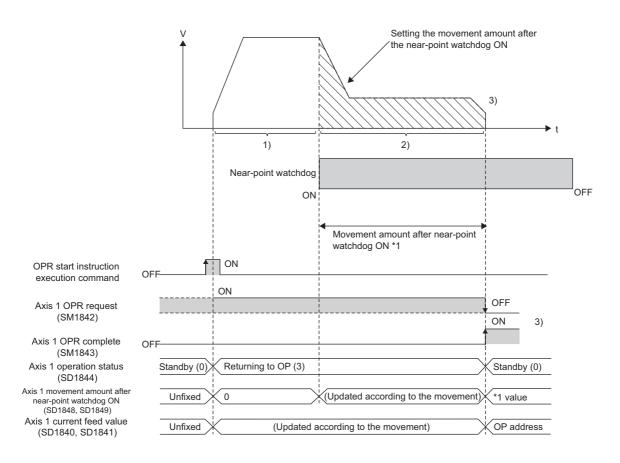


(a) Wiring of deviation counter clear signal

Deviation counter clear signals are not output in the count 2 method. Use a general-purpose output signal and output it to the servo amplifier.

(b) Movement amount after near-point dog ON


The "Movement amount after near-point dog ON" should be equal to or longer than the distance moved by the axis as it decelerates from the OPR speed to creep speed. (Page 69, Section 7.6 (8)) If the axis has moved the distance set by "Movement amount after near-point dog ON" while still decelerating from the OPR speed to creep speed, the axis stops immediately at that point to complete machine OPR. As a result, the OP position deviates and the motor load also increases because the axis stops suddenly at the creep speed or higher.

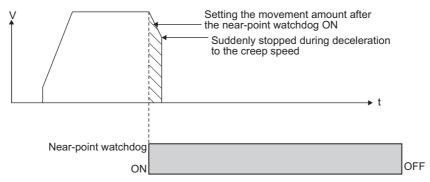

(c) Advantages of using limit switches

The following functions can be used when the upper and lower limit signals are selected:

- · OPR retry function
 - When machine OPR is started in a position indicated as interval A (where the near-point dog is turned off and no near-point dog is found in the OPR direction) in the figure below, the axis continues to operate at the OPR speed until reaching the limit switch of the machine system because it cannot detect the near-point dog. When the limit signal in the OPR direction turns off, the OPR retry function actuates. As a result, the axis decelerates to a stop and then move in the opposite direction to complete machine OPR successfully. (Page 110, Section 7.10.1) This eliminates the need to perform JOG operation to return to the position before the near-point dog turns on.
- Hardware stroke limit function
 When the limit signal in the direction opposite the OPR direction turns off, the axis decelerates to a stop
 due to the hardware stroke limit function. (Page 123, Section 7.10.5) This prevents damage to the
 machine system.

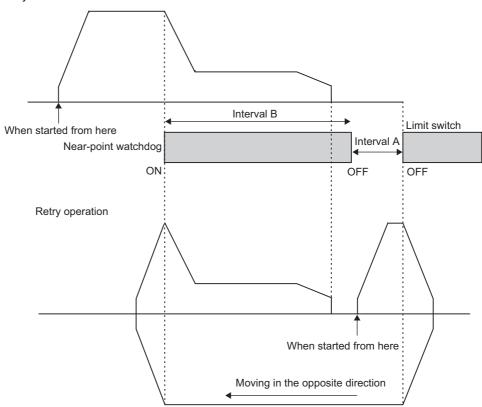

(d) Machine OPR from a position where the near-point dog is turned on

When machine OPR is started in a position indicated as interval B (where the near-point dog is turned on) in the figure above, the axis starts moving at the OPR speed in the direction opposite the OPR direction due to the OPR retry function to perform machine OPR. (Page 113, Section 7.10.1 (4))

(9) Setting of no method

"No method" is provided as an OPR method for those systems that do not use machine OPR. The I/O signals used for OPR can be used with other functions. If "No method" is set, an attempt to start machine OPR with the OPR start instruction (IPOPR1(P)) generates "OPERATION ERROR" (error code: 4116).

7.6.2 Fast OPR

The fast OPR is a function to perform positioning to the "OP address" established by machine OPR or other position (standby address).


Address	Description		
OP address	This address is used to perform positioning using the OP established by machine OPR as the starting point		
Standby address	This address is used to perform positioning using a position other than the OP established by machine OPR as the starting point. In certain situations such as when a near-point dog cannot be installed near the standby address and thus the standby address is not the same as the OP in machine system design, fast OPR can be implemented to the standby address to return the workpiece to the starting point (\neq OP).		

High-speed positioning control is started with the OPR start instruction (IPOPR1(P)) and implemented without using a near-point dog or zero signal. (Page 146, Section 7.12.1 (4))

(1) Fast OPR operation

This operation uses the following OPR parameters, except for the OP address and standby address set for the OPR start instruction (IPOPR1(P).

Setting item	Data type
OPR Speed	
OPR Acceleration/Deceleration Time	OPR Parameter
OPR Deceleration Stop Time	

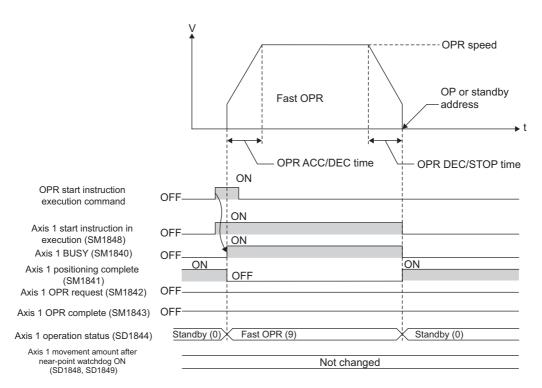

(2) Precautions

- Establish the OP via machine OPR before starting fast OPR. Otherwise, the "Machine OPR not performed" error (Axis 1 error code: 1201) occurs and operation does not start.
- If the system uses speed control, speed/position switching control and current value change, the Axis 1 current feed value (SD1840, SD1841) is different from the coordinate calculated with reference to the machine OP and thus fast OPR to the machine OP or standby address cannot be performed.

7.6.3 Forced off of Axis 1 OPR request (SM1842)

When the LCPU requests machine OPR upon power on, the Axis 1 OPR request (SM1842) turns on. If the system does not require machine OPR, the Axis 1 OPR request (SM1842) can be forcibly turned off by turning on the Axis 1 OPR request off (SM1851). The Axis 1 OPR request off (SM1851) should be turned off again after checking that the Axis 1 OPR request (SM1842) has turned off.

7.6.4 Precautions on Axis 1 OPR request (SM1842)


In the following condition, the Axis 1 OPR request (SM1842) needs to be turned on to perform the machine OPR.


- · At power on
- · At reset
- · When the operating status is switched from STOP to RUN
- · When the drive unit ready signal is turned off
- · At the start of machine OPR control

While the Axis 1 OPR request (SM1842) is on, address information stored in the LCPU cannot be guaranteed. When the machine OPR is performed and successfully completed, the Axis 1 OPR request (SM1842) turns off and the Axis 1 OPR completion (SM1843) turns on.

7.7 Positioning Control

The positioning control method is set by the positioning data "Control System". 10 positioning data can be set for each axis with the programming tool. To start positioning control using positioning data set with the programming tool, use the Table start instruction (IPPSTRT1(P)) (Page 138, Section 7.12.1 (1)). To start positioning control using 10 or more positioning data, set them as the setting data of the Positioning start instruction (IPDSTRT1(P)) (Page 140, Section 7.12.1 (2)).

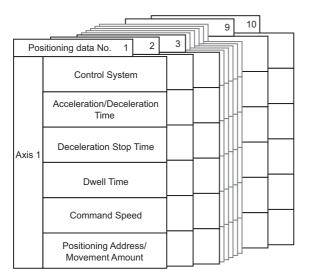

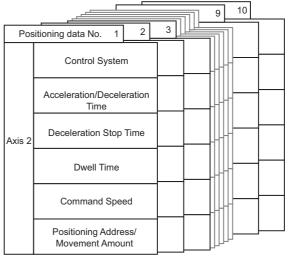

Setting item	Setting range	Default	
	Not selected (blank)		
	Position Control (ABS)		
	Position Control (INC)		
Control System	Speed-position Switching Control (Forward RUN)	Not selected (blank)	
Control System	Speed-position Switching Control (Reverse RUN)	Not selected (blank)	
	Current Value Change		
	Speed Control (Forward RUN)		
	Speed Control (Reverse RUN)		
Acceleration/Deceleration Time (ms)	0 to 32767	1000	
Deceleration Stop Time (ms)	0 10 32707	1000	
Dwell Time (ms)	0 to 65535	0	
Command Speed (pulse/s)	0 to 200000		
	-2147483648 to 2147483647		
Positioning Address/Movement Amount (pulse)	(0 to 2147483647 if the control system is		
	speed/position switching control)		

Setting details are explained below.

Note that the explanations in this section assume use of Axis 1. For the special relay, special register, dedicated instructions, error codes, and warning codes for Axis 2, refer to the following.

- Special relay and special register: Fage 62, Section 7.4 (2)
- Dedicated instructions: Page 137, Section 7.12
- Error codes: Fage 173, Section 7.14 (1)
- Warning codes: Fage 177, Section 7.14 (2)

(1) Control system

Set the positioning control system.

Control system	Description	Reference
Not selected (blank)	Set this option if positioning control is not performed.	_
Position Control (ABS)	Positioning control is implemented from the position at which the axis is currently	Page 97, Section
Position Control (INC)	stopped, to the specified position. (1-axis linear control)	7.7.2
Speed-position Switching Control (Forward RUN)	Speed control is implemented first and when the external command signal is turned on, position control (positioning control based on specified movement amount) is	Page 98, Section
Speed-position Switching Control (Reverse RUN)	implemented successively.	7.7.3
Current Value Change	The Axis 1 current feed value (SD1840, SD1841) is changed to the set address.	Page 100, Section 7.7.4
Speed Control (Forward RUN)	After acceleration, operation continues until the execution command for Axis stop	Page 101,
Speed Control (Reverse RUN)	instruction (IPSTOP1) turns on.	Section 7.7.5


The following lists the control systems and the required positioning data.

 \bigcirc : Must be set, \triangle : Set as necessary, —: Need not be set

	Control System				
Positioning data	Position control	Speed control	Speed/position switching control	Current value change	
Acceleration/Deceleration Time	0	0	0	_	
Deceleration Stop Time	0	0	0	_	
Dwell Time	Δ	Δ	Δ	Δ	
Command Speed	0	0	0	_	
Positioning Address/Movement Amount	0	_	0	0	

(2) Acceleration/deceleration time, deceleration stop time, dwell time, and command speed

- Acceleration/deceleration time: Set the time required for the axis to reach the command speed from the bias speed at start.
- Deceleration stop time: Set the time required for the axis to reach the bias speed at start from the command speed and then stop upon completion of position control or occurrence of a stop cause.
- Dwell time: Set the time required for Axis 1 positioning completion (SM1841) to turn on after completion of positioning control.
- Command speed: Set the speed at which to implement positioning control. If the set command speed exceeds the speed limit, positioning control is implemented at the speed limit. If the set command speed is less than the bias speed at start, positioning control is implemented at the bias speed at start.

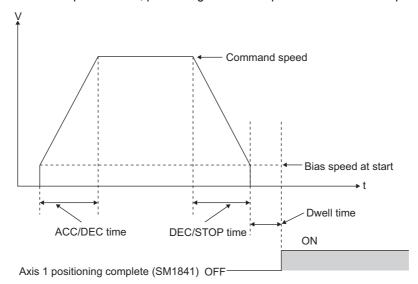


(3) Positioning address/movement amount

Set the address or movement amount to be used as the target value for positioning control. The setting range of values varies depending on the control system.

(a) Position control (ABS), current value change


Set the address from the OP.

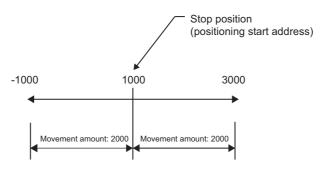

(b) Position control (INC)


Set the movement amount with sign.

- · When the movement amount is positive: Move in the positive direction (address increasing direction)
- · When the movement amount is negative: Move in the negative direction (address decreasing direction)

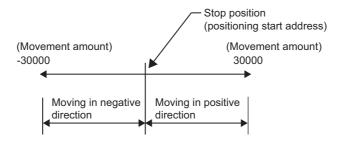

(c) Speed-position switching control (forward RUN/reverse RUN)

Set the movement amount after switching from speed control to position control. The setting range is 0 to 2147483647 (pulses).

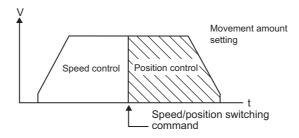

(d) Speed control (forward RUN/reverse RUN)

The set value is ignored.

7.7.1 Start of positioning control

Positioning control can be started by using positioning data set with the programming tool or by setting positioning data in a program. The I/O signals used under each control system are shown below.

 \bigcirc : Wiring required, \triangle : Wire as necessary, —: Wiring not required

I/O signal	Control system		
	Position control	Speed control	Speed/position switching control
Zero signal ^{*1}	_	_	_
Near-point dog signal ^{*1}	_	_	_
Deviation counter clear signal ^{*1}	_	_	_
External command signal	*1	*1	0
CW/PULSE/A phase output	0	0	0
CCW/SIGN/B phase output	0	0	0
Drive unit ready signal ^{*1}	Δ	Δ	Δ
Upper limit signal*1*2	Δ	Δ	Δ
Lower limit signal*1*2	Δ	Δ	Δ

^{*1} When this signal is not required, it can be used for other functions such as the general-purpose input and general-purpose output.

(1) Starting with positioning data set by the programming tool

Positioning data (up to 10 sets of data for each axis) can be set easily using the programming tool. Note that once set, positioning data cannot be changed in a program. Two axes can be started simultaneously at the pulse output level using the Two axes simultaneous start instruction (IPSIMUL(P)).

(a) Setting

Set positioning data (10 sets of data for each axis) using the programming tool and write the data to the LCPU.

(b) Starting

Start positioning with the Table start instruction (IPPSTRT1(P)) by specifying a positioning data No. (Fig. Page 138, Section 7.12.1 (1)) Only one set of positioning data can be executed with each instruction. To start two axes simultaneously, use the Two axes simultaneous start instruction (IPSIMUL(P)).

(2) Starting by setting positioning data with a device

Start positioning with the Positioning start instruction (IPDSTRT1(P)) by specifying the device in which positioning data is stored. Positioning data can be changed every time positioning is started. Use this mode when there are many positioning points and 10 sets of positioning data are not enough, or when positioning addresses and command speeds are calculated by a program, among others.

(a) Setting

Set positioning data to a device by a program.

(b) Starting

Positioning is started when the set device is specified as setting data and the Positioning start instruction (IPDSTRT1(P)) is executed in the program (Page 140, Section 7.12.1 (2)). Two axes cannot be started simultaneously.

^{*2} These signals are required when the hardware stroke limit and OPR retry functions are used.

(3) Sub function

- The command speed can be changed using the Speed change instruction (IPSPCHG1(P)) (Page 115, Section 7.10.3).
- The software stroke limit function can be used when the software stroke upper/lower limits are set (Page 120, Section 7.10.4).
- The hardware stroke limit function can be used when upper/lower limit signals are input (Page 123, Section 7.10.5).
- The target position can be changed using the Target position change instruction (IPTPCHG1(P)) (Page 124, Section 7.10.6).


7.7.2 Position control

Positioning control is implemented for the specified axis from the current position to specified position.

(1) Positioning control by ABS (absolute) method

Positioning is performed by specifying a position with reference to the OP. The moving direction is determined by the current position.


Ex. Operation when the starting point address is 2000 and "Positioning address/movement amount" is set to

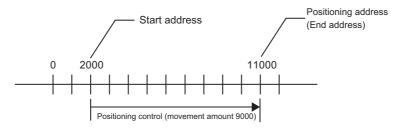

(2) Positioning control by INC (incremental) method

Positioning is performed by the set movement amount from the current position being the starting point. The moving direction is determined by the sign of "Positioning address/movement amount."

Ex. Operation when the starting point address is 2000 and "Positioning address/movement amount" is set to - 11000:

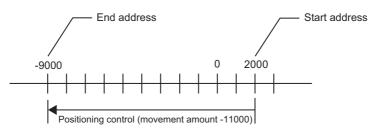

(3) Precautions


If the value of "Positioning address/movement amount" exceeds the upper limit of the software stroke, a "Software stroke limit+" error (Axis 1 error code: 1103) occurs. If the value is smaller than the lower limit of the software stroke, a "Software stroke limit-" error (Axis 1 error code: 1104) occurs. In these cases, position control does not start.

7.7.3 Speed/position switching control

After the start instruction has been executed, positioning control is started via speed control first. When the external command signal turns on, speed control switches to position control and positioning control is implemented by the movement amount set by "Positioning address/movement amount." Speed/position switching control is implemented in forward and reverse directions. To switch from speed control to position control, the Axis 1 Speed/position switching enable (SM1852) must be turned on beforehand.

(1) Speed/position switching control operations

(a) Operation timings

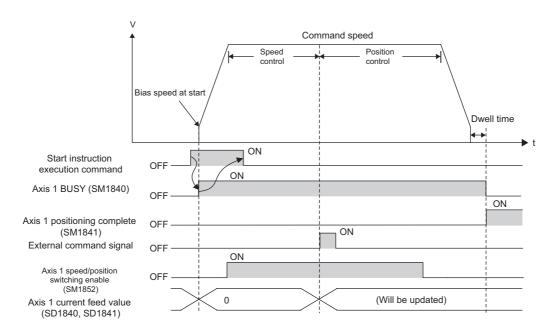

(b) Axis 1 current feed value (SD1840, SD1841)

This value is cleared to 0 at the start of speed control. It is not refreshed during speed control, and refreshed only after switching to position control.

(2) Precautions

(a) Selection of external command signal

An attempt to start speed/position switching control without selecting an external command signal generates a "Speed/position switching control start not possible" error (Axis 1 error code: 1505).

(b) External command signal on timing and operation

- If speed/position switching control is started while the external command signal is still on, position control
 is implemented first. (The Axis 1 current feed value (SD1840, SD1841) is cleared to 0 and then refreshed
 accordingly thereafter.)
- If the external command signal is turned on before the command speed is reached, position control is implemented at the speed effective at that point.

(c) External command signal and positioning data

If the following condition is met, deceleration starts at the moment an external command signal is input:

Positioning address/movement amount < Deceleration distance from command speed

In this case, the axis moves only by the movement amount set by "Positioning address/movement amount," before decelerating to the bias speed at start, and then stops immediately.

(d) Speed 0

When the bias speed at start is set to 0 and the command speed is also set to 0 under the speed control, operation does not start. At this time, the special relays and registers assume the following status. To continue with the operation, set a value other than 0 for the new speed value and then turn off the Axis 1 speed 0 (SM1844) using a speed change request with the Speed change instruction (IPSPCHG1(P)).

- Axis 1 speed 0 (SM1844): On
- · Axis status: Stop
- Axis 1 axis operation status (SD1844): 5 (In speed-position control (speed))
- Axis 1 busy (SM1840): On

If the bias speed at start is other than 0, changing the command speed to 0 generates an "Out of speed range" warning (Axis 1 warning code: 1020) and the axis operates at the bias speed at start.

(e) Software stroke limit

Do not implement speed/position switching control beyond the range of software stroke limits. If the value of "Positioning address/movement amount" exceeds the range of software stroke limits during speed control, a "Software stroke limit+" error (Axis 1 error code: 1103) or "Software stroke limit-" error (Axis 1 error code: 1104) occurs the moment it switches to position control, and the axis decelerates to a stop.

(f) Set value of "Positioning address/movement amount"

Do not set a negative value for "Positioning address/movement amount." A "Movement amount setting out of range under speed/position switching control" error (Axis 1 error code: 1504) occurs.

(g) Stop position


To suppress fluctuation of the stop position after switching to position control, turn the external command signal on in a stable speed area.

7.7.4 Current value change

The Axis 1 current feed value (SD1840, SD1841) of a stationary axis is changed to a specified address.

(1) Timing of current value change

When the execution command for start instruction turns on, the specified address is stored in the Axis 1 current feed value (SD1840, SD1841).



(2) Precautions


If the new current value exceeds the upper limit of the software stroke, "Software stroke limit +" (Axis 1 error code: 1103) occurs. If the value is smaller than the lower limit of the software stroke, a "Software stroke limit-" error (Axis 1 error code: 1104) occurs. In these cases, the current value is not changed.

7.7.5 Speed control

After accelerating to the command speed, the axis continues to operate at the command speed until the Axis stop instruction (IPSTOP1) is executed. Speed control is implemented in forward and reverse directions. Operation timings are shown in the figure below.

(1) Speed control operation

(a) Operation timings

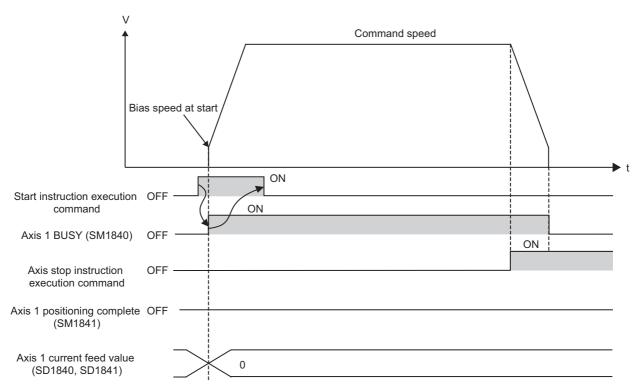

(b) Axis 1 positioning completion (SM1841) and Axis 1 current feed value (SD1840, SD1841)

The Axis 1 positioning completion (SM1841) does not turn on during speed control. Also note that the Axis 1 current feed value (SD1840, SD1841) is fixed to 0 during speed control.

(2) Precautions

(a) Speed 0

When the bias speed at start is set to 0 and the command speed is also set to 0 under the speed control, the special relays and registers assume the following status. To continue with the operation, set a value other than 0 for the new speed value and then turn off the Axis 1 speed 0 (SM1844) using a speed change request with the Speed change instruction (IPSPCHG1(P)).

- Axis 1 speed 0 (SM1844): On
- · Axis status: Stop
- Axis 1 axis operation status (SD1844): 10 (In speed control)
- Axis 1 busy (SM1840): On


If the bias speed at start is other than 0, changing the command speed to 0 generates an "Out of speed range" warning (Axis 1 warning code: 1020) and the axis operates at the bias speed at start.

7.8 Multiple Axes Simultaneous Start Control

Two axes can be started simultaneously using the Two axes simultaneous start instruction (IPSIMUL(P)) (Page 143, Section 7.12.1 (3)).

(1) Operation details

Two axes can be started simultaneously. The stop timing varies depending on the data of each axis.

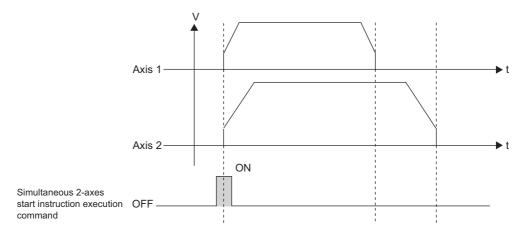




If you want the two axes to generate a linear composite locus, simulated interpolation control can be performed. In this case, take note of the following points:

- · Calculate the speed according to the ratio of movement amounts of two axes.
- Use identical acceleration and deceleration time and deceleration stop time for the two axes.

(Example) "Positioning address/movement amount" ratio Axis 1: Axis 2 = 2:1 Command speed ratio Axis 1: Axis 2 = 2:1

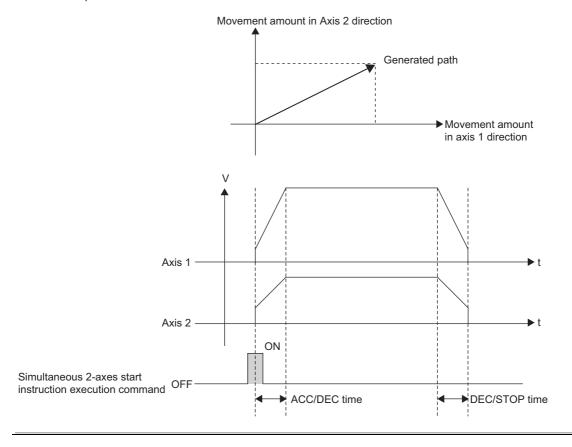

(2) Precautions

- Errors are handled for each axis. If Axis 1 data is abnormal but Axis 2 data is normal, for example, only Axis 2 is started.
- If either axis or both axes is/are operating when the Two axes simultaneous start instruction (IPSIMUL(P)) is executed, the two axes do not start simultaneously. The operating axis or axes continue(s) with the current positioning operation.
- To stop each axis, execute the Axis stop instruction (IPSTOP1) for the axis.

7.9 JOG Operation


JOG operation is used for moving the axis only by a desired movement amount without using positioning data. Use this operation when checking the connection of the positioning control system, or to move the workpiece to inside the range of software stroke limits after operation has stopped by the software stroke limit function. JOG operation is started with the JOG start instruction (IPJOG1) by setting the JOG speed, JOG ACC time, JOG DEC time and direction (PJOG1).

Note that the explanations in this section assume use of Axis 1. For the special relay, special register, dedicated instructions, error codes, and warning codes for Axis 2, refer to the following.

- Special relay and special register: Fage 62, Section 7.4 (2)
- Dedicated instructions: Fage 137, Section 7.12
- Error codes: Fage 173, Section 7.14 (1)
- Warning codes: Fage 177, Section 7.14 (2)

(1) Flow of operation

Operation step	Description of operation
1)	JOG operation is started with the JOG start instruction (IPJOG1). When the execution command for JOG start instruction (IPJOG1) turns on, the axis starts to accelerate in the set direction over the JOG ACC time. The Axis 1 busy (SM1840) turns on.
2)	Once the accelerating workpiece reaches the JOG speed, the axis continues to move with maintaining the JOG speed.
3)	When the execution command for JOG start instruction (IPJOG1) turns off, the axis starts to decelerate from the JOG speed over the JOG DEC time.
4)	The axis stops when the speed drops to 0. The Axis 1 busy (SM1840) turns off.

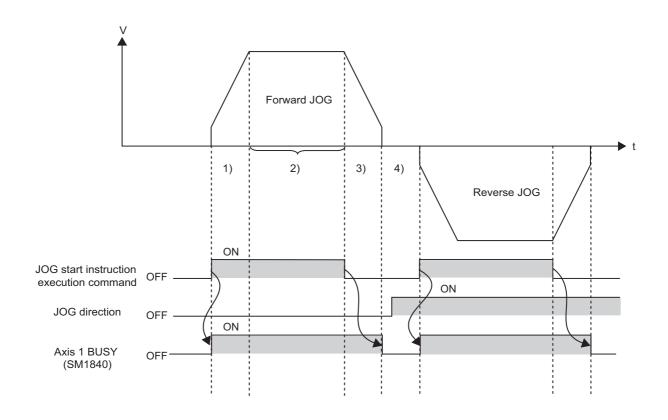


(2) Precautions

(a) JOG speed adjustment

It is dangerous to set a high JOG speed from the beginning. To ensure safety, set a small value first and gradually increase it while checking the operation to adjust to an optimal speed for control.

(b) Axis stop instruction command during JOG operation


When the execution command for Axis stop instruction (IPSTOP1) turns on during JOG operation, the axis decelerates to a stop. If the execution command for JOG start instruction (IPJOG1) turns on while the execution command for Axis stop instruction (IPSTOP1) is on, a "Stop instruction ON at start" error (Axis 1 error code: 1102) occurs and JOG does not start.

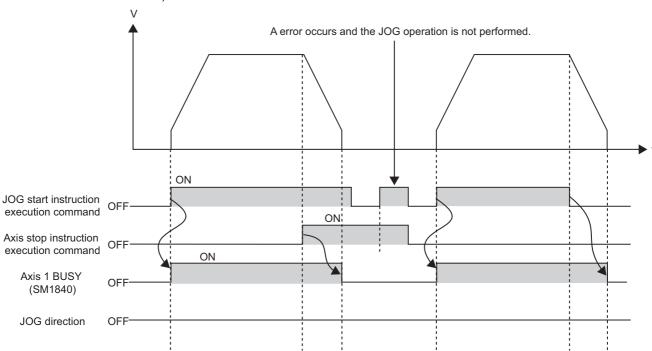

To start JOG operation, follow the steps below.


- 1. Turn off the execution command for JOG start instruction (IPJOG1).
- 2. Reset the axis error.
- 3. Turn off the execution command for Axis stop instruction (IPSTOP1).
- 4. Turn on the execution command for JOG start instruction (IPJOG1) again.

If the execution command for Axis stop instruction (IPSTOP1) is turned on while the execution command for the JOG start instruction (IPJOG1) is on and then the execution command for Axis stop instruction (IPSTOP1) is turned off, JOG operation cannot be performed. To start JOG operation, turn on the execution command for JOG start instruction (IPJOG1) again.

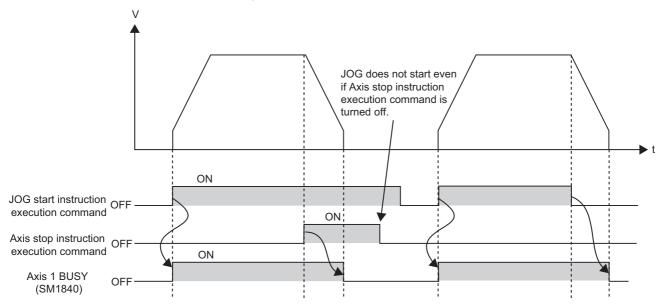

(c) Multiple instruction executions

If the execution command for JOG start instruction (IPJOG1) is turned on again while the axis is decelerating due to the turning off of the JOG start instruction (IPJOG1), JOG operation cannot be performed.

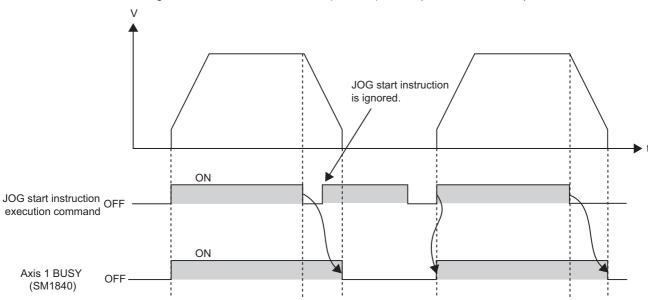

(d) Limitation of JOG speed

If the JOG speed exceeds the set speed limit, the axis operates at the speed limit and an "Out of speed range" warning (Axis 1 warning code: 1020) occurs. If the JOG speed is less than the bias speed at start, the same warning occurs and the bias speed at start is applied.

(e) JOG speed 0

If the bias speed at start is 0 and JOG operation is started by setting 0 for the JOG speed, the special relays and registers assume the following status. If the new speed value is set to other than 0 and the speed is changed accordingly using the Speed change instruction (IPSPCHG1(P)), the Axis 1 speed 0 (SM1844) turns off and JOG operation continues.

- Axis 1 speed 0 (SM1844): On
- · Axis status: Stop
- Axis 1 axis operation status (SD1844): 2 (In JOG control)
- Axis 1 busy (SM1840): On

If the bias speed at start is other than 0, changing the JOG speed to 0 generates an "Out of speed range" warning (Axis 1 warning code: 1020) and the axis operates at the bias speed at start.

(f) Speed change

The speed cannot be changed while the axis is decelerating.

(g) Forward/reverse switching

To switch between forward and reverse directions, check that the Axis 1 busy (SM1840) is off and then turn on the execution command for JOG start instruction (IPJOG1). While the Axis 1 busy (SM1840) is on, establishment of the execution command for JOG start instruction (IPJOG1) is ignored.

(3) Sub function

- The software stroke limit function can be used when the software stroke upper/lower limits are set (Page 120, Section 7.10.4).
- The hardware stroke limit function can be used when upper/lower limit signals are input (Fig. Page 123, Section 7.10.5).
- The JOG speed can be changed using the Speed change instruction (IPSPCHG1(P)).

Important

To perform JOG operation near the perimeter of the moving range, use the hardware stroke limit function (Page 123, Section 7.10.5). If the hardware stroke limit function is not used, the workpiece may go out of the moving range and cause an accident.

7.10 Sub Function

"Sub functions" govern control limitation, addition of function when OPR control, positioning control, and JOG operation are performed. These sub functions are implemented by setting parameters or in programs.

Sub function	Description	Reference
OPR retry function	A function to perform machine OPR automatically by detecting an off edge of the limit signal and moving to a position where machine OPR is possible, even when the OP is not located in the OPR direction	Page 110, Section 7.10.1
Speed limit function	A function to limit the speed to within the setting range of speed limit when the operating speed exceeds the positioning parameter "Speed Limit Value"	Page 114, Section 7.10.2
Speed change function	A function to change the speed during operation	Page 115, Section 7.10.3
Software stroke limit function	A function to not start operation when a start instruction is given to move to the target position which is outside the range set by the upper stroke limit and lower stroke limit. The limit function also stops operation when the current feed value deviates from the setting range.	Page 120, Section 7.10.4
Hardware stroke limit function	A function to decelerate the axis to a stop using a limit switch connected to the connector for external devices	Page 123, Section 7.10.5
Target position change function	A function to change the target value during positioning control.	Page 124, Section 7.10.6
Acceleration/deceleration processing function	A function to adjust the acceleration/deceleration processing as part of control	Page 128, Section 7.10.7
Stop processing function	A function to control the stopping method to be applied when a stop cause occurs during operation	Page 130, Section 7.10.8

Note that the explanations in this section assume use of Axis 1. For the special relay, special register, dedicated instructions, error codes, and warning codes for Axis 2, refer to the following.

- Special relay and special register: Fage 62, Section 7.4 (2)
- Dedicated instructions: 🖙 Page 137, Section 7.12
- Error codes: 🖙 Page 173, Section 7.14 (1)
- Warning codes: Page 177, Section 7.14 (2)

(1) Sub function and external input signal

When the OPR retry function and hardware stroke limit function are used, upper and lower limit signals are required.

7.10.1 OPR retry function

The workpiece may not move toward the OP depending on the position (for example, when it has already exceeded the OP during position control). In this case, normally machine OPR is started again after moving the workpiece to just before the near-point dog using JOG operation. If the OPR retry function is used, however, machine OPR can be performed regardless of where the workpiece is. To operate the OPR retry function, select the limit signal in the OPR direction (upper limit signal or lower limit signal) using the built-in I/O function setting.

(1) OPR methods in which this function is enabled


This function is always enabled when the following OPR methods are used:

- · Near-point dog method
- Count 1
- Count 2

(2) Flow of operation

The following shows OPR retry function when the workpiece is within the range of upper or lower limit switches.

Operation step	Description of operation
1)	Machine OPR starts upon execution of the OPR start instruction (IPOPR1(P)). The axis starts moving in the OPR direction.
2)	The axis decelerates upon detection of turning off of the limit signal.
3)	After stopping upon detection of turning off of the limit signal, it moves in the direction opposite the OPR direction at the OPR speed. "OPR dwell time" is enabled, if set.
4)	The axis decelerates upon turning off of the near-point dog.
5)	After stopping upon turning off of the near-point dog, the axis performs machine OPR in the OPR direction. The OPR dwell time is enabled, if set.
6)	 Machine OPR is complete. Near-point dog method: Machine OPR completes upon detection of the first zero signal after the near-point dog has turned off. Count 1: Machine OPR completes upon detection of the first zero signal after reaching a position corresponding to "Movement amount after near-point dog ON." Count 2: Machine OPR completes upon reaching a position corresponding to "Movement amount after near-point dog ON." (Before machine OPR is complete, the axis decelerates from the creep speed over the OPR deceleration stop time.)

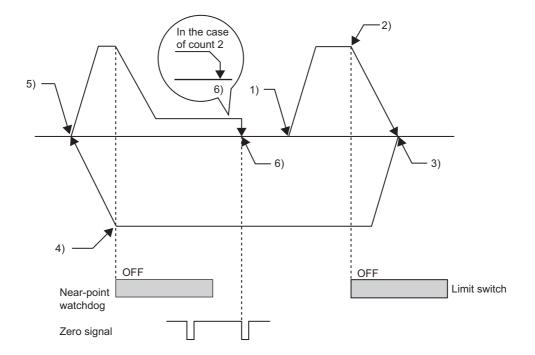


(3) When the workpiece is outside the range of upper or lower limit switches

(a) When the OP direction is the same as the OPR direction

Machine OPR is not performed. A "Hardware stroke limit +" error (Axis 1 error code: 1100) or "Hardware stroke limit -" error (Axis 1 error code: 1101) occurs.


Ex. When "OPR direction" is set to "Forward RUN":

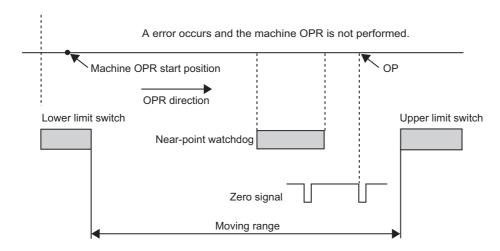

(b) When the OP direction is opposite to "OPR direction":

The axis decelerates to a stop upon turning off of the near-point dog and then performs machine OPR in the direction set as "OPR direction."

Ex. When "OPR direction" is set to "Forward RUN":

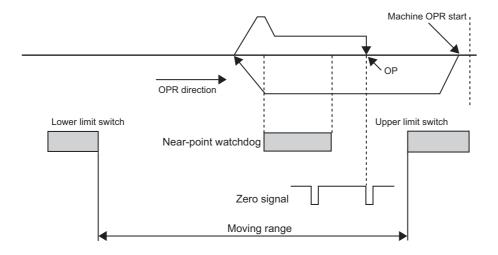


(4) Near-point dog and starting position of machine OPR

If machine OPR is performed at a position where the near-point dog is turned on, the following operations take place under each OPR method:

- · Near-point dog method: Machine OPR starts at the creep speed.
- Count 1 or count 2: Machine OPR is performed according to the OPR retry function.

Ex. Count 1

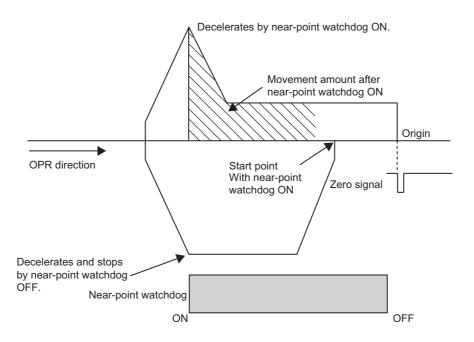

(5) Precautions

- If a limit signal is not selected by the built-in I/O function setting, the OPR retry function does not operate and
 the mechanical system may also be damaged as the axis continues to operate to the limit of the machine
 system.
- If the near-point dog method is used, make sure the area in which the limit switch turns off does not overlap with the area in which the near-point dog turns on. An attempt to start machine OPR in an overlapped area generates "Retry error" (Axis 1 error code: 1202) and the axis stops. If the two areas are overlapped during OPR retry, "Retry error" (Axis 1 error code: 1202) may occur regardless of the OPR method (near-point dog method, Count 1 or Count 2) and the axis may stop.
- Make sure the limit signal in the direction opposite the OPR direction does not turn off during machine OPR.
 A "Hardware stroke limit +" error (Axis 1 error code: 1100) or "Hardware stroke limit -" error (Axis 1 error code: 1101) occurs and the axis stops.
- Do not start machine OPR in an area where the limit signal in the direction opposite the OPR direction is off.
 A "Hardware stroke limit +" error (Axis 1 error code: 1100) or "Hardware stroke limit -" error (Axis 1 error code: 1101) occurs and machine OPR does not start.

7.10.2 Speed limit function

If the operating speed exceeds the speed limit, this function limits the speed to within the setting range of speed limits. To use this function, set the positioning parameter "Speed limit."

(1) Relationship of speed limit function and control

	Control	Operation when the speed limit is exceeded	
OPR control	Machine OPR	No operation occurs. (The OPR speed cannot be set higher than the speed	
OF R CONTION	Fast OPR	limit using the programming tool.)	
	Position control		
	Speed control	An "Out of speed range" warning (Axis 1 warning code: 1020) occurs and the	
Positioning control	Speed/position switching control	command speed is limited to the speed limit.	
	Current value change	_	
JOG operation		An "Out of speed range" warning (Axis 1 warning code: 1020) occurs and the JOG speed is limited to the speed limit.	

7.10.3 Speed change function

The speed change function changes the operating speed to a newly specified speed at a desired timing. This function is implemented with the Speed change instruction (IPSPCHG1(P)) by setting the new speed value, ACC/DEC time at speed change and DEC/STOP time at speed change (Page 156, Section 7.12.1 (8)).


(1) Controls that permit speed change and timings of change

The speed can be changed during the controls denoted by "Speed change possible" in the table below, at the specified timings. If speed change is not possible, a "Speed change not possible" warning (Axis 1 warning code: 1022) occurs and the instruction is ignored, or the instruction is simply ignored without any warning.

Control		During acceleration	During constant-speed operation	During speed change by the Speed change instruction (IPSPCHG1(P))	During deceleration	During deceleration by the Axis stop instruction (IPSTOP1)
OPR control	Machine OPR	Warning	Warning	_	Warning	Ignored
Of IX control	Fast OPR	vvairing	vvarriing		vvarriing	ignored
	Position control	Warning	Speed change possible	Warning	Warning	Ignored
Positioning	Speed control	Speed change possible	Speed change possible	Speed change possible	_	Ignored
control	Speed control of speed/position switching control	Speed change possible	Speed change possible	Speed change possible	_	Ignored
	Position control of speed/position switching control	Warning	Speed change possible	Warning	Warning	Ignored
JOG operation		Speed change possible	Speed change possible	Speed change possible	Ignored	Ignored

(2) Description of operation

Ex. Speed change under speed control

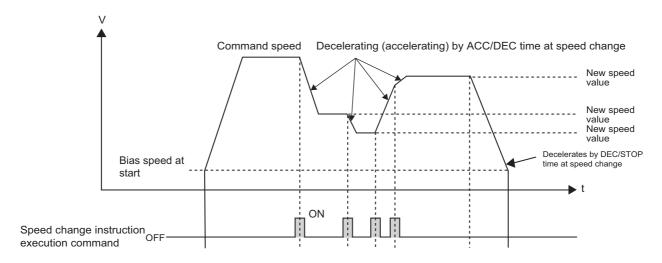

(3) Precautions


(a) Limitation of new speed value

If the new speed value exceeds the speed limit, the axis operates at the speed limit and an "Out of speed range" warning (Axis 1 warning code: 1020) occurs. If the new speed value is less than the bias speed at start, the same warning occurs and the bias speed at start is applied.

(b) Operation during processing


Even when the workpiece is moving at the command speed or JOG speed, speed change is not accepted if calculations are in progress following the establishment of the execution command for Speed change instruction (IPSPCHG1(P)).

Ex. Timings at which speed change is permitted during position control

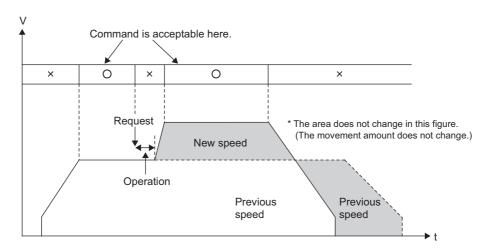

Remark

Change to a new speed occurs after completion of pulse output at the current speed.

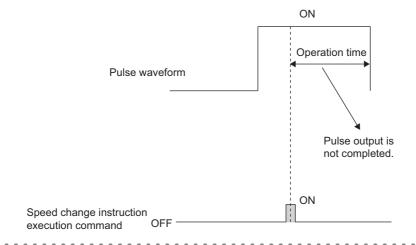

116

(c) Speed change during position control

If the target position is reached during the processing for speed change in the case of a speed change during position control or position control of speed/position switching control, a "Speed change not possible" warning (Axis 1 warning code: 1022) occurs and the speed is not changed.


(d) Target position change and speed change

If the Target position change instruction (IPTPCHG1(P)) is accepted simultaneously as the execution command for Speed change instruction (IPSPCHG1(P)) is established, a "Speed change not possible" warning (Axis 1 warning code: 1022) generates and the Speed change instruction (IPSPCHG1(P)) is cancelled. (For example, if the execution command for Target position change instruction (IPTPCHG1(P)) is established during acceleration, the operation switches to a constant speed and the target position change is accepted. If the execution command for Speed change instruction (IPSPCHG1(P)) is established at this timing, it means that the execution commands for both instructions are established simultaneously.) (Page 124, Section 7.10.6)

(e) Speed change and deceleration stop time

When the speed is changed during position control or position control of speed/position switching control in the following condition, positioning completes before the stop speed reaches the bias speed at start.


• The deceleration stop time is longer than the remaining movement amount at the end of speed change and thus the constant-speed part of operation cannot be performed after the speed has changed.

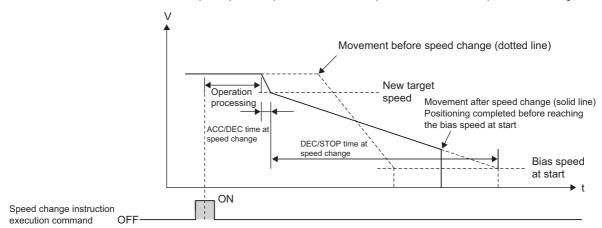

(f) Speed change to 0

When bias speed at start is 0
 If the bias speed at start is set to 0 and new speed value is changed to 0, the axis stops.

 However, the Axis 1 busy (SM1840) does not turn off. Even when the axis is stopped, the Axis 1 axis operation status (SD1844) does not change.

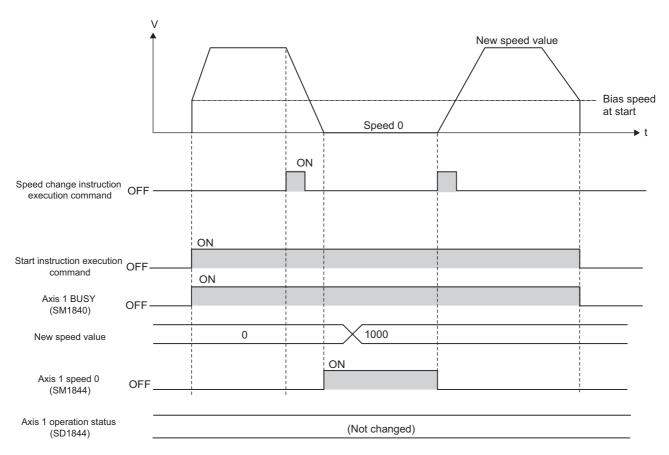

- When bias speed at start is other than 0
 When the speed is changed to 0, an "Out of speed range" warning (Axis 1 warning code: 1020) occurs and the axis operates at the bias speed at start.
- Occurrence of error
 If the speed is changed and "Outside the acceleration/deceleration time setting" error (Axis 1 error code: 1502) or "Deceleration stop time out of range" error (Axis 1 error code: 1503) occurs under operation at speed 0, the axis stops and the Axis 1 axis operation status (SD1844) changes to Error occurring (-1).

(g) Speed change and "out of setting range" error

If an "Outside the acceleration/deceleration time setting" error (Axis 1 error code: 1502) or "Deceleration stop time out of range" error (Axis 1 error code: 1503) occurs at the start of speed change, the Axis 1 axis operation status (SD1844) changes to Error occurring (-1). When each control is active, the following operations are performed according to the control.


- In position control (including it of speed/position switching control)
 Position control continues until the end and the axis decelerates to a stop over the deceleration stop time effective before the speed change.
- In speed control
 The axis decelerates to a stop over the deceleration stop time effective before the speed change.
- In JOG operation
 The axis decelerates to a stop over the JOG deceleration time effective before the speed change or DEC/STOP time at speed change (if the last speed change was successful).



The DEC/STOP time at speed change represents the "time until the axis stops at the new speed value" and not the "time until the axis stops at the current speed."

7.10.4 Software stroke limit function

This function prevents execution of a moving command to a position outside the upper/lower limit of the moving range of the workpiece. The range is set using the address established by machine OPR.

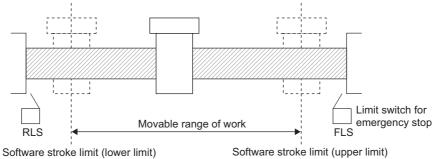

(1) Range check

A software stroke limit range check is executed at the start of operation and also during operation.

(a) Range check at start of operation

The following are checked at start of operation

- · Whether operation starts from outside the range of software stroke limits
- · Whether operation starts to outside the range of software stroke limits

The software stroke limit range check is processed as follows depending on the applicable control.

In the table, "error" indicates "Software stroke limit +" (Axis 1 error code: 1103) or "Software stroke limit -" (Axis 1 error code: 1104).

Control		Operation after range check
Ма	achine OPR	Check is not performed.
Fast OPR	OP address	 If the Axis 1 current feed value (SD1840, SD1841) is outside the range of software stroke limits, an error occurs and operation does not start. If the OP address is outside the range of software stroke limits, an error occurs and operation does not start.
r ast OF IX	Standby address	 If the Axis 1 current feed value (SD1840, SD1841) is outside the range of software stroke limits, an error occurs and operation does not start. If the standby address is outside the range of software stroke limits, an error occurs and operation does not start.
	Position control	If the Axis 1 current feed value (SD1840, SD1841) is outside the range of software stroke limits, an error occurs and operation does not start. If the value of "Positioning address/movement amount" is outside the range of software stroke limits, an error occurs and operation does not start.
	Speed control	
Positioning control	Speed/position switching control (in speed control)	Check is not performed.
	Speed/position switching control (in position control)*1	 If the Axis 1 current feed value (SD1840, SD1841) is outside the range of software stroke limits, an error occurs and operation does not start. If the value of "Positioning address/movement amount" is outside the range of software stroke limits, an error occurs and operation does not start.
	Current value change	If the new current value is outside the range of software stroke limits, an error occurs and the current value is not changed.
JOG operation		When the Axis 1 current feed value (SD1840, SD1841) is outside the range of software stroke limits and: If operation is started in the direction of going out of the range of software stroke limits, an error occurs and operation does not start. If operation is started in the direction of going into the range of software stroke limits, an error does not occur and operation starts.
Absolute p	position restoration	Check is not performed.

^{*1} If speed/position switching control is started while the external command signal is still on, operation starts under position control.

(b) Range check during operation

The software stroke limit range check is processed as follows depending on the applicable control. In the table, "error" indicates "Software stroke limit +" (Axis 1 error code: 1103) or "Software stroke limit -" (Axis 1 error code: 1104).

Control		Operation after range check
OPR control	Machine OPR	Charle is not notformed
OPR COILLOI	Fast OPR	Check is not performed.
	Position control	If the Axis 1 current feed value (SD1840,SD1841) may exceed the software stroke limit by changing the target position, the change is not executed and the original positioning operation is continued. An error occurs after the positioning is completed.
	Speed control	
	Speed/position switching control (in speed control)	Check is not performed.
Positioning control	Speed/position switching control (in position control)	 If the Axis 1 current feed value (SD1840, SD1841) is outside the range of software stroke limits upon switching to position control, an error occurs and the axis decelerates to a stop. If the value of "Positioning address/movement amount" is outside the range of software stroke limits upon switching to position control, an error occurs and the axis decelerates to a stop. If the target position is changed and the Axis 1 current feed value (SD1840, SD1841) exceeds the software stroke limit as a result, the target position change is ignored and the control continues based on the original value of "Positioning address/movement amount." An error occurs after the positioning is completed.
	Current value change	
JO	G operation	An error occurs at the moment the Axis 1 current feed value (SD1840, SD1841) exceeds the software stroke limit, and the axis decelerates to a stop.
Absolute	position restoration	Check is not performed.

(2) Precautions

- Execute machine OPR beforehand so that the software stroke limit function operates normally.
- Setting the software stroke upper/lower limits prevents a software overrun. To make doubly sure, also provide emergency stop limit switches near the outer perimeter of the range.




With the Two axes simultaneous start instruction (IPSIMUL(P)), the current values of the two axes to be started simultaneously are checked against the stoke limits. If either axis generates an error, only the other axis is started.

7.10.5 Hardware stroke limit function

The hardware stroke limit function stops the control (after deceleration) by detecting an input from the upper and lower limit switches that are installed at the upper and lower limit of the physical moving range. Equipment damage can be prevented by this function. Normally a hardware stroke limit is set on the stroke limit on the drive unit side or inside of the stroke end, to stop the control before this stroke limit or stroke end is reached. For the limit signal, select either the upper limit signal or lower limit signal using the built-in I/O function setting.

(1) System overview

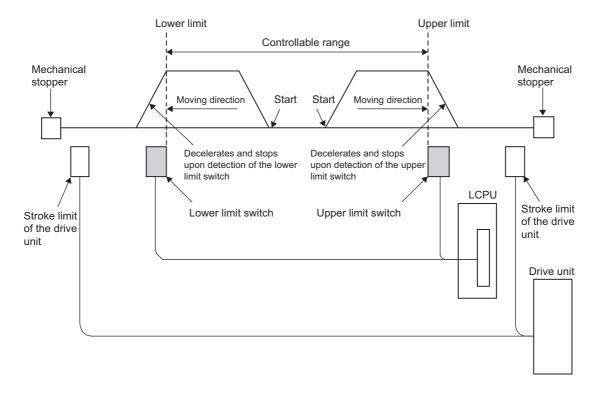

(2) Precautions

While the axis is stopped outside the controllable range (outside the upper or lower limit switch) or after detection of a limit switch, OPR control and positioning control cannot be started. Start each control after moving the workpiece to inside the controllable range via JOG operation.


7.10.6 Target position change function

The target position change function changes the target position set by "Positioning address/movement amount" during position control (including it of speed/position switching control), to a new target position at a desired timing. This function is implemented with the Target position change instruction (IPTPCHG1(P)) (Page 159, Section 7.12.1 (9)). The following shows the target position of each control system.


- Position control (ABS): Address with reference to the OP address
- Position control (INC): Movement amount from the starting address
- Position control of speed/position switching control: Movement amount from the address at which speed control switched to position control

(1) Control details


• If the position of the workpiece upon establishment of the execution command for Target position change instruction (IPTPCHG1(P)) is located before the position at which to start decelerating to the new target value over the deceleration stop time, positioning is performed to the new target position.

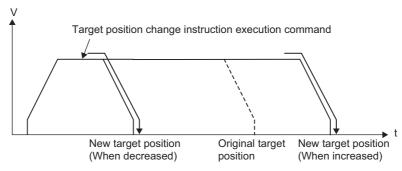

• If the position of the workpiece upon establishment of the execution command for Target position change instruction (IPTPCHG1(P)) exceeds the position at which to start decelerating to the new target value over the deceleration stop time, the axis decelerates to a stop and then positions itself to the new target position.

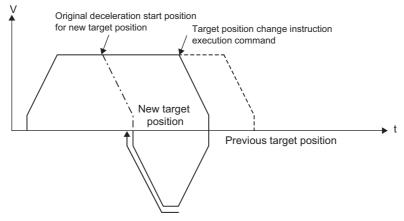


• If the workpiece is decelerating when the execution command for Target position change instruction (IPTPCHG1(P)) is established, the axis decelerates to a stop and then positions itself to the new target position.

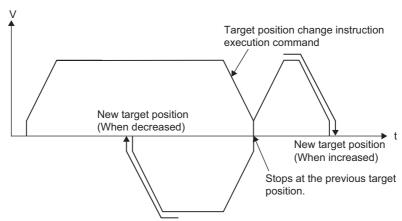

(2) Precautions

(a) Instruction execution during acceleration/deceleration

If the axis was accelerating/decelerating to the command speed when the execution command for Target position change instruction (IPTPCHG1(P)) was established, the workpiece is allowed to reach the command speed, after which positioning to the new target position is performed. If the axis starts decelerating to a stop before reaching the command speed, positioning to the new target position is performed after the axis has decelerated to a stop.

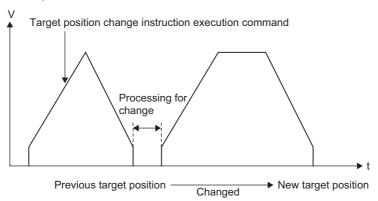

(b) Software stroke limit

If the new target value exceeds the range of software stroke limits, the target position is not changed and the positioning control effective before the establishment of the execution command for Target position change instruction (IPTPCHG1(P)) continues. When the positioning control is complete, a "Software stroke limit +" error (Axis 1 error code: 1103) or "Software stroke limit -" error (Axis 1 error code: 1104) occurs. (If causes of both "Software stroke limit +" error (Axis 1 error code: 1103) and "Software stroke limit -" (Axis 1 error code: 1104) occurs.)

(c) Multiple target position changes

The target position can be changed as many times as desired during a single operation.

- During operation under position control (INC), a new target position is always defined by the movement amount from the current value from which positioning is started.
- During position control of speed/position switching control, a new target position is always defined by the movement amount from the current value (0) at which speed control switched to position control.

If the target position is changed multiple times while the workpiece is accelerating/decelerating to the command speed or simply decelerating, only the last target position change is implemented.

(d) Target position change and speed change

If the execution command for Target position change instruction (IPTPCHG1(P)) is established during speed change, the target position change is executed upon completion of the speed change. Note that if the new speed value is 0, only the target position is changed and the workpiece does not move. If the speed is set to other than 0, positioning is performed to the target position.

(e) Positioning control and target position change

The target position cannot be changed during operation other than when position control is active. A "Target position change not possible" warning (Axis 1 warning code: 1021) occurs.

(f) When Axis 1 speed 0 (SM1844) is on

If the Target position change instruction (IPTPCHG1(P)) is executed when the Axis 1 speed 0 (SM1844) is on, a "Target position change not possible" warning (Axis 1 warning code: 1021) occurs and the target position is not changed.

(g) Axis 1 axis operation status (SD1844) and target position change

If the Axis 1 axis operation status (SD1844) is indicating a stopped status (1) or indicating a standby status (0), the target position is not changed.

(h) Instruction calculation and positioning completion

If positioning based on positioning data completes while the calculation relating to the Target position change instruction (IPTPCHG1(P)) is still in progress, the target position is not changed. A "Target position change not possible" warning (Axis 1 warning code: 1021) occurs.

(i) Acceleration and deceleration

Target position change does not involve acceleration or deceleration change. (The slope in the VT diagram does not change.)

(j) Target position change value during position control of speed/position switching control

For the target position change value during position control of speed/position switching control, do not set a negative value.

If a negative value is set, a "Movement amount setting out of range under speed/position switching control" error (Axis 1 error code: 1504) occurs.

(The target position change is ignored and position control continues.)

7.10.7 Acceleration/deceleration processing function

The acceleration/deceleration processing function is used to adjust the acceleration/deceleration when OPR control, positioning control or JOG operation is performed. By adjusting the acceleration/deceleration processing according to each control, the control can be implemented in a more detailed manner.


(1) Decision of acceleration/deceleration processing method

The acceleration/deceleration method is determined by the setting items specified below.

Function	Operation start speed	Acceleration time	Target speed	Deceleration time
OPR control	Bias speed at start*1	OPR acceleration/deceleration time	OPR speed ^{*2}	OPR acceleration/deceleration time*1
Positioning control		Acceleration/deceleration time	Command speed	Deceleration stop time
JOG operation	Bias speed at start	JOG ACC time	JOG speed	JOG DEC time
Speed change function		ACC/DEC time at speed change	New speed value	DEC/STOP time at speed change

Deceleration is to the creep speed. In the Count 2 method, the axis decelerates from the creep speed over the OPR deceleration stop time prior to the completion of machine OPR (Page 71, Section 7.6.1). Also during fast OPR, the axis decelerates from the OPR speed over the OPR deceleration stop time.


*2 In the Stopper 3 method, the creep speed applies (Page 82, Section 7.6.1 (6)).

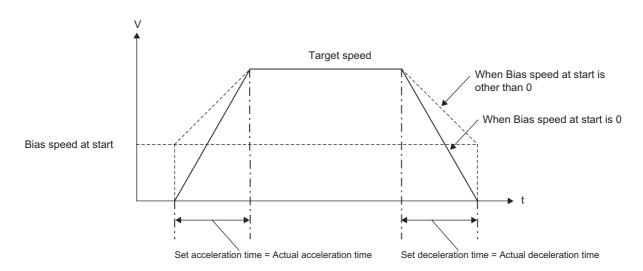

(2) Trapezoidal acceleration/deceleration, S-curve acceleration/deceleration

Set an appropriate method by the positioning parameter "Acceleration/deceleration method selection" (Page 60, Section 7.3.1 (6)).

When S-curve acceleration/deceleration is selected, the motor load can be reduced upon start and during standstill.

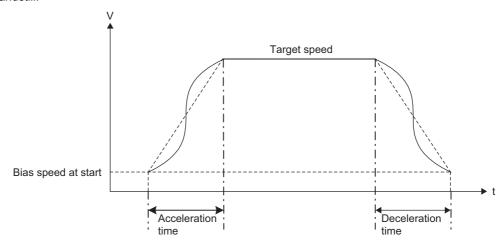

(3) Set acceleration/deceleration time and actual acceleration/deceleration time

Basically the acceleration/deceleration time set by the parameter becomes the actual acceleration/deceleration time, so the speed limit does not affect the acceleration/deceleration time. However, the following differences apply depending on the acceleration/deceleration method selected:

(a) Trapezoid acceleration/deceleration method

Both become equal regardless of whether the bias speed at start is 0 or not 0.

(b) S-curve acceleration/deceleration method

Since the final speed of deceleration becomes 1 pulse/s faster than the bias speed at start, the actual deceleration time becomes longer than the set deceleration time. In this case, the actual deceleration time can be shortened by setting the bias speed at start to other than 0.

(4) Precautions

- If the target speed is 1 pulse/s, the set acceleration/deceleration time is ignored.
- If the constant speed is not performed during operation (for example, when the axis starts decelerating to a stop during acceleration/deceleration), the axis does not operate at the set acceleration/deceleration time.

7.10.8 Stop processing function

The following explains the stop processing that takes place when a stop cause occurs during operation. The deceleration time after the occurrence of a stop cause varies depending on the specific control.

Control details	Deceleration time
Positioning control	 Positioning using the Table start instruction (IPPSTRT1(P)): Positioning data "Deceleration stop time" Positioning using the Positioning start instruction (IPDSTRT1(P)): Setting data "Deceleration stop time"
JOG operation	JOG DEC time set as control data in the JOG start instruction (IPJOG1)
OPR control	OPR parameter "OPR deceleration stop time"
After speed change	DEC/STOP time at speed change, set by the Speed change instruction (IPSPCHG1(P))

(1) Details of stop processing control

- · When a stop cause occurs, the axis decelerates to the bias speed at start and then stops.
- If the axis reaches the specified position while decelerating following the occurrence of a stop cause, it stops immediately.

(2) Stop cause

A stop cause occurs at the following conditions.

- · Each control ends successfully
- · An error occurs
- · The Axis stop instruction (IPSTOP1) is executed
- · A return operation occurs during target position change


The following shows operations when above conditions occur except "each control ends successfully".

Stop cause	Positioning control	OPR control	JOG operation	Target axis	Axis 1 axis operation status (SD1844) after stopping
Software stroke upper limit	Deceleration	_	Deceleration to a stop	For each axis	Error occurring (-1)
Software stroke lower limit	to a stop		Deceleration to a stop	1 of cacif axis	Life occurring (-1)
Hardware stroke upper limit	Deceleration	Deceleration			Error occurring (-1)
Hardware stroke lower limit	to a stop	to a stop	Deceleration to a stop	For each axis	(Except when OPR
- I laidware stroke lower limit	10 0 010 p	to a stop			retry is performed.)
Program execution is stopped.	Deceleration	Deceleration	Deceleration to a stop	All axes	Error occurring (-1)
1 Togram exceditor is stopped.	to a stop	to a stop	Deceleration to a stop	All dACS	Life occurring (-1)
Drive unit ready signal is off.	Deceleration	Deceleration	Deceleration to a stop	For each axis	Error occurring (-1)
Drive drift ready signal is on.	to a stop	to a stop	Deceleration to a stop	1 Of Cacif axis	Error occurring (-1)
The Axis stop instruction (IPSTOP1) is	Deceleration	Deceleration	Deceleration to a stop	For each axis	Stopped (1)
executed.	to a stop	to a stop	Deceleration to a stop	1 Of Cacif axis	Stopped (1)
A return operation occurs during target	Deceleration				
position change	to a stop	_	_	_	_
(Operating normally)	to a stop				

(3) Stop processing during speed change


If the axis starts decelerating to a stop before the new speed value is reached, the actual deceleration stop time may not become the same as the set value of "Deceleration stop time."

Ex. When a stop cause occurs in the middle of speed change during speed control

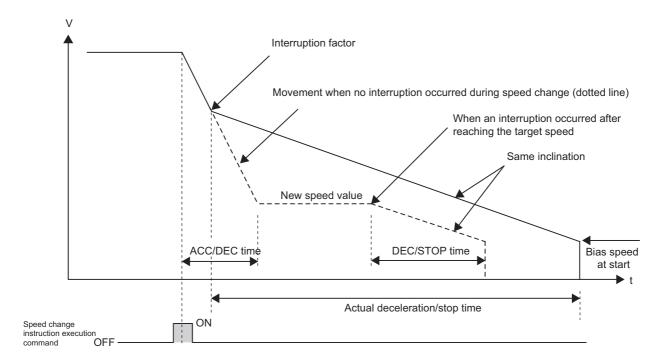

(4) Stop processing during S-curve acceleration/deceleration

If a stop cause occurs while the axis is accelerating according to "S-curve acceleration/deceleration," the S-curve needed to decelerate from the current speed is recalculated. The axis moves at a constant speed while the calculation is in progress.

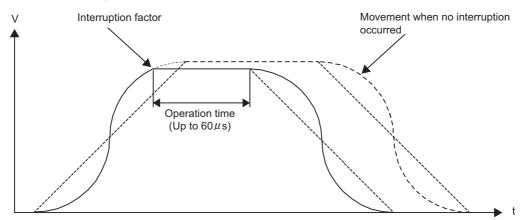


Since pulses are output during constant-speed operation, the positioning address may be reached during deceleration. In this case, the axis stops immediately upon reaching the positioning address.

(5) Stopping after simultaneous starting of two axes

The axes started by the Two axes simultaneous start instruction (IPSIMUL(P)) are not stopped simultaneously. Each axis must be stopped separately. (Fig. Page 101, Section 7.7.5)

(6) Pulse output processing upon stop

If the axis stops due to occurrence of a stop cause, pulse output currently in progress after elapse of the set deceleration stop time after the start of deceleration stop will continue until one pulse is output. The actual deceleration time may become longer by a maximum of 1s than the deceleration stop time. As indicated by the calculation formula below, the extended deceleration stop time can be reduced by increasing the value of "Bias speed at start."

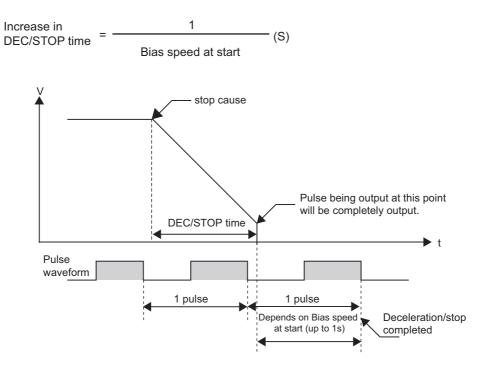


(7) The Axis stop instruction (IPSTOP1) is executed.

Even if the execution command for axis stop instruction is established in the middle of deceleration, the current deceleration is continued until the axis stops. (Fig. Page 154, Section 7.12.1 (7))

7.11 Absolute Position Restoration Function

The absolute position restoration function restores the absolute position of the specified axis using the absolute position detection system. The Absolute position restoration function (IPABRST1) (Page 152, Section 7.12.1 (6)) is used to adjust the Axis 1 current feed value (SD1840, SD1841) to the actual motor position. This way, machine OPR is no longer necessary after the power was cut off due to a momentary power failure or emergency stop, and the onsite recovery work can be performed easily.

(1) Configuration of Absolute position detection system

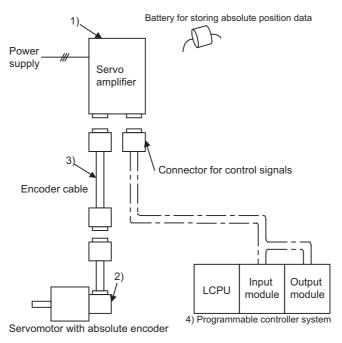


No.	Component	Description
1)	Servo amplifier ^{*1}	 Install the battery in the servo amplifier. Enable the absolute position detection function of the servo amplifier. For details, refer to the manual for the servo amplifier used.
2)	Servo motor	Use a servomotor with absolute position detector. For details, refer to the manual for the servo motor used.
3)	Encoder cable	Wire the battery power connection lines (BAT/LG signals) to the incremental encoder cable. For details, refer to the manual for the cable used.
4)	Programmable controller system	 Absolute position detection data is sent/received using general-purpose I/Os or the I/O module (three input points, three output points*2).

- *1 Any Mitsubishi general-purpose AC servomotor (pulse-train type) supporting absolute position detection systems
- *2 The orders of three input points and three output points are determined, and the device numbers must be consecutive.

(2) Communication overview of absolute position detection data


As shown below, the detector consists of phase A/B/Z signals for position control during normal operation, an encoder for detecting positions within one rotation, and an accumulative revolution counter for detecting the rotation amount. This absolute position detection system always detects the absolute position of the machine and stores it in a memory backed up by a battery, regardless of the power condition of the programmable controller system. Accordingly, once the OP is initially set when the machine is installed*1, machine OPR is no longer necessary at subsequent power-on operations and recovery also becomes easy in the event of a momentary power failure or emergency stop. Also, absolute position data is backed up using a super capacitor in the detector, which means that absolute position data is retained for a specified time even when the cable is disconnected or breaks.

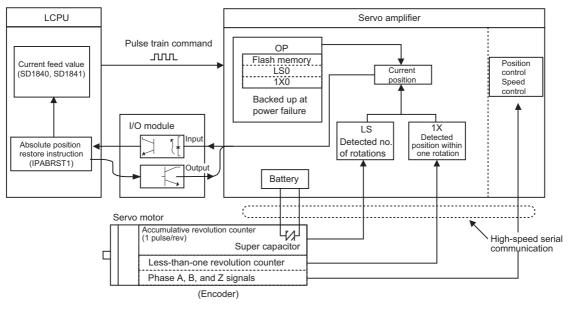

*1 Operation to output a deviation counter clear signal to the servo amplifier at the OP position. This operation must be performed before absolute position restoration. When other than Count 2 is selected: Perform machine OPR, output a deviation counter clear signal. When Count 2 is selected: Wire a general-purpose output signal to the deviation counter clear signal line of the servo amplifier, perform JOG operation to adjust the position, and then turn the signal on.

(3) Connection example with a servo amplifier (MR-J3-A) manufactured by Mitsubishi

For details, refer to the manual for the MR-J3-A specification.

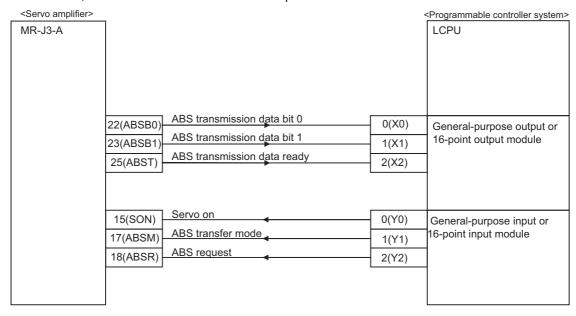

(a) Connector pin on servo side

Signal name	Abbreviation	Pin No.	Function and application
Servo on	SON	15	This signal is on when the servo amplifier is normal.
ABS transfer mode	ABSM	17	While this signal is on, the servo amplifier operates in the ABS transfer mode and the functions of CN1-22, 23 and 25 conform to those shown in this table.
ABS request flag	ABSR	18	This signal turns on when ABS data is requested in the ABS transfer mode.
ABS transmission data bit 0	ABSB0	22	Lower bit of the two ABS data bits to be transferred to the programmable controller system from the servo in the ABS transfer mode.
ABS transmission data bit 1	ABSB1	23	Upper bit of the two ABS data bits to be transferred to the programmable controller system from the servo in the ABS transfer mode.
ABS transmission data ready	ABST	25	This signal turns on when the ABS transmission data is ready in the ABS transfer mode.

(4) Condition for starting positioning using the absolute position detection system

Use the system within the range where conditions 1 and 2 specified below are satisfied. If this range is exceeded, the current value cannot be successfully restored by absolute position restoration.

(a) Condition 1: Number of output pulses

This is the number of pulses that can be output to the servo amplifier when positioning is performed from the OP using the absolute position detection system. With the absolute position detection system, pulses within the range calculated by the formula below, around the OP, can be output to the servo amplifier:

 $\{-32678 \ x \ (Number of feedback pulses)\} \le Number of output pulses \le \{32768 \ x \ (Number of feedback pulses) - 1\}$

The number of feedback pulses indicates pulses per servomotor rotation as recognized by the LCPU.

Ex. Number of feedback pulses = 8192: -268435456 (pulses) to 268435455 (pulses) Number of feedback pulses = 16384: -536870912 (pulses) to 536870911 (pulses)

(b) Condition 2: Positioning address

Set an appropriate address within the settable range of "Positioning address/movement amount."

Setting range: -2147483648 (pulses) to 2147483647 (pulses)

(5) Precautions

- With the absolute position detection system, the following controls cannot be performed:
 - · Feed control for unlimited length in one direction only, such as a turntable
 - Control where the movement amount from the OP address exceeds the ranges of conditions 1 and 2 explained in Page 136, Section 7.11 (4)
- With the Absolute position restoration function (IPABRST1), three consecutive bits starting from the input signal and output signal set by the arguments are used, respectively. Do not mistakenly use them as I/O signals for other purposes.
- If you have built an absolute position detection system, perform absolute position restoration at least once after the power on or reset.

Important

When absolute position restoration is performed, the servo ON signal may turn off (thereby causing the servo to turn off) for approx. 20 ms and the motor may move as a result. If this causes a problem, provide an electromagnetic brake to lock the motor during absolute position restoration.

7.12 Dedicated Instructions


The following table lists and describes dedicated instructions for the positioning function.

Ex. The table start instruction for Axis 1 is IPPSTRT1(P), and for Axis 2 is IPPSTRT2(P).

Instruction		Description	Reference
Axis 1	Axis 2	Description	Reference
IPPSTRT1(P)	IPPSTRT2 (P)	Start operation based on the desired data number specified among "Positioning data" No.1 to 10 set beforehand using the programming tool.	Page 138, Section 7.12.1 (1)
IPDSTRT1(P)	IPDSTRT2(P)	Start positioning with data stored in the device specified by control data and subsequent devices, without using "Positioning data" No.1 to 10 set beforehand using the programming tool.	Page 140, Section 7.12.1 (2)
IPSIM	UL(P)	Start positioning using the specified "Positioning data" number for Axis 1, and positioning using the specified "Positioning data" number for Axis 2, simultaneously.	Page 143, Section 7.12.1 (3)
IPOPR1(P)	IPOPR2(P)	Start OPR of the specified axis based on the specified method.	Page 146, Section 7.12.1 (4)
IPJOG1	IPJOG2	JOG operation of the specified axis is started.	Page 149, Section 7.12.1 (5)
IPABRST1	IPABRST2	Perform absolute position restoration of the specified axis.	Page 152, Section 7.12.1 (6)
IPSTOP1	IPSTOP2	Stop the operating axis.	Page 154, Section 7.12.1 (7)
IPSPCHG1(P)	IPSPCHG2(P)	Change the speed of the specified axis.	Page 156, Section 7.12.1 (8)
IPTPCHG1(P)	IPTPCHG2(P)	Change the target position of the specified axis.	Page 159, Section 7.12.1 (9)

7.12.1 Details of dedicated instructions

(1) Table start instructions: IPPSTRT1(P), IPPSTRT2(P)

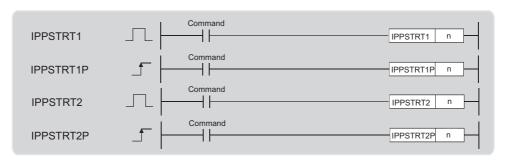


	Internal device		R, ZR		J=/=				Constant		
Setting data	Bit	Word	,		Bit	Word	UD/GD	Z	К, Н	•	Others
	DIL	word	Bit	Word	ы	Bit Word			к, п	Φ	
n	1	0	_	0	_	_		0	0	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type	
n	Positioning data No.	1 to 10	BIN 16-bit	

(b) Function

- These instructions start operation based on the desired data number specified by "n" among "Positioning data" No.1 to 10 set beforehand using the programming tool.
- Ex. Timing chart when "Positioning data" No.1 is executed

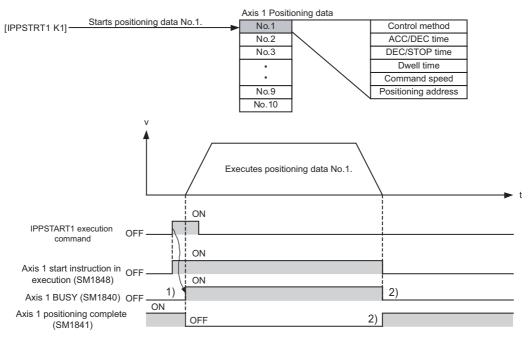

- When positioning control starts successfully, the Axis 1 busy (SM1840) turns on. (1))
- When positioning is complete, the Axis 1 busy (SM1840) turns off and Axis 1 positioning completion (SM1841) turns on. (2))
- The Axis 1 positioning completion (SM1841) will turn off the next time the applicable axis is started.
- If the Axis stop instruction (IPSTOP1) is executed or an error is detected during positioning, the axis decelerates to a stop and the Axis 1 positioning completion (SM1841) does not turn on.

The number of steps is basically two.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• A value other than 1 to 10 is specified in "n":

(Error code: 4100)

· Inapplicable device is specified in "n":


(Error code: 4101)

The positioning function for the target axis is not set to "Use":


(Error code: 4116)

(d) Program example

Program that starts "Positioning data" No.1 for Axis 1 when M0 turns on



(2) Positioning start instructions: IPDSTRT1(P), IPDSTRT2(P)

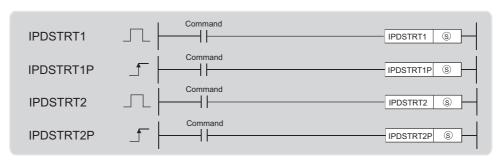

	Internal device		R, ZR		J 🗆 / 🗆				Constant		
Setting data	Bit	Word	,		Bit	Word	U□\G□	Z□	К, Н	4	Others
	DIL	Word	Bit	Word	Bit	VVOIG			к, п	Þ	
<u>\$</u>	1	0	_	0	_	_	_	_	-	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type	
	Device start number of the device	Within the range of a specified	Device name	
<u>S</u>	storing control data	device	Device Hairie	

(b) Control data

Device	Item	Setting data	Setting range	Set by
(S)	Control system	1: Position control (ABS) 2: Position control (INC) 3: Speed/position switching control (forward RUN) 4: Speed/position switching control (reverse RUN) 5: Current value change 6: Speed control (forward RUN) 7: Speed control (reverse RUN)	1 to 7	
<u>s</u> +1	Acceleration/deceleration time	_	0 to 32767 (ms)	User
S+2	Deceleration stop time	_	0 to 32767 (ms)	
<u>S</u> +3	Dwell time	_	0 to 65535 (ms)*1	
©+4 ©+5	Command speed	_	0 to 200000 (pulse/s)*2	
©+6 ©+7	Positioning address/movement amount	_	-2147483648 to 2147483647 (pulse)	

^{*1} In the program, enter the setting values as follows:


¹ to 32767: Enter as decimals.


 $^{32768\} to\ 65535$: Convert to hexadecimals and enter the resulting hexadecimals.

^{*2} If the set value of command speed is outside 0 to 200000, the axis may operate at the speed limit.

(c) Function

- These instructions start positioning with data stored in the device specified by (§) and subsequent devices, without using "Positioning data" No.1 to 10 set beforehand using the programming tool.
- Ex. Timing chart when position control is performed by setting the start device number in D0

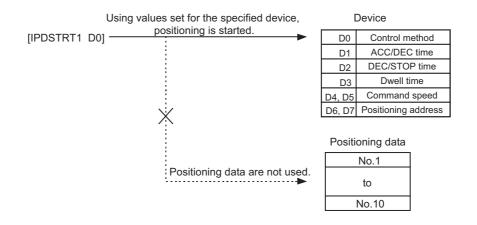

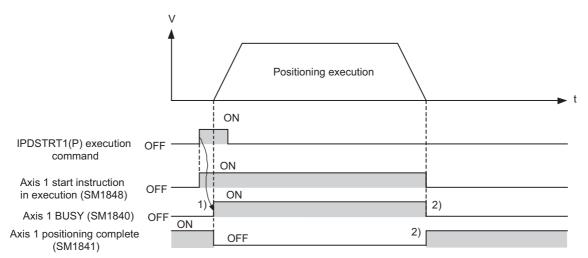

- When positioning control starts successfully, the Axis 1 busy (SM1840) turns on. (1))
- When positioning is complete, the Axis 1 busy (SM1840) turns off and Axis 1 positioning completion (SM1841) turns on. (2)) (During speed control, causes that stop the axis include execution of the Axis stop instruction (IPSTOP1) and aborted operation due to error detection. Accordingly, the Axis 1 positioning completion (SM1841) does not turn on.)
- The Axis 1 positioning completion (SM1841) will turn off the next time the applicable axis is started.
- If operation cannot be started because (s) is outside the setting range, the Axis 1 error (SM1845) turns on.
- If the Axis stop instruction (IPSTOP1) is executed or an error is detected during positioning, the axis decelerates to a stop and the Axis 1 positioning completion (SM1841) does not turn on.

The number of steps is basically two.

(d) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Inapplicable device is specified in §:

(Error code: 4101)


• The positioning function for the target axis is not set to "Use":

(Error code: 4116)


(e) Program example

Program that starts Axis 1 based on the set positioning data below when M0 turns on

Device used	Item	Setting item		
D0	Control system	Position control (ABS)		
D1	Acceleration/deceleration time	1000 (ms)		
D2	Deceleration stop time	1000 (ms)		
D3	Dwell time	0 (ms)		
D4, D5	Command speed	20000 (pulse/s)		
D6, D7	Positioning address/movement amount	100000 (pulse)		

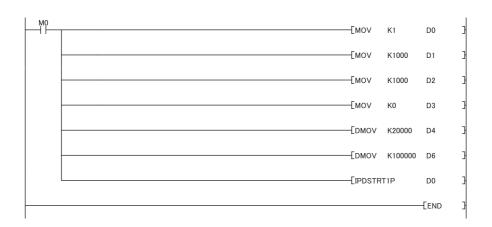

(3) Two-axes simultaneous start instruction: IPSIMUL(P)




	Intern	nal device	R.	ZR	JE	1_		J=\=			Constant		
Setting data	Bit	Word	14,		Bit	Word	UD/GD	Z	K, H	¢	Others		
	Ď.	vvoru	Bit	Word	DIL	vvoiu			к, п	Ф			
n1	_	0	_	0	_	_	_	0	0	_	_		
n2		0	_	0	_	_		0	0	_	_		

(a) Setting data

Setting data	Setting item	Setting range	Data type		
n1	Axis 1 positioning data No.	1 to 10	BIN 16-bit		
n2	Axis 2 positioning data No.	1 10 10	BIN 10-DIL		

(b) Function

- This instruction start positioning using the "Positioning data" number for Axis 1 specified by "n1", and positioning using the "Positioning data" number for Axis 2 specified by "n2", simultaneously.
- Ex. Timing chart when positioning data No.1 for Axis 1 and positioning data No.10 for Axis 2 are started simultaneously

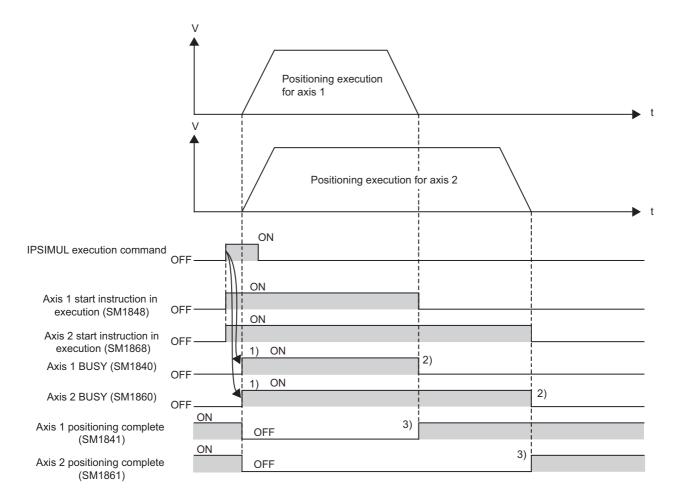

- When positioning control starts successfully, both of the Axis □ busy (SM1840, SM1860) turn on. (1))
- The Axis □ busy (SM1840 or SM1860) turns off and Axis □ positioning completion (SM1841 or SM1861) turns on, starting from the axis whose positioning has completed. (2)) (3))
- The Axis ☐ positioning completion (SM1841 or SM1861) will turn off the next time the applicable axis is started.
- If the Axis stop instruction (IPSTOP□) is executed for each axis or an error is detected during positioning, the axis decelerates to a stop and the Axis □ positioning completion (SM1841 or SM1861) does not turn on.

The number of steps is basically three.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• A value other than 1 to 10 is specified in "n1" or "n2":

(Error code: 4100)

• Inapplicable device is specified in "n1" or "n2":


(Error code: 4101)

• The positioning function for the target axis is not set to "Use":


(Error code: 4116)

(d) Program example

Program that simultaneously starts positioning data No.1 for Axis 1 and positioning data No.10 for Axis 2 when M0 turns on



(4) Original position return start instructions: IPOPR1(P), IPOPR2(P)

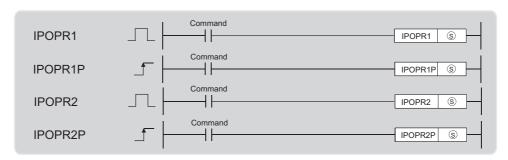

	Interr	nal device	R.	ZR	JE				Consta	ant		
Setting data	Bit	Mond.	14,	, \			U□\G□	UU\GU ZU	UD/GD ZD	K II		Others
	DIL	Word	Bit	Word	DIL	Word	K, H !			Þ		
<u>\$</u>	_	0	_	0	_	_	_	_	_	_	_	

(a) Setting data

Setting data	Setting item	Setting range	Data type
<u> </u>	Device start number of the device storing	Within the range of a specified	Device name
	control data	device	


(b) Control data

Device	Item	Setting data	Setting range	Set by
(\$)	Original position return type	1: Machine OPR 2: Fast OPR (OP address) 3: Fast OPR (standby address)	1 to 3	
S)+1			-2147483648 to	
\$+2	Standby address (Set the standby address only when the original position return type has been set to 3 (fast OPR (standby address).)	_	2147483647 (pulse) (The data is valid only when the original position return type is set to 3 (standby address).)	User

(c) Function


• These instructions start OPR of the type specified by (S).

Ex. Near-point dog method

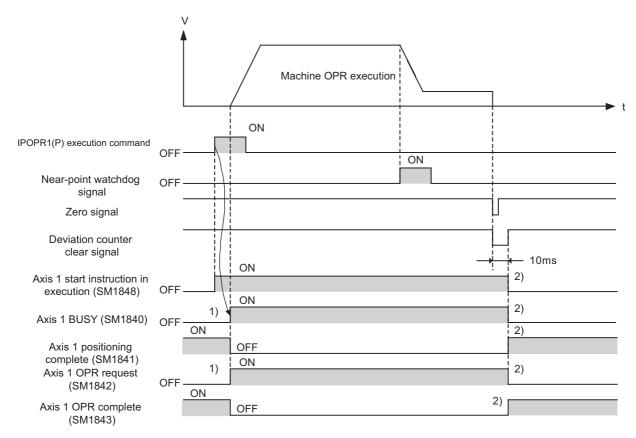

- When machine OPR starts successfully, the Axis 1 busy (SM1840) and Axis 1 OPR request (SM1842) turn on. (1))
- When machine OPR is complete, the Axis 1 busy (SM1840) turns off and Axis 1 positioning completion (SM1841) turns on. Also, the Axis 1 OPR request (SM1842) turns off and Axis 1 OPR completion (SM1843) turns on. (2)) The Axis 1 OPR completion (SM1843) will turn off the next time the applicable axis is started.
- If operation cannot be started because (§) is outside the setting range, the Axis 1 error (SM1845) turns on.
- If the Axis stop instruction (IPSTOP1) is executed or an error is detected during machine OPR, the axis decelerates to a stop and the Axis 1 OPR completion (SM1843) does not turn on.

The following operations take place in the case of fast OPR

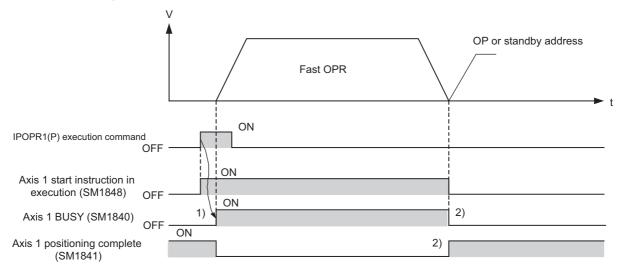

- When fast OPR starts successfully, the Axis 1 busy (SM1840) turns on. (1))
- When fast OPR is complete, the Axis 1 busy (SM1840) turns off and Axis 1 positioning completion (SM1841) turns on. (2))
- The Axis 1 positioning completion (SM1841) will turn off the next time the applicable axis is started.
- If operation cannot be started because (s) is outside the setting range, the Axis 1 error (SM1845) turns on.
- If the Axis stop instruction (IPSTOP1) is executed or an error is detected during fast OPR, the axis decelerates to a stop and the Axis 1 positioning completion (SM1841) does not turn on.

The number of steps is basically two.

(d) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Inapplicable device is specified in §:

(Error code: 4101)

• The OPR Method for the target axis is set to "No method":

(Error code: 4116)


The positioning function for the target axis is not set to "Use":

(Error code: 4116)


(e) Program example

Program that starts machine OPR of Axis 1 when M0 turns on

Device used	Item	Setting item
D0	Original position return type	Machine OPR
D1, D2	Standby address	0 (Ignored)



(5) JOG start instructions: IPJOG1, IPJOG2



	Intern	nal device	R	ZR	JE	ם/ם		Const	ant		
Setting data	Bit	Word	,		Bit	Word	UD/GD	Z□	K, H	9	Others
	Ď.	vvoia	Bit	Word	Dit	vvoid			13, 11	Þ	
§ 1	_	0	_	0	_	_	_	_	_	_	_
<u>\$2</u>	0	_	0	_	_	_	_	_	_	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type	
<u> </u>	Device start number of the device	Within the range of a specified	Device name	
9)	storing control data	device	Bevice Haine	
	Specification of JOG operation direction			
<u>\$2</u>	0: Forward RUN	0,1	Bit	
	1: Reverse RUN			


(b) Control data

Device	Setting data	Setting range	Set by	
<u>\$1</u>	JOG speed	0 to 200000 (mulos (a)*1		
<u>\$1</u> +1	JOG speed	0 to 200000 (pulse/s)*1	User	
<u>\$1</u> +2	JOG ACC time	0 to 22767 (mg)	USEI	
<u>\$1</u> +3	JOG DEC time	0 to 32767 (ms)		

^{*1} If the set value of JOG speed is outside 0 to 200000, the axis may operate at the speed limit.

(c) Function

• These instructions perform JOG operation in the direction specified by ② using the JOG speed, JOG ACC time and JOG DEC time stored in ③ onwards.

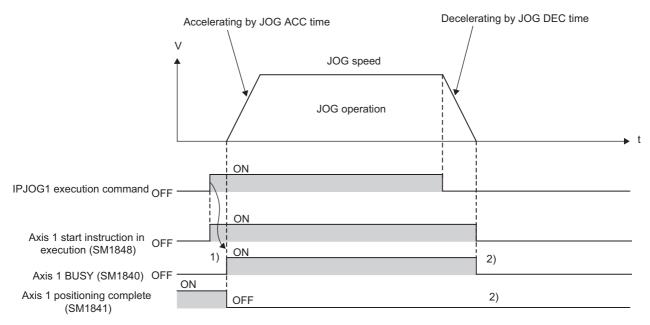

- When JOG operation starts successfully, the Axis 1 busy (SM1840) turns on. (1))
- When JOG operation ends, the Axis 1 busy (SM1840) turns off but the Axis 1 positioning completion (SM1841) does not turn on. (2))
- If operation cannot be started because §) is outside the setting range, the Axis 1 error (SM1845) turns on.

The number of steps is basically three.

(d) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Inapplicable device is specified in (\$1) or (\$2):

(Error code: 4101)


• The positioning function for the target axis is not set to "Use":

(Error code: 4116)


(e) Program example

Program that starts forward JOG when M0 turns on, and reverse JOG when M1 turns on.

Device used	Item	Setting item
D0, D1	JOG speed	10000 (pulse/s)
D2	JOG ACC time	1000 (ma)
D3	JOG DEC time	1000 (ms)

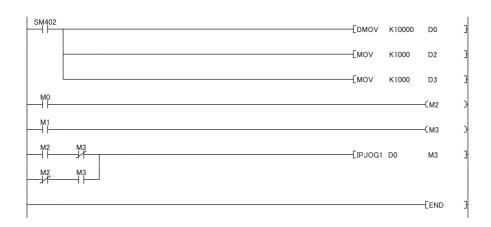

(6) Absolute position restoration instructions: IPABRST1, IPABRST2



	Intern	nal device	R	ZR	JE	3/0			Const	ant	
Setting data	Bit	Word	14,	\	Bit	Word	U□\G□	Z□	ип	\$	Others
	DIL	word	Bit	Word	DIL	word			K, H	Þ	
S	0	_	_	_	_	_	_	_	_	_	_
(D)	0	_	_	_	_	_	_	_	_	_	_

(a) Setting data


Setting data	Setting item	Setting range	Data type
<u>s</u>	Start input device number	Within the specified range of devices	Device name
(D)	Start output device number	Within the range of a specified device	Device name

(b) Control data

Device	Item	Setting data	Setting range	Set by
<u>s</u>		ABS transmission data bit 0		
<u>\$+1</u>	Signal loaded from the servo amplifier	ABS transmission data bit 1	0,1	User
S+2		ABS transmission data ready		
Device	Item	Setting data	Setting range	Set by
Device D		Setting data Servo on	Setting range	Set by
	Signal output to the servo amplifier		Setting range	Set by System

(c) Function

• These instructions perform absolute position restoration of the specified axis via communication with the servo amplifier using the input device and output device specified by (§) and (D), respectively.

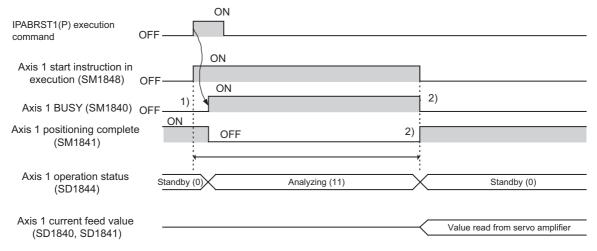

- When absolute position restoration starts successfully, the Axis 1 busy (SM1840) turns on. (1))
- The current position data retained by the servo amplifier is read. The read data is stored in the Axis 1 current feed value (SD1840, SD1841).
- When absolute position restoration is complete, the Axis 1 busy (SM1840) turns off and Axis 1 positioning completion (SM1841) turns on.
- The Axis 1 positioning completion (SM1841) will turn off the next time the applicable axis is started. (2))
- The Axis stop instruction (IPSTOP1) is ignored during absolute position restoration.
- If an error occurs during absolute position restoration, the Axis 1 positioning completion (SM1841) does not turn on.

The number of steps is basically three.

(d) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

(Error code: 4101)

• The positioning function for the target axis is not set to "Use":

(Error code: 4116)


(e) Program example

Program that performs absolute position restoration of Axis 1 when M0 turns on

- · X20 to X22: Signal loaded from the servo amplifier
- · Y30 to Y32: Signal output to the servo amplifier




(7) Axis stop instructions: IPSTOP1, IPSTOP2



	Interr	nal device	R, ZR		J 🗆 / 🗆				Consta	ant	
Setting data	Bit	Word	1.1,		Bit	Word	UD/GD	Z	К, Н	\$	Others
	Dit	Word	Bit	Word	Dit	Word			Ιζ, 11 ψ	Ψ	
_	_	_	_	_	_	_	_	_	_	_	_

(a) Function

- · These instructions stop the operation of the specified axis.
- Ex. Timing chart when the positioning started by the Table start instruction (IPPSTRT1(P)) is stopped

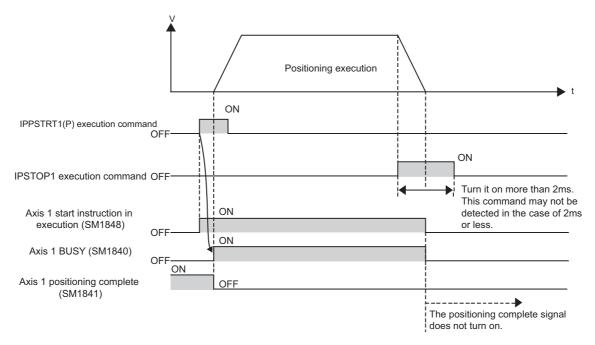

 No processing is performed if IPSTOP1 is executed while the Axis 1 axis operation status (SD1844) is indicating one of the following values:

Standing by (0)

Stopped (1)

Error occurring (-1)

Decelerating (axis stop ON) (7)

Decelerating (JOG start OFF) (8)

Analyzing (11)

- If an attempt is made to start positioning while IPSTOP1 is still being executed, a "Stop instruction ON at start" error (Axis 1 error code: 1102) occurs and positioning does not start.
- When the deceleration stop is complete due to the IPSTOP1, the Axis 1 positioning completion (SM1841) does not turn on.

The number of steps is basically one.

(b) Operation error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• The positioning function for the target axis is not set to "Use":


(Error code: 4116)

(c) Program example

Program that stops Axis 1 when M0 turns on



(8) Speed change instructions: IPSPCHG1(P), IPSPCHG2(P)

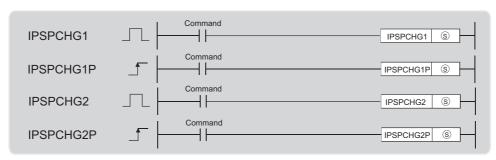

	Interr	nal device	R 7R		R, ZR J□\□				Constant		
Setting data	Bit	Word	,		Bit	Word	UD\GD	Z□	К, Н	4	Others
	Dit	vvoiu	Bit	Word	Dit	Bit Word			К, П Ф	Ψ	
<u>(S)</u>		0	_	0	_	_	_	_	_	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
	Device start number of the device	Within the range of a specified	Device name
(<u>s</u>)	storing control data	device	Device name


(b) Control data

Device	Setting data	Setting range	Set by
<u>s</u>	ACC/DEC time at speed change	0 to 32767 (ms)	
<u>\$</u> +1	DEC/STOP time at speed change	0 10 32707 (1118)	- User
<u>\$</u> +2	New speed value	0 to 200000 (mules (s)*1	
<u>\$</u> +3	New speed value	0 to 200000 (pulse/s)*1	

^{*1} If the set new speed value is outside 0 to 200000, the axis may operate at the speed limit.

(c) Function

- These instructions change the speed using the ACC/DEC at speed change, DEC/STOP time at speed change, and new speed value stored in (§) onward.
- Ex. Timing chart when the speed is changed during positioning which was started by the Table start instruction (IPPSTRT1(P))

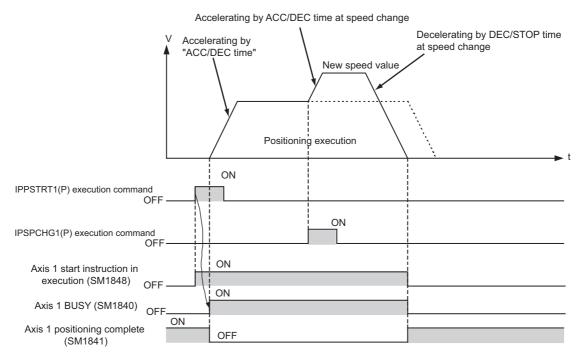

• If IPSPCHG1(P) is executed while the Axis 1 axis operation status (SD1844) is indicating one of the following values, the instruction is ignored:

Standing by (0)

Stopped (1)

Error occurring (-1)

Decelerating (axis stop ON) (7)

Decelerating (JOG start OFF) (8)

Analyzing (11)

The number of steps is basically two.

(d) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Inapplicable device is specified in S:

(Error code: 4101)

The positioning function for the target axis is not set to "Use":

(Error code: 4116)


(e) Program example

Program that changes the Axis 1 speed when M0 turns on

Device used	Item	Setting item
D0	ACC/DEC time at speed change	2000 (ms)
D1	DEC/STOP time at speed change	1000 (ms)
D2, D3	New speed value	20000 (pulse/s)



(9) Target position change instructions: IPTPCHG1(P), IPTPCHG2(P)

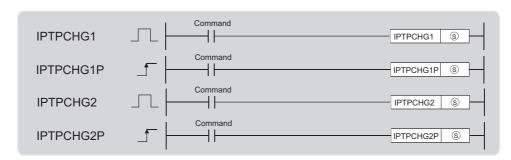

	Intern	nal device	R, ZR		J=\-				Consta	ant	
Setting data	Bit	Word	1.,	\	D:4	Mond	U□\G□	Z□	иц		Others
	DIL	word	Bit	Word	DIL	Bit Word			K, H \$	Þ	
<u>(S)</u>	_	0	_	0		_	_	0	0	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
(S)	Target position change value (constant) Device start number of the device storing control data	Constant: -2147483648 to 2147483647 Device: within the range of a specified device	Constant: BIN 32-bit Device: device name


(b) Control data

Device	Setting data	Setting range	Set by
(8)	Target position change value	-2147483648 to 2147483647	User
<u>\$</u> +1	raiget position change value	(pulse)	0361

(c) Function

• These instructions change the target position to the new value specified by §.

Ex. Timing chart when the address is changed during positioning which was started by the Table start instruction (IPPSTRT1(P))

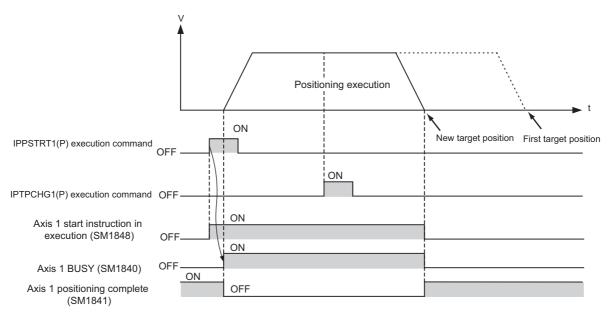

 No processing is performed if the IPTPCHG1(P) is executed while the Axis 1 axis operation status (SD1844) is indicating one of the following values:

Standing by (0)

Stopped (1)

Error occurring (-1)

Decelerating (axis stop ON) (7)

Decelerating (JOG start OFF) (8)

Analyzing (11)

The number of steps is basically two.

(d) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Inapplicable device is specified in S:

(Error code: 4101)

• The positioning function for the target axis is not set to "Use":

(Error code: 4116)

(e) Program example

Program that changes the target position of Axis 1 to 2000 when M0 turns on



7.12.2 Precautions on dedicated instructions

(1) Multiple instruction executions

(a) Axis 1 start instruction (SM1848) and execution of instructions

When the Axis 1 start instruction (SM1848) is on, any attempt to perform positioning of the same axis by each of the following instructions is ignored. (If an instruction to start positioning is executed again after the Axis 1 start instruction (SM1848) has turned off, positioning starts even when the Axis 1 start during operation (SM1847) is on.)

- IPPSTRT1(P)
- IPDSTRT1(P)
- IPSIMUL(P)
- IPOPR1(P)
- IPJOG1
- IPABRST1

(b) Multiple executions during one scan

If each of the following instructions is used multiple times on the same axis during one scan, normal operation cannot be guaranteed.

- IPJOG1
- IPSTOP1

(2) Program executed only once and execution of instructions

If the following instructions are executed in a program which is executed only once, turning off of execution commands cannot be detected and thus normal operation is not possible. Use these instructions in a program where turning off of execution commands can be detected (such as a scan program).

- IPJOG1
- IPSTOP1

(3) Axis 1 axis operation status (SD1844) and execution of instructions

If the IPSTOP1, IPSPCHG1(P) or IPTPCHG1(P) is executed while the Axis 1 axis operation status (SD1844) is indicating one of the following values, the instruction is ignored:

- Standing by (0)
- · Stopped (1)
- Error occurring (-1)
- Decelerating (axis stop ON) (7)
- Decelerating (JOG start OFF) (8)
- Analyzing (11)

(4) Instructions not requiring execution command


The following instructions are always executed, which means that they are executed even when their execution command is off. Therefore, errors can occur even while an execution command is off.

- IPJOG1
- IPSTOP1

(5) Pulse instructions

The pulse instructions such as IPPSTRT1P and IPSIMULP are executed at the leading edge of their execution command. If these instructions are used in an interrupt program or subroutine, they are not executed until the second or later leading edge of their execution command is detected.

Ex. Executing the IPPSTRT1P in an interrupt program

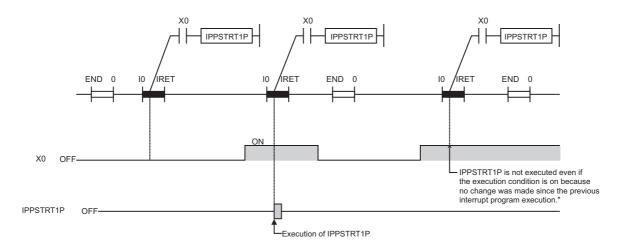

(6) Precautions on IPSTOP1

(a) IPSTOP1 and positioning control

If an attempt is made to start positioning control while the IPSTOP1 is still being executed, a "Stop instruction ON at start" error (Axis 1 error code: 1102) occurs and positioning does not start.

(b) IPSTOP1 and Axis 1 positioning completion (SM1841)

When the deceleration stop is complete due to the IPSTOP1, the Axis 1 positioning completion (SM1841) does not turn on.

(c) Execution command for the IPSTOP1

The execution command for the IPSTOP1 must remain on for at least 2 ms. If the execution command does not remain on for at least 2 ms, it may not be detected.

(7) Speed setting

If the speed set by the IPDSTRT1(P), IPJOG1, or IPSPCHG1(P) is outside 0 to 200000, the axis may operate at the speed limit.

7.13 Programming

This section describes the programs for the positioning function. When applying the program examples provided in this section to an actual system, properly verify the applicability and reliability of the control on the system.

(1) Programming procedure


For program examples, refer to Page 169, Section 7.13 (3).



(2) System configuration and programing condition

The following system configuration is used to introduce program examples.

(a) System configuration

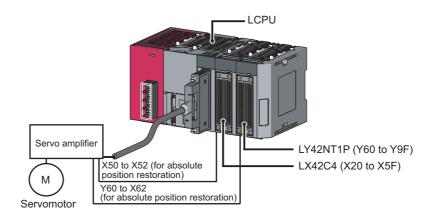

(b) Programming conditions

Device	Function	
X30	Stop command	
X31	Axis 1 machine original position return start selection	
X32	Axis 1 fast OPR (OP address) start selection	
X33	Axis 1 fast OPR (standby address) start selection	
X34	Axis 1 original position return start command	
X35	Axis 1 positioning start command (table start)	
X36	Current start command	
X37	Axis 1 position control (ABS) start selection	
X38	Axis 1 position control (INC) start selection	
X39	Axis 1 speed control (forward run) start selection	
ХЗА	Axis 1 speed control (reverse run) start selection	
ХЗВ	Axis 1 speed-position switching control (forward run) start selection	
X3C	Axis 1 speed-position switching control (reverse run) start selection	
X3D	Axis 1 current value change selection	LX42C4 (X20 to X5F)
X3E	Axis 1 positioning start instruction	LX42C4 (X20 to X3F)
X40	Axis 1 forward run JOG command	
X41	Axis 1 reverse run JOG command	
X42	Speed change command	
X43	Target position change command	
X44	Error reset command	
X45	OPR request off command	
X46	Absolute position restoration	
X47	Axis 1 speed/position switching command	
X48	Axis 1 speed/position switching prohibition command	
X50	Absolute position restoration ABS transmission data bit 0	
X51	Absolute position restoration ABS transmission data bit 1	
X52	Absolute position restoration Transmission data ready	
Y60	Absolute position restoration Servo on	
Y61	Absolute position restoration ABS transfer mode	LY42NT1P (Y60 to Y9F)
Y62	Absolute position restoration ABS request	
D0	Table start number	
D1	Concurrent start data No. (axis 1)	
D2	Concurrent start data No. (axis 2)	
D20	JOG speed	
D21		
D22	JOG ACC time	
D23	JOG DEC time	
D30	ACC/DEC time at speed change	
D31	DEC/STOP time at speed change	

Device	Function	1	
D32	New aread value		
D33	New speed value		
D40	Target position change value		
D41	Target position change value		
D100		Control system	
D101		Acceleration/deceleration time	
D102		Deceleration stop time	
D103	Position control (APS) start data	Dwell time	
D104	Position control (ABS) start data	Command annual	
D105		Command speed	
D106		Positioning address/movement amount	
D107		Positioning address/movement amount	
D110		Control system	
D111		Acceleration/deceleration time	
D112		Deceleration stop time	
D113	Position control (INC) start data	Dwell time	
D114	Position control (INC) start data	Command speed	
D115		Command speed	
D116		Positioning address/movement amour	
D117		1 Ostronning address/movement amount	
D120		Control system	
D121		Acceleration/deceleration time	
D122		Deceleration stop time	
D123	Speed/position switching control (forward) start data	Dwell time	
D124	Speed/position switching control (lorward) start data	Command speed	
D125		Command Speed	
D126		Positioning address/movement amount	
D127		1 Usuoming address/movement amount	
D130		Control system	
D131		Acceleration/deceleration time	
D132		Deceleration stop time	
D133	Speed/position switching control (reverse) start data	Dwell time	
D134	Special position switching control (reverse) staff data	Command speed	
D135		Command Speed	
D136		Positioning address/movement amount	
D137		1 contoning address/movement amount	
D140		Control system	
D141		Acceleration/deceleration time	
D142		Deceleration stop time	
D143	Current value change start data	Dwell time	
D144	Current value change start data	Command speed	
D145		Communa Specu	
D146		Positioning address/movement amount	
D147		Positioning address/movement amount	

Device	Funct	ion		
D150		Control system		
D151		Acceleration/deceleration time		
D152		Deceleration stop time		
D153	On and another Manuscript must be to determine	Dwell time		
D154	Speed control (forward run) start data	Ourse and an and		
D155		Command speed		
D156		Desitioning address/mayoment amount		
D157		Positioning address/movement amount		
D160		Control system		
D161		Acceleration/deceleration time		
D162		Deceleration stop time		
D163	Speed control (reverse run) start data	Dwell time		
D164	Speed Control (reverse run) start data	Command speed		
D165		Command speed		
D166		Positioning address/movement amount		
D167		Positioning address/movement amount		
D200		Original position return type		
D201	Machine OPR start data	Standby address (unused)		
D202		Standby address (undsed)		
D210		Original position return type		
D211	OP address of fast OPR start data	Standby address (unused)		
D212		Stalluby address (ullused)		
D220		Original position return type		
D221	Standby address of fast OPR start data	Standby address		
D222		Standby address		
M10	Axis 1 OPR start permission/prohibition storage			
M20	Forward run JOG command			
M21	Reverse run JOG command			
M22	JOG operation direction			
Z0	OPR parameter index			
Z1	Positioning data index			
SM1840	Axis 1 busy signal			
SM1842	Axis 1 OPR request			
SM1845	Axis 1 error			
SM1848	Axis 1 start instruction			
SM1850	Axis 1 error reset command			
SM1851	Axis 1 OPR request off			
SM1868	Axis 2 start instruction			

(3) Program example


Positioning programs for Axis 1 are shown below.

(a) Data setting program


· Position control



· Speed/position switching control

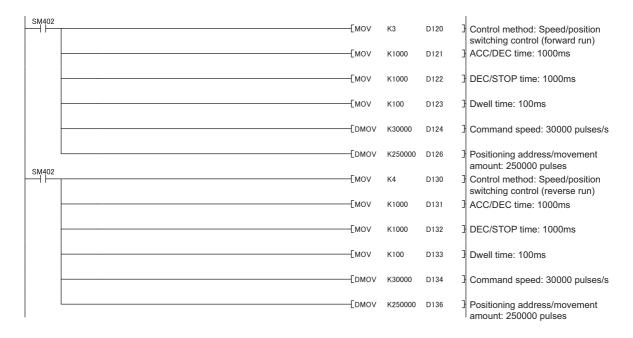

· Current value change

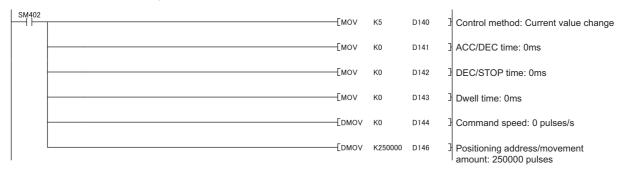


· Speed control




(b) OPR request off program

X45	SM1840	[SET	SM1851	Axis1 OPR request off: On
SM1851	SM1842	[RST	SM1851	Axis1 OPR request off: Off

(c) OPR data setting program

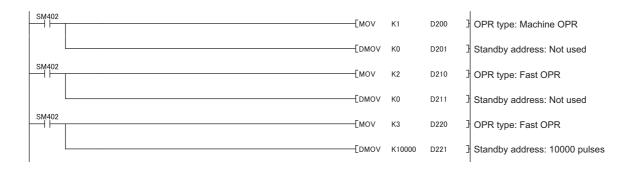

(d) OPR start program

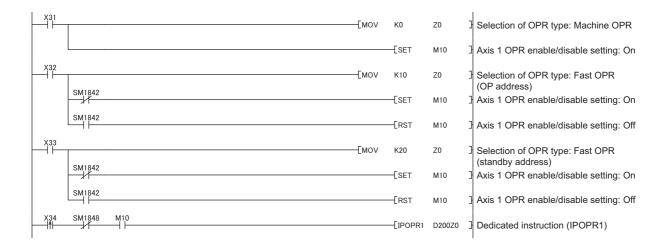


(e) Speed/position switching enable program




(f) Table start program



(g) Positioning start program

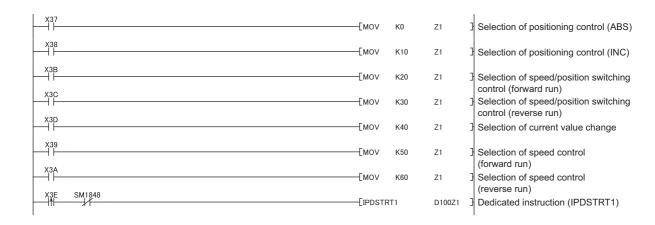

(h) JOG operation program

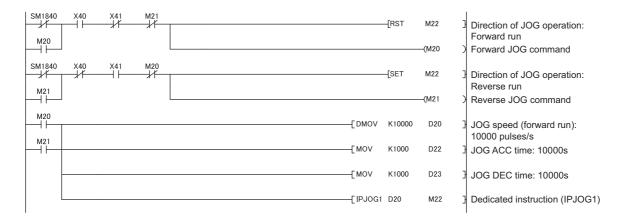

(i) Speed change program




(j) Target position change program



(k) Absolute position restoration program

```
X46 [IPABRST1 X50 Y60 ] Dedicated instruction (IPABRST1)
```

(I) Error, warning reset program



(m) Axis stop program

```
X30 SM1840 [IPSTOP1] Dedicated instruction (IPSTOP1)
```

7.14 Errors and Warnings

This section describes errors and warnings of the positioning function.

(1) Error

When an error occurs, the following operations are performed.

- The I/O ERR. LED turns on.
- The Axis 1 error (SM1845) turns on.
- · An error code corresponding to the error is stored to the Axis 1 error code (SD1845) in decimal.
- The Axis 1 axis operation status (SD1844) changes to error occurring (-1).

If an error occurs during operation, the axis decelerates to a stop. (This excludes situations that the range of software stroke limits is exceeded when the target position is changed. (Page 126, Section 7.10.6 (2) (b)))

Interface	Target axis	No.	Name	Description	
	Axis 1	SM1845		The occurrence condition of positioning function	
Special relay	Axis 2	SM1865	Axis □ error	errors is indicated. This relay turns off when the Axis □ error reset is turned on.	
	Axis 1	SM1850	Axis □ error reset	Reset the Axis □ error code.	
	Axis 2	SM1870	AXIS LI CITOI TESEL	Turn off the Axis □ error.	
	Axis 1	SD1845	When an error occurs, the corresponding error		
Special register	Axis 2	SD1865	Axis □ error code	is stored here. This register is reset when the Axis \square error reset is turned on.	
Special register	Axis 1	SD1844	Axis □ axis operation status	When an error occurs, error occurring (-1) is set.	
	Axis 2	SD1864		When the Axis □ error reset is turned on, the value changes to standing by (0).	

^{*1} Until the Axis 1 busy (SM1840) turns off, the Axis error (SM1845) does not turn off even when the Axis 1 error reset (SM1850) is turned on, and accordingly the Axis 1 error code (SD1845) is not reset. Also, the Axis 1 axis operation status (SD1844) does not change to standing by (0).

The following table lists the Axis $\hfill\square$ error codes.

Axis 🗆 error		lollowing table i	Description			
code (decimal)		Error name		Operation at error occurrence	Corrective action	
Axis 1	Axis 2					
1100	2100	Hardware stroke limit+	The hardware stroke limit (upper limit signal) turned off.	At start: Operation is not started.	At start: Operation starts from a position where the limit signal is on.	
1101	2101	Hardware stroke limit-	The hardware stroke limit (lower limit signal) turned off.	During operation: The axis decelerates to a stop.	During operation: Revise the OPR speed so that the limit will not be triggered. Use JOG operation to move to a position where the limit signal turns on.	
1102	2102	Stop instruction at start ON	A start request was issued when the Axis stop instruction (IPSTOP1) was being executed.	Operation is not started.	Stop the execution of the Axis stop instruction (IPSTOP1) and then start operation.	
1103	2103	Software stroke limit+	Positioning control was performed at a position exceeding the software stroke upper limit. The Axis 1 current feed value (SD1840, SD1841), "Positioning address/movement amount," new current value, or target position change value exceeds the software stroke upper limit.	At start: Operation is not started. At current value change analysis: The current value is not changed. During operation: • During JOG operation, the axis decelerates to a stop when the Axis 1 current feed value (SD1840, SD1841)	At start: Use JOG operation to bring the Axis 1 current feed value (SD1840, SD1841) to within the range of software stroke limits. Current value change: Bring the new current value to within the range of software stroke limits. Target position change value: Bring the target position change value to within the range of software stroke limits.	
1104	2104	Software stroke limit-	Positioning control was performed at a position below the software stroke lower limit. The Axis 1 current feed value (SD1840, SD1841), "Positioning address/movement amount," new current value, or target position change value is below the software stroke lower limit.	exceeds the range of software stroke limits. • During position control (including position control of speed/position switching control), the axis decelerates to a stop when the Axis 1 current feed value (SD1840, SD1841) or "Positioning address/movement amount" exceeds the range of software stroke limits.	During operation: In the case of JOG operation, perform JOG operation in the opposite direction to bring the Axis 1 current feed value (SD1840, SD1841) to within the range of software stroke limits. During position control, bring "Positioning address/movement amount" to within the range of software stroke limits. During speed/position switching control, switch between speed control and position control within the range of software stroke limits.	
1105	2105	During operation Sequence Execution stopped*2	The CPU module stopped during operation.	 During operation: The axis decelerates to a stop. During absolute position restoration: Absolute position restoration is not performed. 	Review the program to check for program errors.	
1106	2106	Drive unit ready off	The drive unit ready signal is off at start or turned off during operation.	 At start: Operation is not started. During operation: The axis decelerates to a stop. 	Check the power condition of the drive unit, wiring with the drive unit, and connection condition of connectors.	

Axis □ error code					
(decimal)		Error name	Description	Operation at error occurrence	Corrective action
Axis 1	Axis 2				
1200	2200	Zero signal ON	The OPR method is Stopper 2 or 3 and a zero signal is input at the start of machine OPR control.	Machine OPR control is not performed.	Turn off the zero signal and then perform machine OPR control.
1201	2201	Machine OPR not performed	Fast OPR control was performed when machine OPR control was not performed.	Fast OPR control is not performed.	Perform machine OPR control before fast OPR control.
1202	2202	Retry error	The near-point dog signal is on and limit signal is off.	 At start of OPR control by near-point dog method: OPR retry operation is not performed. During OPR retry operation: The axis decelerates to a stop. 	Correct the limit signal position so that it does not overlap with the area in which the near-point dog signal turns on.
1204	2204	ABS transfer time-out	Communication could not be performed normally with the servo amplifier following the Absolute position restoration instruction (IPABRST1).	Absolute position restoration is not performed.	Review the wirings. Review the setting data of the Absolute position restoration instruction (IPABRST1).
1205	2205	ABS transfer SUM	Communication could not be performed normally with the servo amplifier following the Absolute position restoration instruction (IPABRST1).	Absolute position restoration is not performed.	Review the wirings. Review the setting data of the Absolute position restoration instruction (IPABRST1).
1500	2500	Speed 0 error	The command speed is "0" at the start of position control.	Operation is not started.	Set the command speed to other than "0."
1501	2501	Control method out of range	The set value of control method is outside the setting range.	Operation is not started.	Set the control method to a value within the setting range.
1502	2502	Acceleration/de celeration time Out of setting range	The set value of JOG ACC time, acceleration/deceleration time, or ACC/DEC time at speed change is outside the setting range.	At start: Operation is not started. During operation: During speed control (including speed control of speed/position switching control) or JOG operation, the axis decelerates to a stop. During position control (including position control of speed/position switching control), operation continues.	Set the JOG ACC time, acceleration/deceleration time, or ACC/DEC time at speed change to a value within the setting range.

Axis □ error code (decimal)		Error name	Description	Operation at error occurrence	Corrective action
Axis 1	Axis 2				
1503	2503	Deceleration stop time out of range	The set value of JOG DEC time, deceleration stop time, or DEC/STOP time at speed change is outside the setting range.	At start: Operation is not started. During operation: During speed control (including speed control of speed/position switching control) or JOG operation, the axis decelerates to a stop. During position control (including position control of speed/position switching control), operation continues.	Set the JOG DEC time, deceleration stop time, or DEC/STOP time at speed change to a value within the setting range.
1504	2504	Movement amount setting out of range under speed/position switching control	A negative value is set in "Positioning address/movement amount" when speed/position switching control is selected as the control method.	At start: Operation is not started. During operation: When the target position is changed during position control of speed/position switching control, operation continues.	Correct the value of "Positioning address/movement amount" or target position change value.
1505	2505	Speed/position switching control start not possible	No external command signal is selected when speed/position switching control is selected as the control method.	Operation is not started.	Select an external command signal.
1506	2506	Original position return type setting out of range	The set value of original position return type is outside the setting range.	OPR control is not performed.	Set the original position return type to a value within the setting range.

^{*2} This error is not displayed when the LCPU is paused.



If a different error occurs while an error is already present, the error code is not rewritten to reflect the latest error.

(2) Warning

When a warning occurs, the following operations are performed.

- The Axis 1 warning (SM1846) turns on.
- A warning code corresponding to the warning is stored to the Axis 1 warning code (SD1846) in decimal. Different from errors, occurrence of a warning does not stop the operation of the axis. The SD value is always updated with the latest warning code.

Interface	Target axis	No.	Name	Description
	Axis 1	SM1846	Axis □ warning	The occurrence condition of positioning function
Special relay	Axis 2	SM1866		warnings is indicated. This relay turns off when the Axis □ error reset is turned on.
	Axis 1	SM1850	Axis □ error reset	Reset the Axis □ warning code.
	Axis 2	SM1870		Turn off the Axis □ warning.
	Axis 1	SD1846	Axis □ warning code	When a warning occurs, the corresponding
Special register	Axis 2	SD1866		warning code is stored here. This register is reset when the Axis □ error reset is turned on.



When a warning occurs, the Axis 1 axis operation status (SD1844) does not change.

The following table lists the Axis \square warning codes.


Axis □ warning code (decimal)		Name	Description	Operation at warning occurrence	Corrective action
1020	2020	Out of speed range	The set speed or new speed value is less than the bias speed at start or exceeds the speed limit.	The speed is controlled at the bias speed at start or speed limit.	Change the set speed or new speed value so that it becomes equal to or greater than the bias speed at start or equal to or smaller than the speed limit.
1021	2021	Target position change not possible	The Target position change instruction (IPTPCHG1(P)) was executed other than when position control was active. The Target position change instruction (IPTPCHG1(P)) was executed when the Axis 1 speed 0 (SM1844) was on.	Operation continues.	 Do not execute the Target position change instruction (IPTPCHG1(P)) other than when position control is active. Do not execute the Target position change instruction (IPTPCHG1(P)) when the Axis 1 speed 0 (SM1844) is on.
1022	2022	Speed change Not allowed	The Speed change instruction (IPSPCHG1(P)) was executed when OPR control was active. The Speed change instruction (IPSPCHG1(P)) was executed during acceleration/deceleration when position control (including position control of speed/position switching control) was active.	Operation continues.	Do not execute the Speed change instruction (IPSPCHG1(P)) when OPR control is active. Do not execute the Speed change instruction (IPSPCHG1(P)) during acceleration/deceleration when position control (including position control of speed/position switching control) is active.

7.15 Monitoring with a Programming Tool

When the positioning function is executed, the operating status can be checked on the "Positioning Monitor" window of the programming tool.

[Tool]

□ [Built-in I/O Module Tool]

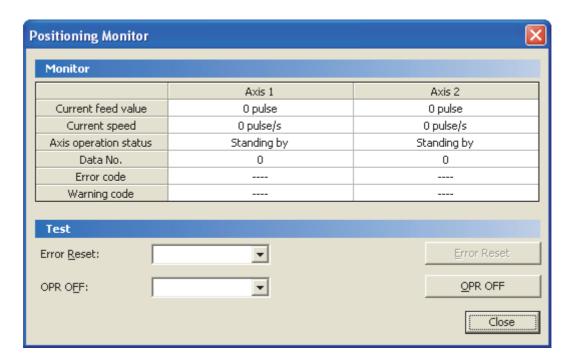

For details, refer to the following. GX Works2 Version 1 Operating Manual (Common)

CHAPTER 8 HIGH-SPEED COUNTER FUNCTION


8.1 Overview

(1) Definition

This function counts the number of high-speed input pulses that cannot be measured by general counter.

(2) Features

The high-speed counter function is controlled by parameters and dedicated instructions.

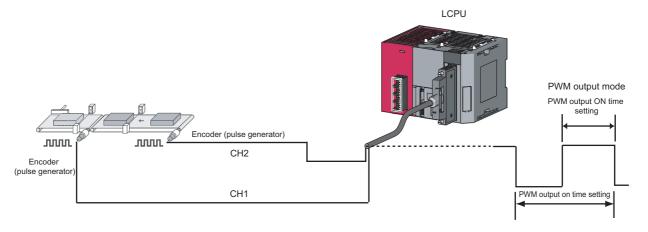

(a) Pulse inputs from two channels

Pulses can be simultaneously input from two pulse generators.

(b) Five operation modes

According to the application, an operation mode can be selected from the following five modes:

- · Normal mode: used for operating the CPU module as a general high-speed counter.
- · Frequency measurement mode: used for measuring frequencies from the number of input pulses.
- Rotation speed measurement mode: used for measuring a rotation speed from the number of input pulses.
- Pulse measurement mode: used for measuring the on width or off width of input pulses. This mode is suitable for measuring the length of an object and others.
- PWM (pulse width modulation) output mode: used for outputting pulses with the on width and cycle time set. This mode is suitable to use the CPU module as an oscillator and others.

(c) Combined use of functions

Functions for preset, count stop, and counter value latch can be used in combination (counter function selection).

(d) Execution of an interrupt program

An interrupt program can be executed when the current value and a set value match in the counter (coincidence detection interrupt function).

(e) Signal output

A coincidence signal can be output when the current value and a set value match in the counter. (coincidence output function).

(3) Function list


The following table lists and describes available functions of the high-speed counter function.

ltem		Description	Operation mode where the function can be used	Reference
Linear counter function		Counts pulses within the range of -2147483648 to 2147483647, and detects an overflow or an underflow if the count range is exceeded.		Page 199, Section 8.4 (1)
Ring	counter function	Repeatedly counts pulses within the range of the upper limit value to the lower limit value of ring counter.		Page 199, Section 8.4 (1)
Р	reset function	Overwrites CH1 Current value (SD1880, SD1881) with a set value in the counter.		Page 203, Section 8.4.1 (2)
	_	Compares a set value with CH1 Current value (SD1880, SD1881) in the counter and outputs on or off signal.		Page 205, Section 8.4.2
Coincidence output function	Preset function at coincidence output	Overwrites CH1 Current value (SD1880, SD1881) with a set value in the counter on the rising edge of Counter value coincidence (No.n) signal.		Page 207, Section 8.4.2 (1)
	Coincidence detection interrupt function	Initiates an interrupt program when CH1 Current value (SD1880, SD1881) and a set value match.	Normal mode	Page 208, Section 8.4.3
Latch counter function		Latches CH1 Current value (SD1880, SD1881) of the counter on the rising edge of Latch counter input signal.		Page 213, Section
	Latch counter function	Latches CH1 Current value (SD1880, SD1881) of the counter on the rising edge of CH1 Selected counter function start command (SM1896) or Function input signal.		8.4.4 (2) (a)
Counter	Count disable function	Stops counting while CH1 Count enable command (SM1895) is on.		Page 213, Section 8.4.4 (2) (a)
function selection	Sampling counter function	Counts pulses that are input during a specified sampling period.		Page 215, Section 8.4.4 (2) (c)
	Count disable/preset function	Performs the count disable function and the preset function without switching the function.		Page 217, Section 8.4.4 (2) (d)
	Latch counter/preset function	Performs the latch counter function and the preset function without switching the function.		Page 219, Section 8.4.4 (2) (e)
Inter	nal clock function	Counts clock frequencies generated by the LCPU.		Page 194, Section 8.3.1 (2) (a)
Frequency measurement function		Counts pulses input from the pulse input signals of phases A and B and automatically calculates frequencies.	Frequency measurement mode	Page 224, Section 8.5 (5)
Rotation speed measurement function		Counts pulses input from the pulse input signals of phases A and B and automatically calculates frequencies.	Rotation speed measurement mode	Page 230, Section 8.6 (5)
Pulse measurement function		Measures the on or off width of pulses that are input to Function input signal.	Pulse measurement mode	Page 234, Section 8.7 (2)
PWN	M output function	Outputs PWM waveforms from Coincidence output No.1 signal at the maximum of 200kHz.	PWM output mode	Page 237, Section 8.8 (2)

8.1.1 Procedure for performing the high-speed counter function

The following flowchart shows the procedure.

End

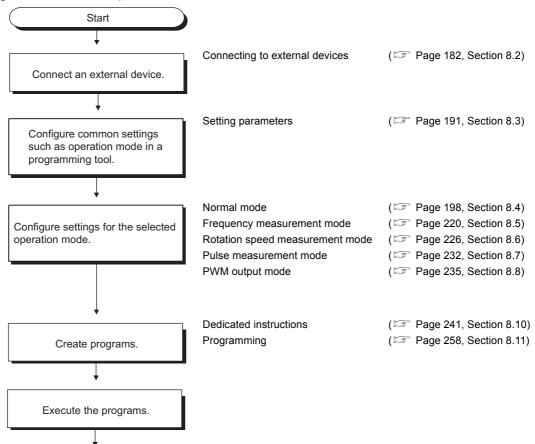

8.2 Connecting to External Devices

8.2.1 I/O signals

The following shows the internal circuits on interfaces for connecting LCPU external devices using schematic drawings. \Box in a signal name indicates either 1 (CH1) or 2 (CH2). For I/O signal settings, refer to \Box Page 191, Section 8.3.

(1) Input

Pin number				
CH1	CH2	Internal circuit	Signal name	
B20	A20	3.6kΩ		+24V (PULSE A□ -24V)
B19	A19	1/2W 220Ω 4 ¥ ₹	Phase A (PULSE A□)	Differential (PULSE A□-DIFF)
B18	A18	1/10W		COM (PULSE A□-COM)
B17	A17	3.6kΩ		+24V (PULSE B□ -24V)
B16	A16	1/2W 220Ω	¥ ‡	Differential (PULSE B□ -DIFF)
B15	A15	1/10W		COM (PULSE B□-COM)
B14	A14	3.6kΩ		+24V (PULSE Z□-24V)
B13	A13	1/2W 680Ω 220Ω Δ ¥ ±	Phase Z (PULSE Z□)	Differential (PULSE Z□-DIFF)
B12	A12	1/10W		COM (PULSE Z□-COM)
B11	A11		Ir	nput common
B10	A10	$ \begin{array}{c ccccccccccccccccccccccccccccccccccc$	Function i	nput signal (FUNC□)
B09	A09		Latch counte	r input signal (LATCH□)
B08	A08			
B07	A07	1/10W ΔΨ ¥ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ Δ	- (Not used for the high-speed counter function)	
B06	A06	1/10W 4¥ ₹ √ 5.6kΩ 1/3W		

(2) Output

(a) L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT

Pin nu	mber		O'contact and the second	
CH1	CH2	Internal circuit	Signal name	
B05	A05	Insulating	Coincidence output No.1 signal (EQU□1)	
B04	A04	Insulating	Coincidence output No.2 signal (EQU□2)	
B03	A03	Insulating element	-	
B02	A02	Insulating	(Not used for the high-speed counter function)	
B01	A01	element	Output common	

(b) L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT

Pin number			C'and and
CH1	CH2	Internal circuit	Signal name
B05	A05	Insulating element	Coincidence output No.1 signal (EQU□1)
B04	A04	Insulating element	Coincidence output No.2 signal (EQU□2)
B03	A03	Insulating element	-
B02	A02	Insulating element	(Not used for the high-speed counter function)
B01	A01		Output common

(3) Details of I/O signals

The following table lists and describes the I/O signals of the connector for LCPU external devices.


Category	Signal name	Description
	Phase A (PULSE A□)	Pulse input signal. Pulses input to these signals are counted according to the operation
	Phase B (PULSE B□)	mode set for the phases A and B.
	Phase Z (PULSE Z□)	External signals to perform the preset function are input.
Input	Function input signal (In normal mode, set positive or negative logic.)	 In normal mode: While the count disable function is selected, external signals to suspend count are input. While the latch counter function is selected, external signals to perform the latch function are input. While the count disable/preset function is selected, external signals to stop count or perform the preset function are input. While the latch counter/preset/replace function is selected, external signals to perform the latch function or the preset function are input. While the sampling counter function is selected, external signals to start counting during sampling period are input. In pulse measurement mode: The on or off width of pulses that are input to Function input signal can be measured.
	Latch counter input signal (LATCH□)	This signal is used for latching a current counter value.
	Input common	Common for Function input signal and Latch counter input signal
	Coincidence output No.1 signal (EQU□1)	In normal mode: • Signals are output when a count value set by Coincidence output point write instruction
Output	Coincidence output No.2 signal (EQU□2)	(ICCOVWR1(P)) matches CH1 Current value (SD1880, SD1881). In PWM output mode: • PWM waveforms are output. (for Coincidence output No.1 signal only)
	Output common	Common for Coincidence output No.1 signal and Coincidence output No.2 signal

8.2.2 Wiring


This section describes wiring to an encoder and a controller. For connectors used for external wiring, refer to the AMELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection).

(1) Wiring precautions

- Inputting a signal with a different voltage may cause malfunction of the module and failure of the connected devices.
- In 1-phase input, connect a pulse input cable to A-phase line.
- · When inputting high-speed pulses, take the following noise reduction measures.
 - Always use a shielded twisted pair cable and ground the FG and LG terminals to the protective ground conductor dedicated to the programmable controller.
 - To prevent noise from power cables and I/O cables, do not install shielded twisted pair cables in parallel
 with them and separate the shielded twisted pair cables at least 100mm away from them. Also, wire the
 shielded twisted pair cables with the shortest distance. The following figures show an example of noise
 reduction measures.

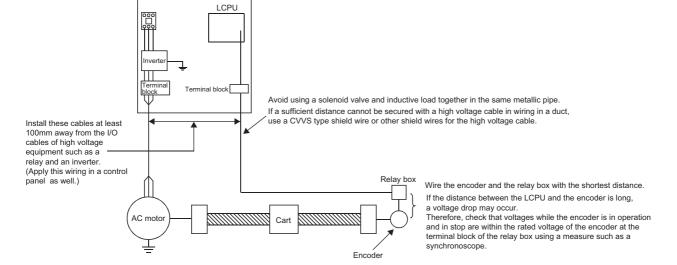

• Ground the shielded twisted pair cable on the encoder side (relay box). (This example shows wiring using 24V sink type.)



(2) Connectable encoders


Check that the output voltages of the following encoders meet the specifications of the high-speed counter function (Page 238, Section 8.9).

- · Open collector output type encoder
- · Line driver output type encoder

(3) Example of wiring to an encoder

Characters in the parentheses of the terminal part indicate the pin number of CH2.


(a) Example of wiring to an open collector output type encoder (24VDC)

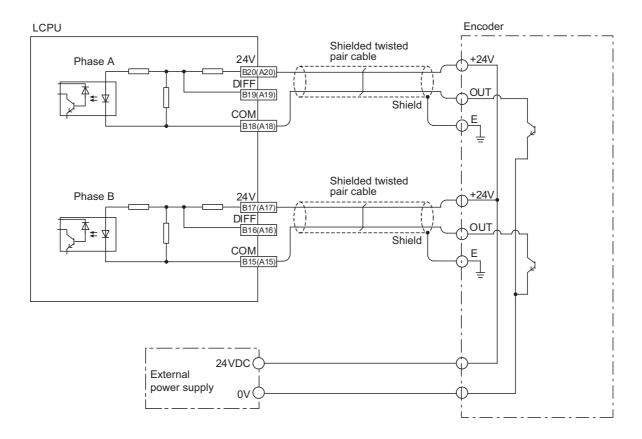


Point P

When wiring an LCPU and an encoder, separate power cables and signal cables. The following figures show examples.


Wiring example

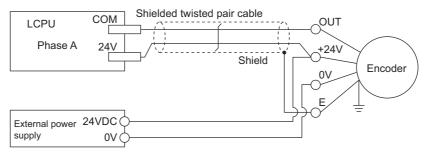

Improper wiring example

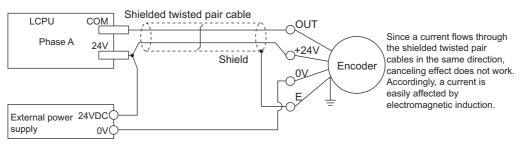


(b) Example of wiring to a line driver (equivalent to AM26LS31) encoder

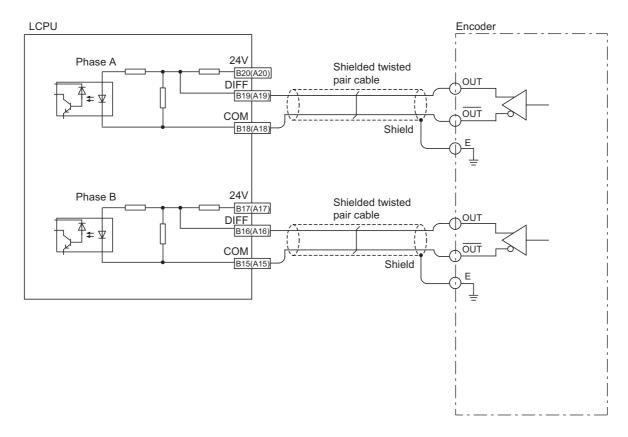


(4) Example of wiring between a controller and external input signals

Characters in the parentheses of the terminal part indicate the pin number of CH2.

(a) Example of wiring to a controller (sink type)

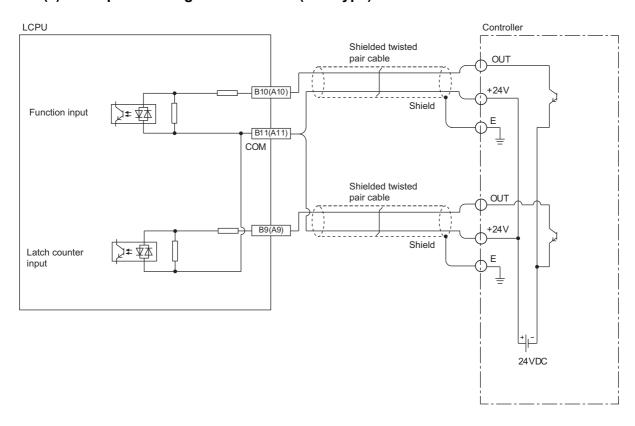


(b) Example of wiring when the controller is a line driver

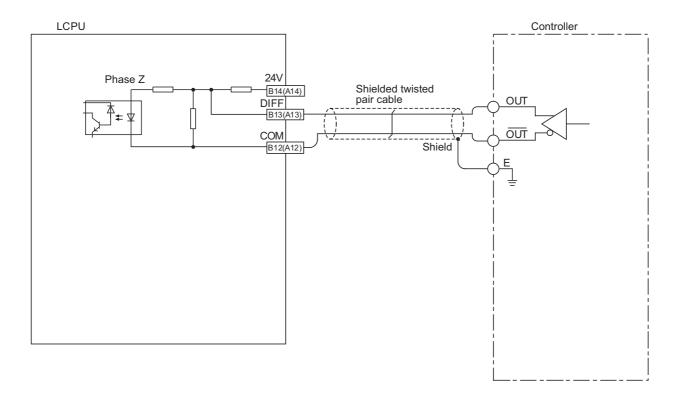

(5) Example of wiring to an external output device

(a) L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT

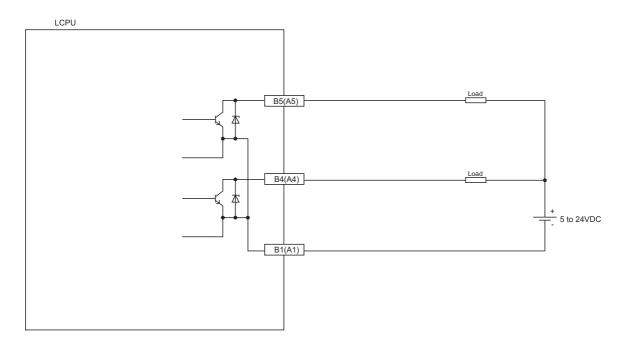


Point P

When connecting an inductive load, connect a diode to the load in parallel to prevent the back EMF from being generated for output element protection.



(b) L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT

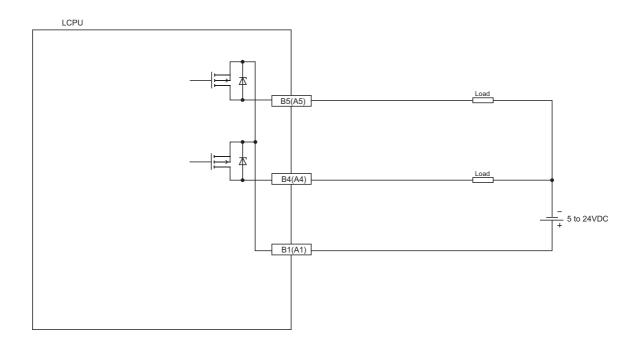




When connecting an inductive load, connect a diode to the load in parallel to prevent the back EMF from being generated for output element protection.



8.3 Parameter Settings

Set parameters for each channel.

- 1. Click the High-speed Counter CH1 Setting button in the "Built-in I/O Function Setting" tab.
 - Project window ⇒ [Parameter] ⇒ [PLC Parameter] ⇒ "Built-in I/O Function Setting" tab
- 2. Select the "Use high-speed counter function (CH1)" checkbox on the top left on the "High-speed Counter CH1 Detailed Setting" window.
- 3. Configure required settings.
- 4. Click the _____ button to exit.

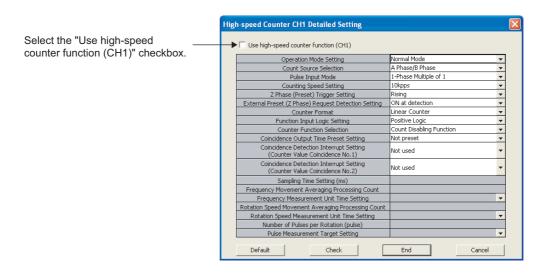


ltem	Description	Default	Operation mode where the setting can be used	Reference
Operation Mode Setting	Select an operation mode.	Normal mode		
Count Source Selection	Select a count source.	A Phase/B Phase	_	Page 193,
Pulse Input Mode	Select a pulse input mode.	1-Phase Multiple of 1	(common settings)	Section 8.3.1
Counting Speed Setting	Select the counting speed of pulses.	10kpulse/s		
Z Phase (Preset) Trigger Setting	Select a trigger condition to perform the preset function by phase Z input.	Rising		Page 202, Section 8.4.1 (1)
External Preset (Z Phase) Request Detection Setting	Select whether to turn on CH1 External preset (phase Z) request detection (SM1886) when the preset function is performed by phase Z input.	ON at detection		Page 202, Section 8.4.1 (1)
Counter Format	Select a counter type.	Linear Counter	Normal mode	Page 199, Section 8.4 (1)
Function Input Logic Setting	Select logic for Function input signal.	Positive Logic		Page 211, Section 8.4.4 (1) (a)
Counter Function Selection	Select a counter function.	Count Disabling Function		Page 211, Section 8.4.4

ltem	Description	Default	Operation mode where the setting can be used	Reference
Coincidence Output Time Preset Setting	Select whether to perform the preset function on the rising edge of CH1 Counter value coincidence (No.1) (SM1881).	Not preset		Page 207, Section 8.4.2 (1)
Coincidence Detection Interrupt Setting (Counter Value Coincidence No.1)	Select whether to perform coincidence detection interrupt using CH1 Counter value coincidence (No.1) (SM1881).	Not Used	Normal mode	Page 208,
Coincidence Detection Interrupt Setting (Counter Value Coincidence No.2)	Select whether to perform coincidence detection interrupt using CH1 Counter value coincidence (No.2) (SM1884).	- Not Used		Section 8.4.3 (1)
Sampling Time Setting (ms)	Set sampling period for the sampling counter function.	_		Page 211, Section 8.4.4 (1) (b)
Frequency Movement Averaging Processing Count	Set a moving average processing count when frequencies are measured.	_	Frequency measurement	Page 220,
Frequency Measurement Unit Time Setting	Select a pulse measurement period to calculate frequencies.	_	mode	Section 8.5
Rotation Speed Movement Averaging Processing Count	Set a moving average processing count when a rotation speed is measured.	_	Rotation speed	Dogo 226
Rotation Speed Measurement Unit Time Setting	Select a pulse measurement period to calculate a rotation speed.	_	measurement mode	Page 226, Section 8.6
Number of Pulses per Rotation (pulse)	Set the number of pulses per rotation when a rotation speed is measured.	_		
Pulse Measurement Target Setting	Select a period (on width or off width) during which pulses are measured.	_	Pulse measurement mode	Page 232, Section 8.7

After the settings are configured, used external signals are automatically assigned. Set "Input Response Time" for input signals other than phases A and B, and set "Error Time Output Mode" for output signals for each channel.

According to the settings, external signals are assigned.

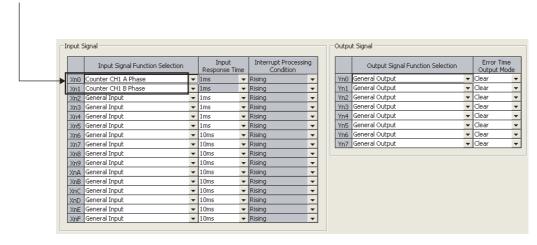

8.3.1 Common settings

This section describes settings common to some operation modes.

(1) Operation mode setting

According to the application, select an operation mode from the following five modes. The setting items depend on the selected operation mode. For required settings and available functions for each operation mode, refer to the following table.

Operation mode	Description	Reference
Normal mode	In this mode, the CPU module operate as a general high-speed counter.	Page 198, Section 8.4
Frequency measurement mode	The frequencies of pulses input to the pulse input signals of phases A and B are measured.	Page 220, Section 8.5
Rotation speed measurement mode	A rotation speed is calculated from the number of pulses input to the pulse input signals of phases A and B.	Page 226, Section 8.6
Pulse measurement mode	The on or off width of pulses input to Function input signal is measured.	Page 232, Section 8.7
PWM output mode	PWM waveforms are output from Coincidence output No.1 signal.	Page 235, Section 8.8

(2) Count source selection


Select a count source from the following.

Count source	Description	Operation mode where the setting can be used	
A Phase/B Phase	Counts pulses input to the pulse input signals of phases A and B of an external I/O connector. Select a pulse count method in "Pulse Input Mode".	Normal mode Frequency measurement mode Rotation speed measurement mode	
Internal Clock (0.1µs)			
Internal Clock (1µs)	Counts pulses generated at the inside of a LCPU in the specified cycle.	Normal mode	
Internal Clock (10µs)	Counts pulses generated at the inside of a LCFO in the specified cycle.		
Internal Clock (100μs)			
Other CH Coincidence Output No.1	Counts pulses at the timing according to the operation mode set to other channels. • Normal mode: On the rising edge of CH2 Counter value coincidence (No.1) (SM1901) (when the own channel is CH1) • PWM output mode: On the rising edge of Coincidence output No.1 signal	Own channel: Normal mode Other channels: Normal mode or PWM output mode	

(a) Internal clock

By setting the internal clock, clock frequencies generated at the inside of the LCPU can be counted as input pulses. For example, when the internal clock is used together with the coincidence output function, an on delay timer can be configured.

Ex. Selecting "Internal Clock (100μs)" in Count Source Selection and turning on Coincidence output No.1 signal after the elapse of 180 seconds

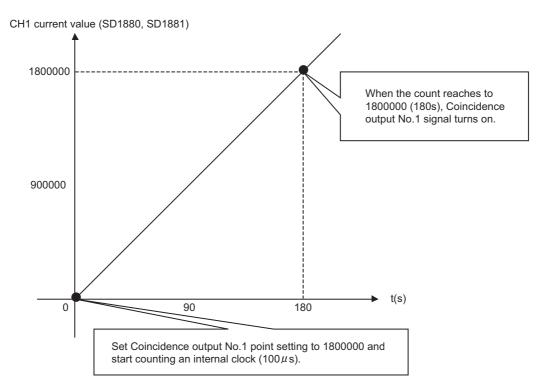

A count value and time have the following relationship.

Count value =
$$\frac{\text{Time (s)}}{\text{Internal clock } (\mu s)}$$



The accuracy of measured time against a count value is as follows.

Count source	Time accuracy	
	±60ppm and "-6.25ns to +9.376ns"	
Internal Clock (0.1μs)	(Example) When pulses are counted from 0 to 10000, time calculated using a count value is: 1ms (= (10000 - 0) \times 0.1 μ s). However, the measured time will be as follows:	
	$(1\text{ms} \times (1-0.00006) - 6.25\text{ns}) \text{ to } (1\text{ms} \times (1 + 0.00006) + 9.376\text{ns})$	
Internal Clock (1µs)		
Internal Clock (10µs)	±60ppm	
Internal Clock (100µs)		

(3) Pulse input mode

Select the mode of pulses input to the pulse input signals of phases A and B. The mode can be set when "A Phase/B Phase" has been selected for Count Source Selection. The following eight pulse input modes are available. ϕA and ϕB express phase A and phase B, respectively.


Pulse input method	Count timing		
1-phase multiple of 1	For counting up	φA φB and CH1 count down command (SM1894)	Counts on the rising edge (\uparrow) of ϕA . Both ϕB and CH1 Count down command (SM1894) are off.
1-priase multiple of 1	For counting down	φA	Counts on the falling edge (\downarrow) of ϕA . Either ϕB or CH1 Count down command (SM1894) is on.
1-phase multiple of 1	For counting up	φACH1 count down command (SM1894)	Counts on the rising edge (↑) of φA. CH1 Count down command (SM1894) is off.
(A phase only)	For counting down	φA CH1 count down command (SM1894)	Counts on the falling edge (\downarrow) of ϕ A. CH1 Count down command (SM1894) is on.
1-phase multiple of 2	For counting up	φA φB and CH1 count down command (SM1894)	Counts on the rising edge (\uparrow) and the falling edge (\downarrow) of ϕA . Both ϕB and CH1 Count down command (SM1894) are off.
	For counting down	φAφB and CH1 count down command (SM1894)	Counts on the rising edge (\uparrow) and the falling edge (\downarrow) of ϕA . Either ϕB or CH1 Count down command (SM1894) is on.
1-phase multiple of 2(A phase only)	For counting up	φA CH1 count down command (SM1894)	Counts on the rising edge (\uparrow) and the falling edge (\downarrow) of ϕA . CH1 Count down command (SM1894) is off.
	For counting down	φA CH1 count down command (SM1894)	Counts on the rising edge (\uparrow) and the falling edge (\downarrow) of ϕA . CH1 Count down command (SM1894) is on.

Pulse input method		Count timing				
CW/CCW	For counting up	φA φB	Counts on the rising edge (\uparrow) of ϕA . ϕB is off.			
	For counting down	φA φB 	ϕA is off. Counts on the rising edge (\uparrow) of $\phi B.$			
2-phase multiple of 1	For counting up	φA	Counts on the rising edge (\uparrow) of ϕA while ϕB is off.			
	For counting down	φA φB	Counts on the falling edge (\downarrow) of ϕA while ϕB is off.			
2-phase multiple of 2	For counting up	φA	Counts on the rising edge (\uparrow) of ϕA while ϕB is off. Counts on the falling edge (\downarrow) of ϕA while ϕB is on.			
2-phase multiple of 2	For counting down	φA	Counts on the rising edge (\uparrow) of ϕA while ϕB is on. Counts on the falling edge (\downarrow) of ϕA while ϕB is off.			
2-phase multiple of 4	For counting up	φA	Counts on the rising edge (\uparrow) of ϕA while ϕB is off. Counts on the falling edge (\downarrow) of ϕA while ϕB is on. Counts on the rising edge (\uparrow) of ϕB while ϕA is off.			
	For counting down	φA	Counts on the rising edge (\uparrow) of ϕA while ϕB is on. Counts on the falling edge (\downarrow) of ϕA while ϕB is off. Counts on the rising edge (\uparrow) of ϕB while ϕA is off. Counts on the falling edge (\downarrow) of ϕB while ϕA is on.			

Point P

When a pulse input mode has been set to "1-Phase Multiple of 1 (A Phase Only)" or "1-Phase Multiple of 2 (A Phase Only)", the input signal of phase B can be used for other functions, such as general-purpose input function other than the interrupt input function.

The overview of external connections regarding pulse input is as follows.

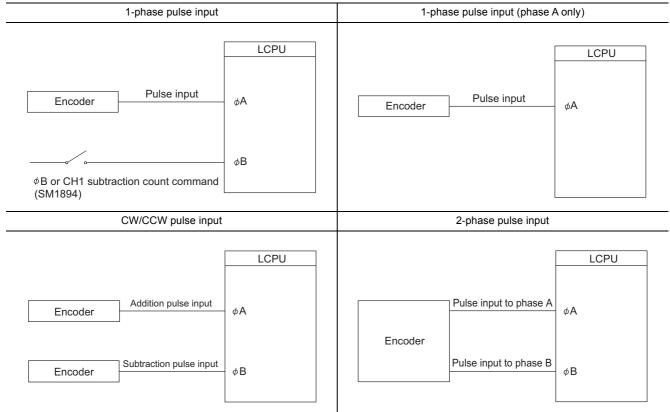

(4) Counting speed setting

Select the counting speed of pulses with considering the following conditions.

Counting speed	Available pulse input mode	Available count source
10kpps	All	
50kpps	All	
100kpps	All other than "2-Phase Multiple of 1"	A Phase/B Phase
	1-Phase Multiple of 2	711110075111100
200kpps	1-Phase Multiple of 2 (A Phase Only)	
	2-Phase Multiple of 4	

8.4 Normal Mode

This section describes settings that become valid and functions that can be used when "Normal Mode" is selected for "Operation Mode Setting". The following table shows I/O signals used in this mode.

O: Wiring required	ired when necess	sarv — Wirin	a not required

. Willing required, Z. Willing required when necessary, . Willing net required								
Count source		Input signal				Output signal		
		Phase A F	Phase B	Phase Z	Function	Latch counter	Coincidence	Coincidence
		Filase A	Filase B	Phase Z	input signal	input signal	output No.1 signal	output No.2 signal
	1-phase							
	multiple of 1				△*3	△*3	△*3	△*3
	(A phase only)		*2					
	1-phase							
	multiple of 2							
	(A phase only)							
	1-phase		0					
A phase/B	multiple of 1							
phase	1-phase	0						
p	multiple of 2							
	CW/CCW							
	2-phase							
	multiple of 1	_						
	2-phase							
	multiple of 2							
	2-phase							
	multiple of 4							
	0.1μs							
Internal clock	1μs							
	10μs	*2	*2					
	100μs							
Other Ch	Coincidence]						
Outp	ut No.1 ^{*1}							
		•	•			l .		

- *1 Setting the high-speed counter function of other channel to the normal mode or PWM output mode is required.
- *2 The signals can be used for other functions such as the general-purpose input except the interrupt input.
- *3 Wiring the input signal is required depending on the selected counter function. When this signal is not required, it can be used for other functions such as the general-purpose input and general-purpose output.

This section describes required settings and functions for each of the following item.

Item	Reference
Preset	Page 202, Section 8.4.1
Coincidence output	Page 205, Section 8.4.2
Coincidence detection	Page 208, Section 8.4.3
Counter function selection	Page 211, Section 8.4.4

First of all, the setting item, "Counter Format", which is common for all items, is described.

Note that the explanations in this section assume use of CH1. For the special relay, special register, dedicated instructions, error codes, and warning codes for CH2, refer to the following.

- Special relay and special register: Fage 240, Section 8.9 (2)
- Dedicated instructions: Page 241, Section 8.10
- Error codes: Page 265, Section 8.12 (1)
- Warning codes: Fage 266, Section 8.12 (2)


(1) Counter type

Select the high-speed counter type.

- Linear counter: Counts pulses within the range of -2147483648 to 2147483647.
- Ring counter: Counts pulses within the range between the ring counter upper limit value and the lower limit value.

(a) Operations of the linear counter

This counter type can be used with any counter functions available in the normal mode.

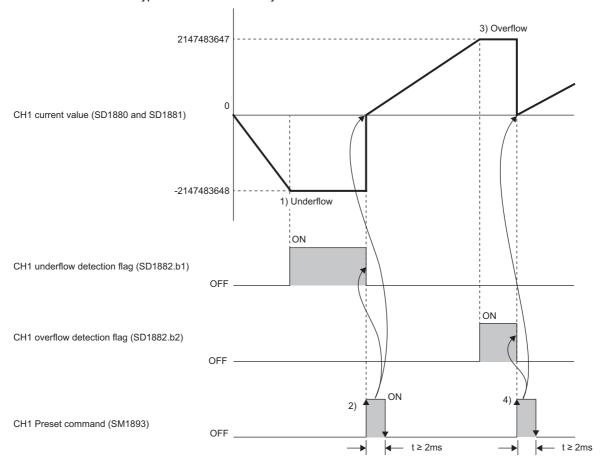


No.	Description of operation
1)	When CH1 Current value (SD1880, SD1881) becomes smaller than the lower limit (-2147483648) during counting down, "detection (1)" is stored in the underflow detection flag (SD1882.b1). Even if an additional pulse is inputted, the CH1 Current value (SD1880, SD1881) remains at the lower limit (-2147483648).
2)	When performing preset of the current value by turning on the CH1 Preset command (SM1893) or other methods, "No detection (0)" is stored in the underflow detection flag (SD1882.b1). The value is preset to "0" in the above chart. And then, counting restarts.
3)	When CH1 Current value (SD1880, SD1881) becomes larger than the upper limit (2147483647) during counting up, "detection (1)" is stored in the overflow detection flag (SD1882.b2). Even if an additional pulse is inputted, the CH1 Current value (SD1880, SD1881) remains at the upper limit (2147483647).
4)	When presetting the value by turning on the CH1 Preset command (SM1893) or other methods, "No detection (0)" is stored in the overflow detection flag (SD1882.b1). The value is preset to "0" in the above chart. And then, counting restarts.

Errors of the linear counter
 When the overflow error or underflow error is detected, "Over/underflow error (CH1 Error code: 3100)" occurs.


(b) Operations of the ring counter

This counter type counts pulses repeatedly within the range within the range between the ring counter upper limit value and the lower limit value. These limit values are set by the ring counter upper/lower limit value write instruction (ICRNGWR1(P)) (Page 243, Section 8.10.1 (2)). This counter type can be used with any counter functions available in the normal mode. When the ring counter is selected, the overflow error and underflow error does not occur.

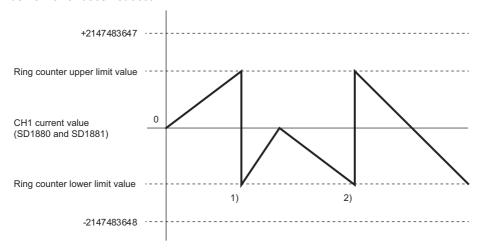

No.	Description of operation
1)	When CH1 Current value (SD1880, SD1881) is counted up from "the upper limit value -1", the lower limit value is stored in the current value.
2)	When CH1 Current value (SD1880, SD1881) is counted down from the lower limit value, "the upper limit value -1" is stored in the current value.

- Count range of the ring counter
 The count range differs depending on the CH1 Current value (SD1880, SD1881) when preset is
 performed or CH1 Count enable command (SM1895) is turned on, upper limit value and lower limit value.
- Ex. When setting the ring counter lower limit value to -50000 and the ring counter upper limit value to 100000 (except for Range 3)

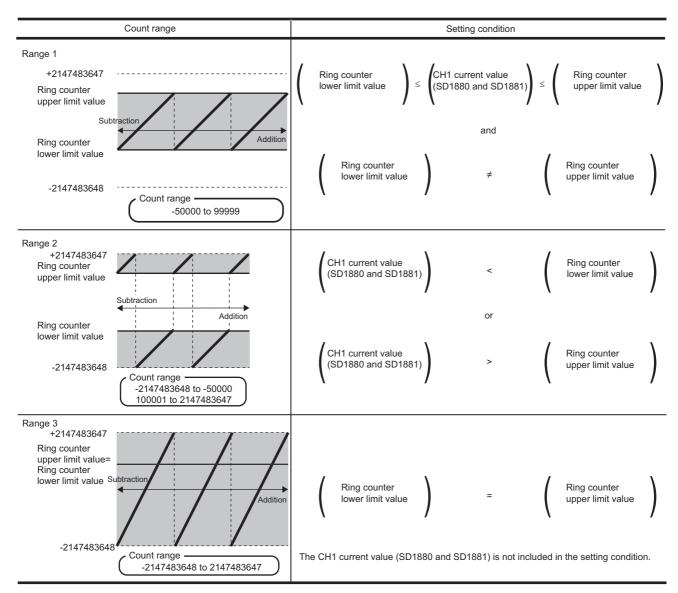

Precautions

- The change of upper limit value and lower limit value of ring counter takes effect when rising edge of CH1 Count enable command (SM1895) is detected. To enable the changed settings of these values when CH1 Count enable command (SM1895) is on, turn off it for 2ms or more and then turn on it.
- When changing the count range by preset, perform it after turning off CH1 Count enable command (SM1895) to prevent incorrect counts.

8.4.1 Preset

This function overwrites CH1 Current value (SD1880, SD1881) with a value set to Preset value write instruction (ICPREWR1(P)) (preset value) and counts pulses starting from the set value (Page 245, Section 8.10.1 (3)). The following methods are available.

- · Preset by phase Z input
- · Preset by a program
- Preset by the preset at coincidence output function (Page 207, Section 8.4.2 (1))
- Preset by the count disable/preset function (Page 217, Section 8.4.4 (2) (d))
- Preset by the latch counter/preset/replace function (Page 219, Section 8.4.4 (2) (e))

This section describes preset by phase Z input and preset by a program.

(1) Z phase settings

(a) Z phase (preset) trigger setting

Select a trigger condition to perform the preset function by phase Z input from the following.

Rising edge	Falling edge
Phase Z	Phase Z
Rising edge +Falling edge	During ON
Phase Z	Phase Z

(b) External preset (Z phase) request detection setting

When performing the preset function by phase Z input, select whether to turn on CH1 External preset (phase Z) request detection (SM1886). This setting is invalid if "Z Phase (Preset) Trigger Setting" is set to "During ON". Select either of the following items.

- ON at detection
- · Not ON at detection
- Precautions


While CH1 External preset (phase Z) request detection (SM1886) is on, the current value cannot be replaced with the preset value by any method. In this case, turn off this relay by turning on CH1 External preset (phase Z) request detection reset command (SM1897).

(2) Details of the preset

(a) Preset by phase Z input

With phase Z input, the current value is replaced with the preset value when the set trigger condition is met.

Ex. Operation when "Z Phase (Preset) Trigger Setting" is set to "Rising" and "External Preset (Z Phase)
Request Detection Setting" is set to "ON at detection"

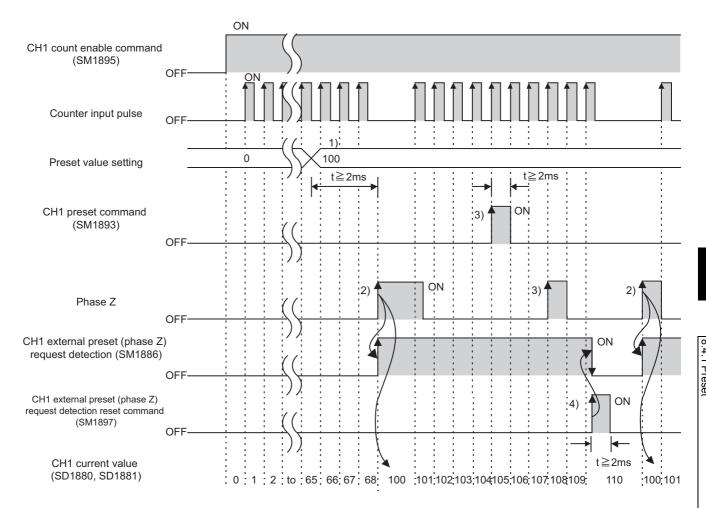


No.	Description of operation	
1)	When Preset value write instruction (ICPREWR1(P)) is executed, a set value is overwritten to the preset value setting.	
2)	The value written to the preset value setting is stored in CH1 Current value (SD1880, SD1881) on the rising edge of phase Z. CH1 External preset (phase Z) request detection (SM1886) turns on. The current value can be replaced with the preset value independent of the on/off status of CH1 Count enable command (SM1895).	
3)	While CH1 External preset (phase Z) request detection (SM1886) is on, the current value cannot be replaced.	
4)	In this case, turn off this relay by turning on CH1 External preset (phase Z) request detection reset command (SM1897).	

Precautions

Provide a 2ms or more interval between the execution command establishment of the Preset value write instruction (ICPREWR1(P)) and replacement with the preset value. If not, the value of the preset value setting before change may be stored in CH1 Current value (SD1880, SD1881). When the preset function is performed by CH1 Preset command (SM1893), execution of the relay delays. Therefore, providing a period is not required.

(b) Preset by a program

When not using a phase Z and the counter function selection, perform the preset function by turning on CH1 Preset command (SM1893) by a program.

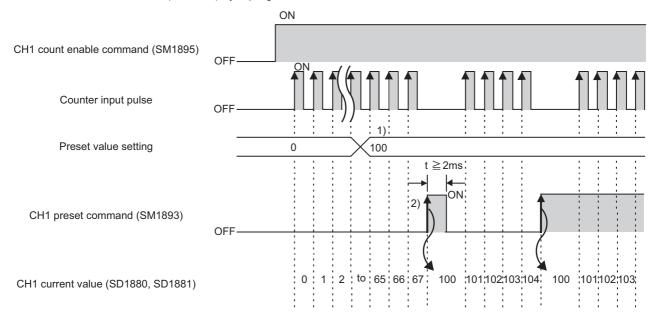


No.	Description of operation
1)	When Preset value write instruction (ICPREWR1(P)) is executed, a set value is overwritten to the preset value setting.
	The value written to the preset value setting is stored in CH1 Current value (SD1880, SD1881) on the rising edge of CH1 Preset
2)	command (SM1893). The current value can be replaced with the preset value independent of the on/off status of CH1 Count
	enable command (SM1895).

8.4.2 Coincidence output

Coincidence output is a function by which a signal can be output when a value set by the coincidence output point write instruction (ICCOVWR1(P)) matches the CH1 Current value (SD1880, SD1881) (Page 250, Section 8.10.1 (6)). Two kinds of coincidence outputs (No.1 and No.2) are provided for each channel.

Ex. When the Coincidence output No.1 signal is turned on

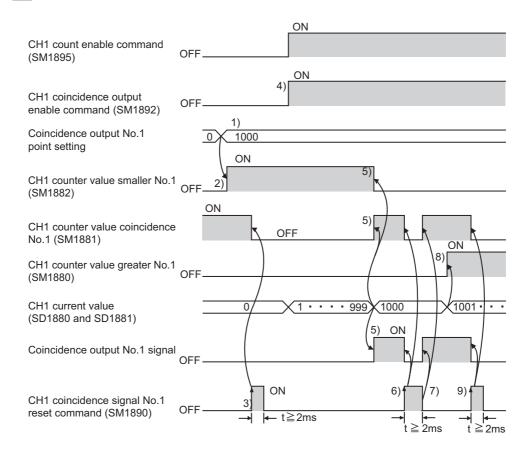

No.	Description of operation
1)	By executing the Coincidence output point write instruction (ICCOVWR1(P)), any value can be written to the coincidence output No.1 point setting area.
2)	When the following condition is met, CH1 Counter value smaller (No.1) (SM1882) turns on. • CH1 Current value (SD1880 or SD1881) < Coincidence output No.1 point setting
3)	When CH1 Coincidence signal No.1 reset command (SM1890) is turned on, CH1 Counter value coincidence (No.1) (SM1881) and the Coincidence output No.1 signal turn off.
4)	To enable the output by the Coincidence output No.1 signal, turn on CH1 Coincidence output enable command (SM1892). (Output of both the Coincidence output No.1 and No.2 signals is enabled.)
5)	When the following condition is met, CH1 Counter value coincidence (No.1) (SM1881) and the Coincidence output No.1 signal turn on. • CH1 Current value (SD1880, SD1881) = Coincidence output No.1 point setting Also, when the following condition is met, CH1 Counter value smaller (No.1) (SM1882) turns off. • CH1 Current value (SD1880 or SD1881) ≥ Coincidence output No.1 point setting
6)	If CH1 Coincidence signal No.1 reset command (SM1890) is turned on while the values match, CH1 Counter value coincidence (No.1) (SM1881) and the Coincidence output No.1 signal turn off.
7)	If CH1 Coincidence signal No.1 reset command (SM1890) is turned off while the values match, CH1 Counter value coincidence (No.1) (SM1881) and the Coincidence output No.1 signal turn on again.
8)	When the following condition is met, CH1 Counter value greater (No.1) (SM1880) turns on. • CH1 Current value (SD1880 or SD1881) > Coincidence output No.1 point setting
9)	When CH1 Coincidence signal No.1 reset command (SM1890) is turned on, CH1 Counter value coincidence (No.1) (SM1881) and the Coincidence output No.1 signal turn off. If CH1 Counter value coincidence (No.1) (SM1881) remains on, it cannot turn on the next time.

Point P

- CH1 Counter value coincidence (No.n) (SM1881 or SM1884) can turn on regardless of the status of CH1 Coincidence output enable command (SM1892).
- Due to internal processing of the high counter function, when CH1 Counter value coincidence (No.n) is turned on, CH1 Counter value greater (No.1) (SM1880) or CH1 Counter value smaller (No.1) (SM1882), or CH1 Counter value greater (No.2) (SM1883) or CH1 Counter value smaller (No.2) (SM1885) may be on.

· Precautions


- When program scan time is less than 2ms, ensure a 2ms or longer on width for Coincidence signal No.n reset command (SM1890 or SM1891) by using a method such as a timer.
- Coincidence output occurs on the rising edge of CH1 Counter value coincidence (No.n) (SM1881, SM1884). Because of this, if it stays on, the next coincidence signal cannot be output. BY turning on CH1 Coincidence signal No.n reset command (SM1890 or SM1891), turn off CH1 Counter value coincidence (No.n) (SM1881 or SM1884).

(1) Coincidence output time preset setting

Select whether to set a preset value on the rising edge of CH1 Counter value coincidence (No.1) (SM1881).

- · Not preset
- Preset

This setting is used for an operation such as sizing. Note, however, that this setting is not available for CH1 Counter value coincidence (No.2) (SM1884).

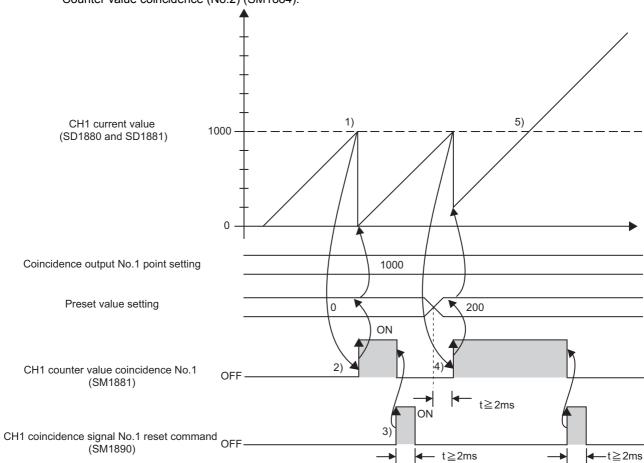

No.	Description of operation
1)	When the following condition is met, CH1 Counter value coincidence (No.1) (SM1881) turns on.
	CH1 Current value (SD1880, SD1881) = Coincidence output No.1 point setting
2)	The preset value is set on the rising edge of CH1 Counter value coincidence (No.1) (SM1881).
3)	Turn on CH1 Coincidence signal No.1 reset command (SM1890) so that CH1 Counter value coincidence (No.1) (SM1881) will be turned on the next time CH1 Current value (SD1880 or SD1881) becomes equal to the coincidence output No.1 point setting.
4)	If the preset value setting has been changed with the Preset value write instruction (ICPREWR1(P)), the new preset value is set.
5)	Even if CH1 Current value (SD1880 or SD1881) becomes equal to the coincidence output No.1 point setting with CH1 Counter value coincidence (No.1) (SM1881) not turned off, the value will not be replaced with the preset value. This happens because CH1 Counter value coincidence (No.1) (SM1881) remains on (does not rise).

(a) Precautions

- While CH1 External preset (phase Z) request detection (SM1886) is on, the current value cannot be replaced with the preset value. In this case, turn off this relay by turning on CH1 External preset (phase Z) request detection reset command (SM1897).
- Provide a 2ms or more interval between the execution command establishment of the Preset value write instruction (ICPREWR1(P)) and replacement with the preset value. If not, a preset value setting before change may be stored in CH1 Current value (SD1880, SD1881).


8.4.3 Coincidence detection

When a match is detected, an interrupt request can be issued to start an interrupt program. There are four points of interrupt factors (interrupt pointers, I0 to I3).

I Number	Interrupt factor
10	Coincidence detection of CH1 Coincidence output No.1 point setting
I1	Coincidence detection of CH1 Coincidence output No.2 point setting
12	Coincidence detection of CH2 Coincidence output No.1 point setting
13	Coincidence detection of CH2 Coincidence output No.2 point setting

Interrupt pointer numbers can be changed (Page 209, Section 8.4.3 (2)).

CH1 counter value coincidence No.1
(SM1881)
CH1 counter value coincidence No.2
(SM1884)
CH1 coincidence signal No.1 reset command
(SM1890)
CH1 coincidence signal No.2 reset command
(SM1891)

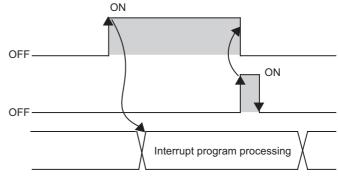

Program processing

(1) Coincidence detection interrupt setting (counter value coincidence No.n)

Select whether to "use" or "not use" the coincidence detection interrupt function by CH1 Counter value output (No.n) (SM1881, SM1884).

(a) Interrupt program execution setting by the IMASK instruction

Use of the IMASK instruction allows the interrupt program execution to be enabled or disabled (interrupt mask) for each interrupt pointer number. For details on the IMASK instruction, refer to the ALL MELSEC-Q/L Programming Manual (Common Instruction).

(b) Time taken until the interrupt request

Time taken from a coincidence detection to an interrupt request is approximately $150 \mu s$.


(c) Precautions

Coincidence output occurs on the rising edge of CH1 Counter value coincidence (No.n) (SM1881, SM1884). Because of this, if it stays on, the next coincidence signal cannot be output. BY turning on CH1 Coincidence signal No.n reset command (SM1890, SM1891), turn off CH1 Counter value coincidence (No.n) (SM1881, SM1884).

(2) Changing the interrupt pointer numbers

Configure the settings in the "Interrupt Function Module Interrupt Pointer Setting" window.

- 1. Click the Interrupt Pointer Setting button in the "PLC System" tab.
 - Project window ⇒ [Parameter] ⇒ [PLC Parameter] ⇒ "PLC System" tab
- 2. Set the interrupt pointer start No., interrupt pointer count, start I/O No., and start SI No.
- 3. Click the _____ button to exit.
- Ex. When assigning coincidence detection interrupt pointers of high-speed counter CH1 to I50 and higher

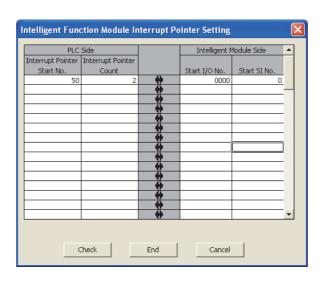


(a) Precautions

When there is no high-speed counter with the coincidence detection output setting and no input interrupt within the range specified in the "Intelligent Function Module Interrupt Pointer Setting" of PLC Parameter, "PARAMETER ERROR" occurs (error code: 3000).

The following are a correct example and an incorrect example of assigning the interrupt pointers of the high-speed counter to I50 and higher as shown above.

Correct setting example
 In this case, there is a high-speed counter (for which coincidence detection interrupt is set) within the range specified in "Intelligent Function Module Interrupt Pointer Setting." Therefore, no error will occur.

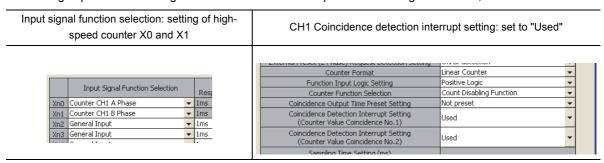

Incorrect setting example
 Although CH2 high-speed counter with the coincidence detection interrupt setting is set, both the counter
 and input interrupt settings do not exist within the range specified in the Intelligent Function Module
 Interrupt Pointer Setting window. Because of this, an error occurs.

Input signal function selection: setting of high- speed counter X2 and X3			CH2 Coincidence detection interrupt setting: set to "Used"		
			Counter Format	Linear Counter	
	Input Signal Function Selection		Function Input Logic Setting	Positive Logic	-
	Tripac signal Fariction Selection	Resp	Counter Function Selection	Count Disabling Function	▼
Xn0	General Input	▼ 1ms	Coincidence Output Time Preset Setting	Not preset	•
Xn1	General Input	▼ 1ms	Coincidence Detection Interrupt Setting	Used	
Xn2	Counter CH2 A Phase	▼ 1ms	(Counter Value Coincidence No.1)	Used	
	Counter CH2 B Phase	▼ 1ms	Coincidence Detection Interrupt Setting (Counter Value Coincidence No.2)	Used	•
			Sampling Time Setting (ms)		

8.4.4 Counter function selection

The following counter functions are selectable.

- · Latch counter function: Latches the current value of the counter.
- · Count disabling function: Stops the counting while it is enabled.
- Sampling counter function: Counts the pulses input during the specified sampling time.
- Count disable/preset/replace function: Performs the count disable function and the preset function depending on changes of the Function input signal without switching the function.
- Latch counter/preset/replace function: Performs the latch counter function and the preset function depending on changes of the Function input signal without switching the function.

These functions can be performed by either of CH1 Selected counter function start command (SM1896) or an input from the Function input signal (OR), or the Function input signal only.

○ Available, — N/A

	Method		
Function	CH1 Selected counter function start command (SM1896)	Function input signal	
Latch counter function	0	0	
Count disabling function	0	0	
Sampling counter function	0	0	
Count disable/preset function	_	0	
Latch counter/preset/replace function	_	0	

(1) Required settings

Select a logic for the Function input signal.

(a) Function input logic setting

Select a logic for the Function input signal.

- Positive logic: The function input signal is on while a voltage is applied.
- Negative logic: The function input signal is on while no voltage is applied.

This section describes each function based on the case where "Function Input Logic Setting" is set to "Positive logic" (default).

(b) Sampling time setting

This setting is enabled when "Sampling Counter Function" is selected. Set sampling time for the sampling counter function in units of 10ms.

Setting range: 10 to 655350 (ms)



A time lag occurs before start of the selected function due to any of the following factors:

- · Input response time of the Function input signal
- Program scan time (for CH1 Selected counter function start command (SM1896))
- Internal control cycle (1ms) of the high-speed function (for CH1 Selected counter function start command (SM1896))

The count error is as follows:

· Count error (maximum) when the Function input signal is used for the function

$$\left(\frac{\text{Input response time setting value (up to 70) (ms)}}{1000}\right)$$
(s) × Pulse input speed (pulse/s)*1

· Count error (maximum) in function execution by CH1 Selected counter function start command (SM1896)

$$\left(\frac{1 \text{ scan time (ms)} + 2(\text{ms})}{1000}\right)$$
 (s) × Pulse input speed (pulse/s) *1

In the case of the sampling counter function, a sampling time error due a component error (± 60 ppm) will also occur. Therefore, the count error is as follows.

Sampling time (s)*2 ×
$$\frac{60(ppm)}{1000000}$$
 × Pulse input speed (pulse/s)*1

=
$$\frac{\text{Sampling time (s)}^{*2} \times 6 \times \text{Pulse input speed (pulse/s)}^{*1}}{100000}$$

- *1 Pulse input speed (pulse/s) = pulse input frequency (Hz) × number of multiples (count)
- *2 Sampling time (s) = $\frac{\text{Sampling time setting value (ms)}}{1000}$


(2) Details on each function

(a) Latch counter function

CH1 Current value (SD1880 and SD1881) can be latched by setting in "Counter Function Selection" or by using the Latch counter input signal.

- Using "Counter Function Selection": Select "Latch Counter Function" or "Latch Counter/Preset/replace Function" (Page 219, Section 8.4.4 (2) (e)).
- · Using the Latch counter input signal

The latch count value can be read out into the specified device by the Latch counter value read instruction (ICLTHRD1(P)) (Page 246, Section 8.10.1 (4)). The following explains the operations of both methods.

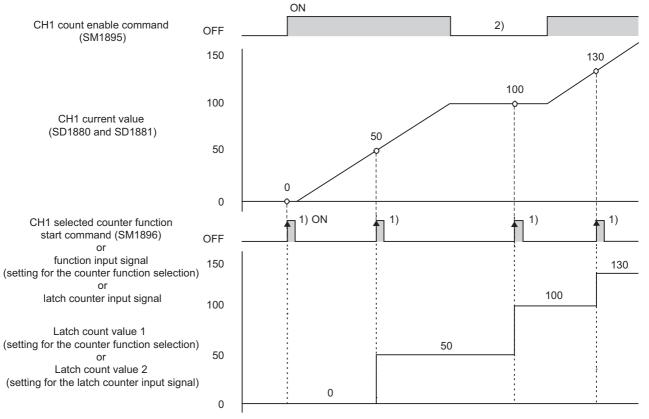


No.	Description of operation
1)	 Using "Counter Function Selection": CH1 Current value (SD1880, SD1881) is stored in the latch count value 1 area on the rising edge of CH1 Selected counter function start command (SM1896) or the Function input signal. The latch count value 1 can be read out into the specified device by the Latch counter value read instruction (ICLTHRD1(P)). Using the Latch counter input signal: CH1 Current value (SD1880, SD1881) is stored in the latch count value 2 area on the rising edge of the Latch counter input signal. The latch count value 2 can be also read out into the specified device by the Latch counter value read instruction (ICLTHRD1(P)).
2)	The latch counter function can be performed regardless of the status of CH1 Count enable command (SM1895).

Precautions

- When the latch counter function is performed by the Function input signal or the Latch counter input signal, the actual execution delays by the input response time. Updating latch count value 1 or 2 will cause a further 1ms delay in the updating cycle.
- While either of CH1 Selected counter function start command (SM1896) or the Function input signal is on, turning on the other does not latch the counter.

(b) Count disabling function


Counting can be stopped while CH1 Count enable command (SM1895) is on. To use this function, select "Count Disabling Function" for "Counter Function Selection."

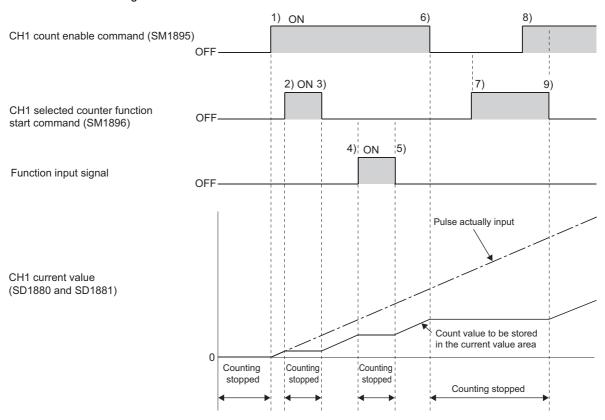

No.	Description of operation
1)	Counting starts when CH1 Count enable command (SM1895) turns on.
2)	Counting stops when CH1 Selected counter function start command (SM1896) turns on.
3)	Counting restarts when CH1 Selected counter function start command (SM1896) turns off.
4)	Counting stops when the Function input signal turns on.
5)	Counting restarts when the Function input signal turns off.
6)	Counting stops when CH1 Count enable command (SM1895) is turned off.
7)	Because CH1 Count enable command (SM1895) is off, counting stops regardless of CH1 Selected counter function start command.
8)	Even though CH1 Count enable command (SM1895) is turned on, counting remains stopped because CH1 Selected counter function start command (SM1896) is on.
9)	Counting restarts when CH1 Selected counter function start command (SM1896) turns off.

(c) Sampling counter function

The pulses input during the specified sampling time (Sampling time setting (Page 211, Section 8.4.4 (1) (b))) can be counted. The sampling count value can be read out into the specified device by the Sampling count value read instruction (ICSMPRD1(P)) (Page 248, Section 8.10.1 (5)).

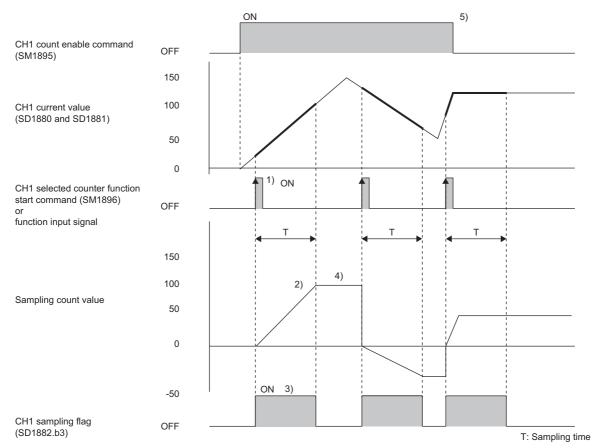


No.	Description of operation
1)	Counting of the input pulses starts from 0 on the rising edge of CH1 Selected counter function start command (SM1896) or the Function input signal.
2)	Counting stops when the specified sampling time has elapsed.
3)	During execution of the sampling counter function, Sampling flag (SD1882, b3) is set to 1 (Operating).
4)	Even after termination of the sampling counter function, the sampling count value is retained. The sampling count value can be read out into the specified device by the Sampling count value read instruction (ICSMPRD1(P)).
5)	The sampling counter function can be performed regardless of the status of CH1 Count enable command (SM1895).

Precautions

- While either of CH1 Selected counter function start command (SM1896) or the Function input signal is on, turning on the other does not perform the sampling counter function. If CH1 Selected counter function start command (SM1896) or the Function input signal is turned on during execution of the sampling counter function, the sampling time measurement will continue. However, the pulses will be counted from 0.
- If "Internal Clock (0.1µs)" is selected for Count Source Selection and 21475 or more is set for Sampling Time Setting, the sampling count value may exceed the maximum (2147483647). In that case, the sampling count value is fixed to the maximum (2147483647), and "Sampling count value overflow" (CH1 Warning code: 3050) is detected. Even after occurrence of this warning, execution of the sampling counter function continues until the sampling time has elapsed.
- The immediately preceding operation of the sampling counter function continues even after status change from STOP to RUN. Therefore, if the sampling time setting is changed by changing the status from STOP to RUN during execution of the sampling counter function, the change takes effect the next time the sampling counter function is performed.

(d) Count disable/preset function

The count disable function and the preset function can be performed depending on changes of the Function input signal without switching the function.

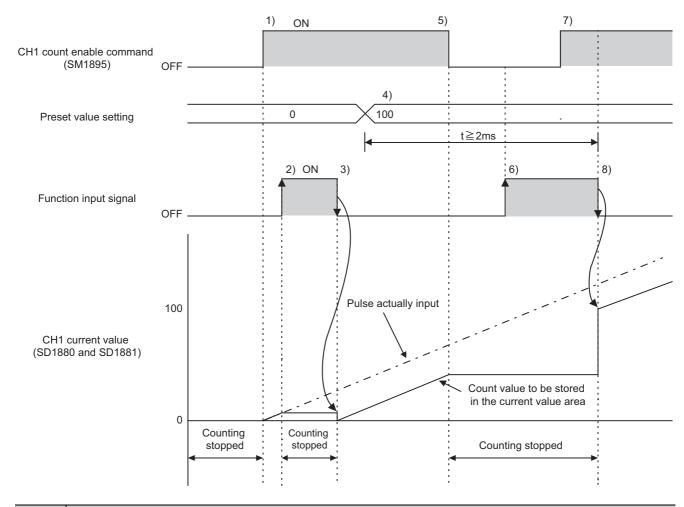

No.	Description of operation
1)	Counting starts when CH1 Count enable command (SM1895) is turned on.
2)	Counting stops on the rising edge of the Function input signal.
3)	On the falling edge of the Function input signal, the preset value setting is stored in CH1 Current value (SD1880, SD1881), and counting is restarted.
4)	When Preset value write instruction (ICPREWR1(P)) is executed, a set value is overwritten to the preset value setting.
5)	Counting stops when CH1 Count enable command (SM1895) turns off.
6)	Because CH1 Count enable command (SM1895) is off, counting stops regardless of the Function input signal.
7)	Even though CH1 Count enable command (SM1895) is turned on, counting remains stopped because the Function input signal is on.
8)	On the falling edge of the Function input signal, the preset value setting is stored in CH1 Current value (SD1880, SD1881), and counting is restarted.



The explanation in this section is based on the case where the Function Input Logic Setting is set to Positive Logic (default). The execution timing of the count disable function and the preset function in the case of Negative Logic setting is as shown below.




· Precautions

- The preset function is not available if CH1 External preset (phase Z) request detection (SM1886) is on. (Only the count disable function is executable.) In this case, turn off this relay by turning on CH1 External preset (phase Z) request detection reset command (SM1897).
- Provide a 2ms or more interval between the execution command establishment of the Preset value write instruction (ICPREWR1(P)) and replacement with the preset value. If not, a preset value setting before change may be stored in CH1 Current value (SD1880, SD1881).

(e) Latch counter/preset/replace function

The latch counter function and the preset function can be performed depending on changes of the Function input signal without switching the function.

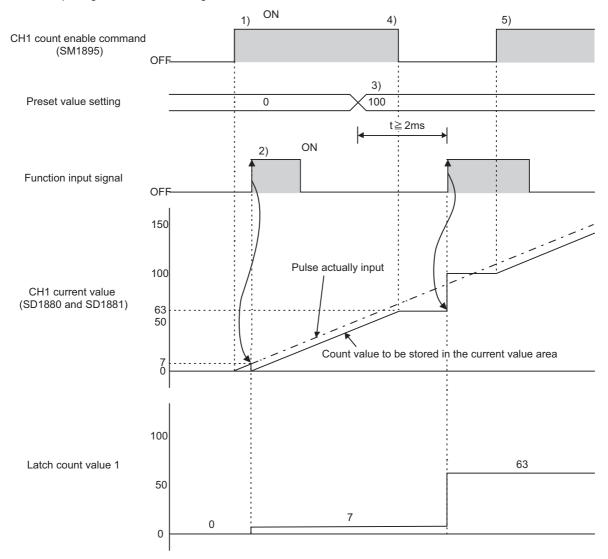

No.	Description of operation
1)	Counting starts when CH1 Count enable command (SM1895) is turned on.
2)	On the rising edge of the Function input signal, CH1 Current value (SD1880, SD1881) is stored in the latch count value 1 area. Also, the preset value setting is stored in CH1 Current value (SD1880, SD1881). The latch count value 1 can be read out into the specified device by the Latch counter value read instruction (ICLTHRD1(P)).
3)	When the Preset value write instruction (ICPREWR1(P)) is executed, a given value is written as a preset value setting.
4)	Counting stops when CH1 Count enable command (SM1895) is turned off.
5)	Counting restarts when CH1 Count enable command (SM1895) is turned on.

· Precautions

- The preset function is not available if CH1 External preset (phase Z) request detection (SM1886) is on. (Only the latch counter function is available.) In this case, turn off this relay by turning on CH1 External preset (phase Z) request detection reset command (SM1897).
- Provide a 2ms or more interval between the execution command establishment of the Preset value write instruction (ICPREWR1(P)) and replacement with the preset value. If not, the value of the preset value setting before change may be stored in CH1 Current value (SD1880, SD1881).

8.5 Frequency Measurement Mode

This section describes settings and functions that become valid when "Frequency Measurement Mode" is selected for "Operation Mode Setting". In this mode, the pulses input from phase A and phase B pulse input signals are counted, and the frequency is automatically calculated from the pulses. The measured frequency value is written to the specified device using the Frequency measurement instruction (ICFCNT1) (FRONT1) (FRONT2). The following table shows I/O signals used in this mode.

○: Wiring required, —: Wiring not required

Count source		Input signal					Output signal	
		Phase A	Phase B	Phase Z	Function input signal	Latch counter input signal	Coincidence output No.1 signal	Coincidence output No.2 signal
	1-phase multiple of 1 (A phase only) 1-phase		*1					
	multiple of 2 (A phase only)							
A b /D.	1-phase multiple of 1							
Aphase/B phase	1-phase multiple of 2	0		*2	*2	*2	*2	*2
	CW/CCW							
	2-phase multiple of 1		0					
	2-phase multiple of 2							
	2-phase multiple of 4							

^{*1} The signals can be used for other functions such as the general-purpose input except the interrupt input.

Note that the explanations in this section assume use of CH1. For the special relay, special register, and dedicated instructions for CH2, refer to the following.

- Special relay and special register: Page 240, Section 8.9 (2)
- Dedicated instructions: Page 241, Section 8.10

^{*2} The signals can be used for other functions such as the general-purpose input and output.

(1) Required settings

(a) Frequency movement averaging processing count

The frequency measurement function performs moving average processing to reduce the unevenness among the measured frequencies. The setting range is 1 to 100 (times). When "1" is set, the processing is not performed. After frequencies are measured for the number of times set to the frequency movement averaging processing count, the average is stored as a measured frequency value.

(b) Frequency measurement unit time setting

Select a pulse measurement time to calculate frequencies from 0.01s, 0.1s, and 1s. The frequencies are calculated using the following formula.

Frequency (Hz) =
$$\frac{\text{Count value per unit time}}{\text{Frequency measurement unit time setting (S)}}$$

When the count per time unit is 0, the frequency becomes 0. When counting down, the frequency becomes a negative value.

(2) Relationship between frequency measurement unit time and frequency

Frequency is calculated from the count value per time unit (Frequency Page 221, Section 8.5 (1) (b)). The following table shows the unit of frequency for each frequency measurement unit time setting when the frequency movement averaging processing count is set to "1". Select an appropriate unit time according to the time and frequency to be measured.

Frequency measurement unit time	Unit of frequency
1s	1Hz
0.1s	10Hz
0.01s	100Hz

(3) Frequency error

Frequency error (maximum) can be calculated using the following formula.

$$\text{Error (maximum) (Hz) = Actual frequency (Hz)} \times \frac{60 \text{(ppm)}}{1000000} + \frac{1}{\text{frequency measurement unit time (s)} \times \text{number of frequency moving averages} }$$

Setting larger values for the following items helps reduce error and unevenness among the measured frequencies.

- · Frequency measurement unit time
- · Frequency movement averaging processing count

(4) Measurement example

In this example, frequency is measured under the following conditions.

- · Actual frequency: 1234Hz
- · Frequency measurement unit time: 0.01s
- · Frequency movement averaging processing count: 1 (The moving average processing is not performed.)

(a) Count value per time unit

Count value per time unit for the actual frequency is calculated as follows using the formula in (Page 221, Section 8.5 (1) (b)).

Count value per unit time = 12.34

The count value should be an integer. For this reason, the count value in this example is 12 or 13 because the numbers after the decimal point is accumulated within the module. When this count value is used in the formula above, the following result can be acquired.

Frequency measurement value (Hz) =
$$\frac{12 \text{ or } 13}{0.01(\text{s})}$$

Frequency measurement value (Hz) = 1200(Hz) or 1300(Hz)

(b) Calculating frequency error (maximum)

Error (maximum) (Hz) =
$$1234(Hz) \times \frac{60(ppm)}{1000000} + \frac{1}{0.01(s) \times 1}$$

= $0.07404(Hz) + 100(Hz)$
= $100.07404(Hz)$

(c) Reducing unevenness

When the frequency movement averaging processing count setting is changed to "4", frequency error (maximum) will be as follows.

Error (maximum) (Hz) =
$$1234(Hz) \times \frac{60(ppm)}{1000000} + \frac{1}{0.01(s) \times 4}$$

= $0.07404(Hz) + 25(Hz)$
= $25.07404(Hz)$

The measured frequency value in this example is 1225Hz or 1250Hz.

Accumulated count value per time unit	Measured frequency value	Measured frequency value obtained by moving average processing (4 times)
12.34	1200Hz	_
24.68	1200Hz	_
37.02	1300Hz	_
49.36	1200Hz	1225Hz
61.70	1200Hz	1225Hz
74.04	1300Hz	1250Hz
86.38	1200Hz	1225Hz
98.72	1200Hz	1225Hz
111.06	1300Hz	1250Hz

As shown in the table above, the measured frequency value obtained by moving average processing is closer to the actual frequency value. The following table shows the measurement result for each frequency measurement unit time setting.

Frequency measurement unit time	Measured frequency value	Measured frequency value obtained by moving average processing (4 times)	
1s	1234Hz	1234Hz	
0.1s	1230 or 1240Hz	1233 or 1235Hz	
0.01s	1200 or 1300Hz	1225 or 1250Hz	




Even when the pulse input mode is set to "1-Phase Multiple of 2", "1-Phase Multiple of 2 (A Phase Only)", "2-Phase Multiple of 2", or "2-Phase Multiple of 4", frequency (Hz) is calculated based on the count value per time unit.

(Example) In 1-phase multiple of 2, even if the input frequency of phase A is 10kHz (10000 pulses per second), the input frequency value is 20kHz because the pulse count is 20000 pulse/s obtained by multiplying 10000 pulse by two.

(5) Function details

The following example describes the frequency measurement operation.

Ex. Operation when the frequency measurement unit time is set to "0.1s" and the frequency movement averaging processing count is set to "4"

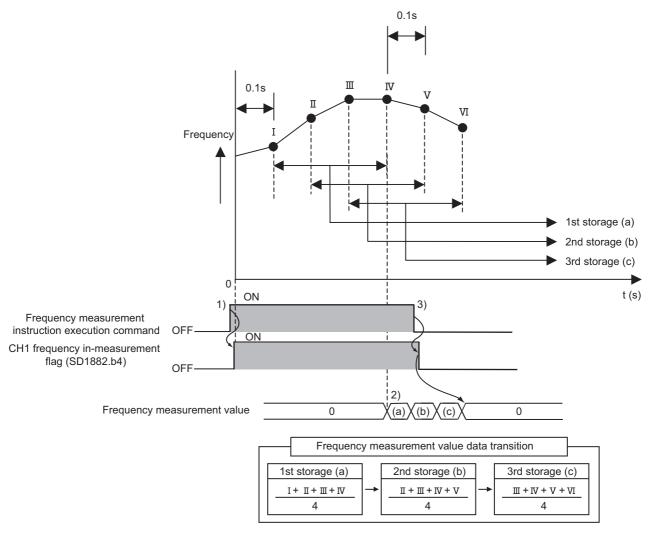

No.	Description of operation
1)	Turning on the execution command for Frequency measurement instruction (ICFCNT1) starts the following operations: • Measurement of the frequency • CH1 Frequency measurement flag (SD1882. b4) changes from stopped (0) to operating (1).
2)	While processing the execution command for Frequency measurement instruction(ICFCNT1), a measured frequency value is written to the device specified by the Frequency measurement instruction(ICFCNT1). As the frequency moving average processing count is set as 4 times, an average of the 4 counts is written.
3)	Turning off the execution command for Frequency measurement instruction (ICFCNT1) starts the following operations: • Measurement of the frequency stops. • CH1 Frequency measurement flag (SD1882. b4) changes from operating (1) to stopped (0). • The measured frequency value becomes 0. (The frequency is not stored as the setting data of Frequency measurement instruction (ICFCNT1).)

(a) Precautions

To restart frequency measurement after an interruption, execute Frequency measurement instruction (ICFCNT1) after "stopped (0)" is stored in CH1 Frequency measurement flag (SD1882. b4). If another execution command of CH1 Frequency measurement instruction (ICFCNT1) is turned on, failing to check Frequency measurement flag (SD1882. b4), while the measurement is being executed, the command may be ignored because the current measurement does not stop.

8.6 Rotation Speed Measurement Mode

This section describes settings and functions that become valid when "Rotation Speed Measurement Mode" is selected for "Operation Mode Setting". In this mode, the pulses input phase A and phase B pulse input signals are counted, and the rotation speed is automatically calculated from the pulses. The measured rotation speed value is written to the specified device using the Rotation speed measurement instruction (ICRCNT1) (Page 253, Section 8.10.1 (8)). The following table shows I/O signals used in this mode.

O 14" 1				
(). Wiring	required	— Wiring	not	required

Count source				Input s	ignal		Output signal	
		Phase A	Phase B	Phase Z	Function input signal	Latch counter input signal	Coincidence output No.1 signal	Coincidence output No.2 signal
	1-phase multiple of 1 (A phase only)		*1					
	1-phase multiple of 2 (A phase only)							
A l /D	1-phase multiple of 1							
Aphase/B phase	1-phase multiple of 2	0		*2	*2	*2	*2	*2
	CW/CCW							
	2-phase multiple of 1		0					
	2-phase multiple of 2							
	2-phase multiple of 4							

^{*1} The signals can be used for other functions such as the general-purpose input except the interrupt input.

Note that the explanations in this section assume use of CH1. For the special register, and dedicated instructions for CH2, refer to the following.

- Special register: Fage 240, Section 8.9 (2)
- Dedicated instructions: Page 241, Section 8.10

^{*2} The signals can be used for other functions such as the general-purpose input and output.

(1) Required settings

(a) Rotation speed movement averaging processing count

The rotation speed measurement function performs moving average processing to reduce the unevenness among the measured rotation speed. The setting range is 1 to 100. When "1" is set, the processing is not performed.

(b) Rotation speed measurement unit time setting

Select a pulse measurement unit time to calculate rotation speeds from 0.01s, 0.1s, and 1s. The rotation speeds are calculated using the following formula.

When the count per time unit is 0, the rotation speed becomes 0. When counting down, the frequency becomes a negative value.

(c) Number of pulses per rotation (pulse)

Set the number of pulses per rotation when a rotation speed is measured.

• Setting range 1 to 200000 (pulse)

(2) Relationship between rotation speed measurement unit time and rotation speed

Rotation speed is calculated from the count value per time unit (Page 227, Section 8.6 (1) (b)). The following table shows the unit of pulse speed for each rotation speed measurement unit time setting when the rotation speed movement averaging processing count is set to "1". Select an appropriate unit time according to the time and rotation speed to be measured.

Rotation speed measurement unit time	Unit of pulse speed
1s	1 pulse/s
0.1s	10 pulse/s
0.01s	100 pulse/s

(3) Rotation speed error

Rotation speed error (maximum) can be calculated using the following formula.

Error (maximum) = Actual rotation speed (r/min) ×
$$\frac{60(ppm)}{1000000}$$
 + $\frac{60}{rotation speed}$ × $\frac{60}{rotation speed}$

Setting larger values for the following items helps reduce error and unevenness among the measured rotation speeds.

- · Rotation speed measurement unit time
- · Rotation speed movement averaging processing count
- · Number of pulses per rotation (pulse)

(4) Measurement example

In this example, rotation speed is measured under the following conditions.

- · Actual rotation speed: 1234r/min
- · Rotation speed measurement unit time: 0.01s
- Rotation speed movement averaging processing count: 1 (The moving average processing is not performed.)
- · Number of pulses per rotation (pulse): 60pulses

(a) Count value per time unit

Count value per time unit for the actual rotation speed is calculated as follows using the formula in Page 227, Section 8.6 (1) (b).

$$1234(r/min) = \frac{60 \times Count \ value \ per \ unit \ time}{0.01(s) \times 60(pulse)}$$

Count value per unit time = 12.34

The count value should be an integer. For this reason, the count value in this example is 12 or 13 because the numbers after the decimal point is accumulated within the module. When this count value is used in the formula above, the following result can be acquired.

Rotation speed measurement value (r/min) =
$$\frac{60 \times (12 \text{ or } 13)}{0.01(\text{s}) \times 60(\text{pulse})}$$

Rotation speed measurement value (r/min) = 1200(r/min) or 1300(r/min)

(b) Calculating frequency error (maximum)

Error (maximum) (r/min) =
$$1234(r/min) \times \frac{60(ppm)}{1000000} + \frac{60}{0.01(s) \times 1 \times 60(pulse)}$$

= $0.07404(r/min) + 100(r/min)$
= $100.07404(r/min)$

(c) Reducing unevenness

When the rotation speed movement averaging processing count setting is changed to "4", rotation speed error (maximum) will be as follows.

Error (maximum) (r/min) =
$$1234$$
(r/min) × $\frac{60$ (ppm)}{1000000} + $\frac{60}{0.01}$ (s) × 4 × 60(pulse)
= 0.07404 (r/min) + 25 (r/min)
= 25.07404 (r/min)

The measured rotation speed value in this example is 1225r/min or 1250r/min.

Accumulated count value per time unit	Measured rotation speed value	Measured frequency value obtained by moving average processing (4 times)
12.34	1200r/min	_
24.68	1200r/min	_
37.02	1300r/min	_
49.36	1200r/min	1225r/min
61.70	1200r/min	1225r/min
74.04	1300r/min	1250r/min
86.38	1200r/min	1225r/min
98.72	1200r/min	1225r/min
111.06	1300r/min	1250r/min

As shown in the table above, the measured rotation speed value obtained by moving average processing is closer to the actual rotation speed value. The following table shows the measurement result for each rotation speed measurement unit time setting.

Rotation speed measurement unit time	Measured rotation speed value	Measured frequency value obtained by moving average processing (4 times)	
1s	1234r/min	1234r/min	
0.1s	1230 or 1240r/min	1233 or 1235r/min	
0.01s	1200 or 1300r/min	1225 or 1250r/min	




Even when the pulse input mode is set to "1-Phase Multiple of 2", "1-Phase Multiple of 2 (A Phase Only)", "2-Phase Multiple of 2", or "2-Phase Multiple of 4", rotation speed (r/min) is calculated based on the count value per time unit.

(5) Function details

The operation of rotation speed measurement is shown below.

Ex. Operation when the rotation speed measurement unit time is set to "0.1s" and the rotation speed movement averaging processing count is set to "4"

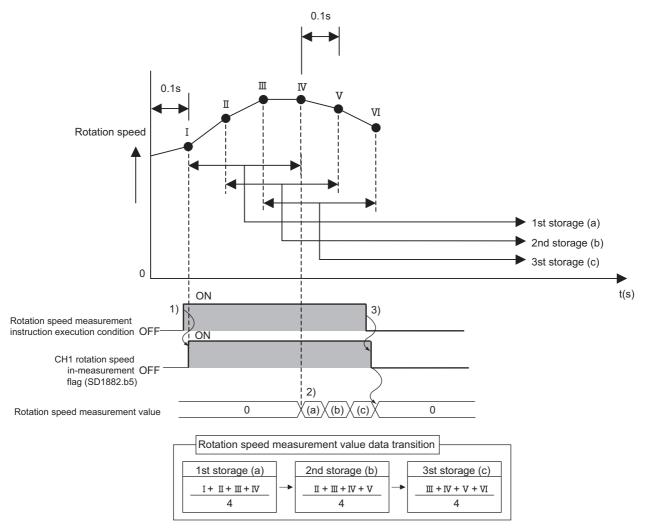

No.	Description of operation
1)	Turning on the execution command for Rotation speed measurement instruction (ICRCNT1) starts the following operations: • Measurement of the rotation speed • CH1 Rotation speed in-measurement flag (SD1882.b5) changes from operation stop(0) to operating(1).
2)	While processing the execution command for Rotation speed measurement instruction (ICRCNT1), a measured rotation speed value is written to the device specified by the Rotation speed measurement instruction (ICRCNT1). As the rotation speed moving average processing count is set as 4 times, an average of the 4 counts is saved.
3)	Turning off the execution command for Rotation speed measurement instruction (ICRCNT1) starts the following operations: • Measurement of the rotation speed stops • CH1 Rotation speed in-measurement flag (SD1882.b5) changes from operating (1) to operation stop (0). • The measured rotation speed value becomes 0. (The rotation speed is not saved to the setting data of Rotation speed measurement instruction (ICRCNT1).)

(a) Precautions

To restart frequency measurement after an interruption, execute Rotation speed measurement instruction (ICRCNT1) after "stopped (0)" is stored in CH1 Rotation speed in-measurement flag (SD1882.b5). If another execution command of Rotation speed measurement instruction (ICRCNT1) is turned on, failing to check CH2 Rotation speed in-measurement flag (SD1882.b5), while the measurement is being executed, the command may be ignored because the current measurement does not stop.

8.7 Pulse Measurement Mode

This section describes settings and functions that become valid when "Pulse Measurement Mode" is selected for "Operation Mode Setting". In this mode, the on or off width of pulses that are input to Function input signal is measured. The measured pulse value is written to the specified device using the Measured pulse value read instruction (ICPLSRD1(P)) (Page 254, Section 8.10.1 (9)). The following table shows I/O signals used in this mode.

 \bigcirc : Wiring required, \longrightarrow : Wiring not required

Operation	Input signal					Output signal		
mode	Phase A	Phase B	Phase Z	Function input signal	Latch counter input signal	Coincidence output No.1 signal	Coincidence output No.2 signal	
Pulse measurement mode	*1	*1	*2	0	*2	*2	_*2	

- *1 The signals can be used for other functions such as the general-purpose input except the interrupt input.
- *2 The signals can be used for other functions such as the general-purpose input and output.


Note that the explanations in this section assume use of CH1. For the special relay, special register, dedicated instructions, and error codes for CH2, refer to the following.

- Special relay and special register: Fage 240, Section 8.9 (2)
- Dedicated instructions: Fage 241, Section 8.10
- Error codes: Fage 265, Section 8.12 (1)

(1) Required settings

(a) Pulse measurement target setting

Select a target of pulse measurement from "Pulse ON Width" and "Pulse OFF Width".

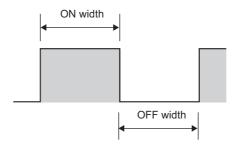

The range of pulses that can be measured
 Pulses can be measured within the range from 2000 to 2147483647 (0.2ms to approx. 214s). If the
 number of pulses exceeds the range, "Pulse measurement range overflow error" (CH1 Error code: 3200)

To resume the measurement, perform either of the following operation. Note, however, that these operations do not reset CH1 Error code (SD1887), it must be reset by CH1 Error reset command (SM1899).

- Input the pulse measurement target again. (Select on for on width and off for off width).
- Turn on CH1 Pulse measurement start command (SM1898) after turning off the CH1 Pulse measurement start command (SM1898) and setting Pulse measurement flag to stopped(0).
- Update intervals of the pulse measurement
 Update interval of the pulse measurement is 1ms. If pulses are measured twice or more often within 1ms,
 only the last measured value is read out to the device by Measured pulse value read instruction
 (ICPLSRD1(P)).
- Resolution of measured pulse value
 The resolution of the measured pulse value varies by the input response time of Function input signal.
 (Measured pulse value is the increments of the resolution.)

Input response time	Resolution (0.1μs) (time)
0.1ms	50 (5μs)
1ms	500 (50μs)
5ms	5000 (500μs)
10ms	5000 (500μs)
20ms	10000 (1000µs)
70ms	50000 (5000μs)




There is a margin of error for ± 0.1 ms in the measured pulse value, depending on the response time from the standard input circuit.

(2) Function details

The following example describes the pulse measurement operation.

Ex. Pulse ON Width" is selected for "Pulse Measurement Target Setting"

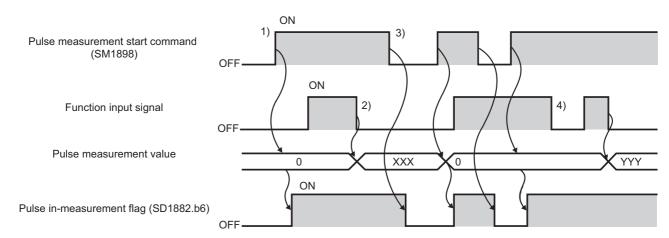

No.	Description of operation
1)	When CH1 Pulse measurement start command turns on, 0 is set as a measured pulse value and then "operating (1)" is stored in CH1 Pulse measurement flag (SD1882.b6).
2)	After completion of the pulse measurement, the measured pulse value can be read to the specified device using Measured pulse value read instruction (ICPLSRD1(P)).
3)	When CH1 Pulse measurement start command is turned off, "stopped (0)" is stored in CH1 Pulse measurement flag (SD1882.b6).
4)	When the pulse measurement target is specified before "operating (1)" is stored in CH1 Pulse measurement flag (SD1882.b6), a measured pulse value will not be updated even if the Function input signal is turned off. Only a value that is specified after "operating (1)" is stored in CH1 Pulse measurement flag (SD1882.b6) can be measured.

Point P

Updating of a measured pulse value can be indirectly detected with Function input status (SD1883.b1). (Example) With "Pulse ON Width" selected for "Pulse Measurement Target Setting", a measured pulse value is stored into D100.

SD1883.	1 [ICPLSRD1	D100	}
		END]

8.8 PWM Output Mode

This section describes settings and functions that become valid when "PWM Output Mode" is selected for "Operation Mode Setting". With this mode, PWM waveforms at a maximum of 200kHz can be output from Coincidence output No.1 signal. (This mode cannot be used for Coincidence output No.2 signal.) Set output waveforms using the PWM output instruction (ICPWM1) (Page 255, Section 8.10.1 (10)). The following table shows I/O signals used in this mode.

O: Wiring required, —: Wiring not required

	Input signal					Output signal	
Operation mode	Phase A	Phase B	Phase Z	Function input signal	Latch counter input signal	Coincidence output No.1 signal	Coincidence output No.2 signal
PWM output mode	*1	*1	*2	*2	*2	0	*2

- *1 The signals can be used for other functions such as the general-purpose input except the interrupt input.
- *2 The signals can be used for other functions such as the general-purpose input and output.

Note that the explanations in this section assume use of CH1. For the special register, and dedicated instructions for CH2, refer to the following.

- Special register: 🖙 Page 240, Section 8.9 (2)
- Dedicated instructions: Fage 241, Section 8.10


(1) Required settings

(a) Output waveform setting

Store the values of on width and a cycle in the setting data of PWM output instruction (ICPWM1).

Setting item	Setting range	Description
PWM output on width setting value	0 or 10 to 10000000 (0.1μs)	Set the on width of output pulses.
PWM output cycle setting value	50 to 10000000 (0.1μs)	Set a cycle of output pulses.

Set these values so that PWM output on width setting value may be smaller than or equal to PWM output cycle setting value.

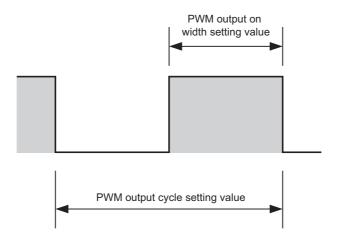


Point P

Using a duty ratio*1, PWM output on width can be calculated by the following formula.

*1 A duty ratio refers to the ratio between the on width of signals and cycle.

(2) Function details

The operation of PWM output is shown below.

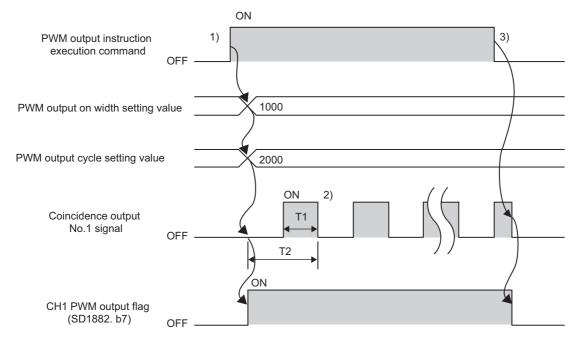

T1: PWM output on width setting value T2: PWM output cycle setting value

No.	Description of operation
1)	Turning on the PWM output instruction (ICPWM1) execution command starts the following operations. • The PWM output on width setting value and the PWM output cycle setting value of PWM output instruction (ICPWM1) become valid. (A value changed during PWM output is invalid.) • PWM waveforms are output from Coincidence output No.1 signal. (Output is started with the signal off.) • CH1 PWM output flag (SD1882. b7) turns from "not operating" (0) to "operating" (1).
2)	While the PWM output instruction (ICPWM1) execution command is established, the output of PWM waveforms is continued.
3)	Turning off the PWM output instruction (ICPWM1) execution command starts the following operations. • The output of PWM waveforms from Coincidence output No.1 signal is stopped. • CH1 PWM output flag (SD1882. b7) turns from "operating" (1) to "not operating" (0).

Point P

- Waveforms output from Coincidence output No.1 signal is susceptible to the output circuit of the LCPU and connected devices. When setting output waveforms, observe waveforms with a synchroscope.
- Output of PWM waveforms is started with the signal off.
- Output waveforms can be changed while CH1 PWM output flag (SD1882. b7) is "not operating" (0). When PWM output instruction (ICPWM1) is executed after output waveforms are changed, the waveforms after the change are output.

8.9 Specifications

(1) Performance specifications

The following is the performance specifications of the high-speed counter function.

	<u> </u>	<u>'</u>		Descri	otion	
	Iten	1	L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT L02SCPU-P, L02CPU L06CPU-P, L02CPU L06CPU-P, L06CPU			
	Number of o	channels	2			
		Phase		1-phase input (1 multiple/2 multiples), CW/CCW, 2-phase input (1 multiple/2 multiples/4 multiples)		
Count input signal			DC input	24VDC, 6.0	mA (TYP.)	
<u> </u>	Signal	level	Differential input	EIA Standard RS-422-A Di (AM26LS31 (manufacture Incorporated) c	d by Texas Instruments	
	Maxim	um counting speed		200k pulse/s (for 1 phase multipl 4)	e of 2 and 2-phase multiple of	
	C	Counting range		-2147483648 to	2147483647	
Counter		Туре		UP/DOWN preset counter (with ring counter function)	
	Minimum count	1 phase		5μι	3	
	pulse width (duty ratio 50%)	2 phases	i.	10μs		
	Minimum phase	e difference in 2-phase	input	5μ:	3	
			DC input	24VDC, 6.0mA (TYP.)		
	Phase Z (preset) Differ inp			EIA Standard RS-422-A Differential line driver level (AM26LS31 (manufactured by Texas Instruments Incorporated) or equivalent)		
External input	I	Function start	l	24\/DC_4.1mA_/TVD.\		
		Latch		24VDC, 4.1mA (TYP.)		
	Minimun	n input response time		Phase Ζ: 10μs Function start, latch: 100μs ^{*2}		
		Output type		Sink type Source type		
External	Output	Coincidence output output	No.1/PWM	5 to 24VDC, 0.25A*1		
output	voltage/current	Coincidence outp	out No.2	5 to 24VDC, 0.1A		
	Respon	so timo	On	1μs or less (rated load, resistive load)		
	Respon	se ume	Off	1μs or less (rated load, resistive load)		
	Co	mparison range		-2147483648 to 2147483647		
Coincidence				Set value < Counted value		
output	Co	mparison result		Set value > Counted value		
-	Numh	per of output points		Set value > Counted value 2 points/channel		
		ut frequency range		·		
		nimum ON width		DC to 200kHz 1μs		
PWM output		Duty ratio		τμs The cycle and ON width can be set in increments of 0.1μs.		
-	Numh	per of output points		1 point/c		
		·		ι μοιπνοπαππει		

		Description			
	Item	L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT	L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT		
Pulse width	Measurement item	Pulse width (ON width: 200μs or more, OFF width: 200μs or more)			
measurement	Measurement resolution	5μs			
	Number of measurement points	1 point/channel			
Pulse width	Measurement item	Pulse width (ON width: $200\mu s$ or more, OFF width: $200\mu s$ or more)			
measurement	Measurement resolution	5μs			
	Number of measurement points	1 point/channel			

^{*1} This applies to the CPU modules with a serial number (first six digits) is "120722" or later. For the CPU modules with a serial number (first six digits) is "120721" or earlier, the specifications will be "5 to 24VDC, 0.1A". For how to check serial numbers, refer to the following.

MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection)

^{*2} The response time takes $100\mu s$ at turning off \rightarrow on of input devices, and $200\mu s$ at turning on \rightarrow off, when the input response time is set to "0.1ms".

(2) Special relay and special register

The following table lists the special relay (SM) and special register (SD) relevant to the high-speed counter function. \square in the name indicates either of 1 (CH1) or 2 (CH2). For details, refer to the \square MELSEC-L CPU Module User's Manual (Hardware Design, Maintenance and Inspection).

Special relay				register		
num	ber	Name	num	nber	Name	
CH1	CH2	CH1		CH2		
SM1880	SM1900	CH□ Counter value greater (No.1)	SD1880	SD1900	CH□ Current value	
SM1881	SM1901	CH□ Counter value coincidence (No.1)	SD1881	SD1901	CHLI Cullent value	
SM1882	SM1902	CH□ Counter value smaller (No.1)	SD1882	SD1902	CH□ Status monitor	
SM1883	SM1903	CH□ Counter value greater (No.2)	SD1883	SD1903	CH□ External I/O status monitor	
SM1884	SM1904	CH□ Counter value coincidence (No.2)	SD1884	SD1904	CH□ Operation mode monitor	
SM1885	SM1905	CH□ Counter value smaller (No.2)	SD1885	SD1905	CH□ Counter type monitor	
SM1886	SM1906	CH□ External preset (phase Z) request detection	SD1886	SD1906	CH□ Selected counter function monitor	
SM1887	SM1907	CH□ Error	SD1887	SD1907	CH□ Error code	
SM1888	SM1908	CH□ Warning	SD1888	SD1908	CH□ Warning code	
SM1890	SM1910	CH□ Coincidence signal No.1 reset command				
SM1891	SM1911	CH□ Coincidence signal No.2 reset command				
SM1892	SM1912	CH□ Coincidence output enable command				
SM1893	SM1913	CH□ Preset command				
SM1894	SM1914	CH□ Count down command				
SM1895	SM1915	CH□ Count enable command	-	_	_	
SM1896	SM1916	CH□ Selected counter function start command				
SM1897	SM1917	CH□ External preset (phase Z) request detection reset command				
SM1898	SM1918	CH□ Pulse measurement start command				
SM1899	SM1919	CH□ Error reset command				

8.10 Dedicated Instructions


The following table lists and describes dedicated instructions for the high-speed counter function.

Ex. The current value read instruction for CH1 is ICCNTRD1(P) and for CH2 is ICCNTRD2(P).

Instru	uction	Description	Reference
CH1	CH2	Description	Reference
ICCNTRD1(P)	ICCNTRD2(P)	Stores the current counter value in the special register.	Page 242, Section 8.10.1 (1)
ICRNGWR1(P)	ICRNGWR2(P)	Sets the upper limit value and lower limit value of a ring counter.	Page 243, Section 8.10.1 (2)
ICPREWR1(P)	ICPREWR2(P)	Sets a preset value (a value to replace another).	Page 245, Section 8.10.1 (3)
ICLTHRD1(P)	ICLTHRD2(P)	Stores a latch counter value.	Page 246, Section 8.10.1 (4)
ICSMPRD1(P)	ICSMPRD2(P)	Stores a sampling count value.	Page 248, Section 8.10.1 (5)
ICCOVWR1(P)	ICCOVWR2(P)	Sets a coincidence output No.n point.	Page 250, Section 8.10.1 (6)
ICFCNT1	ICFCNT2	Measures frequency.	Page 252, Section 8.10.1 (7)
ICRCNT1	ICRCNT2	Measures rotation speed.	Page 253, Section 8.10.1 (8)
ICPLSRD1(P)	ICPLSRD2(P)	Stores a measured pulse value.	Page 254, Section 8.10.1 (9)
ICPWM1	ICPWM2	Outputs PWM waveforms.	Page 255, Section 8.10.1 (10)

8.10.1 Details of dedicated instructions

(1) Current value read instructions: ICCNTRD1(P), ICCNTRD2(P)

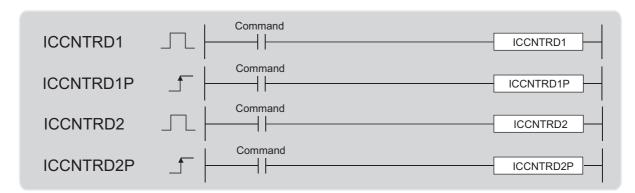

Setting data	Internal device		R, ZR		JE]/0			Constant		
	Bit	Word	, , 2 10		Bit Wor	Word	UD\GD	Z□	νи	•	Others
		DIL WOOLG	Bit	Word	DIL	vvoru			K, H	Þ	
		_	_	_	_	_	_			_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
_	_	_	_

(b) Function

This function stores the current counter value in the special register.

For ICCNTRD1(P), the storage area is CH1 Current value (SD1880 or SD1881).

The number of steps is basically one.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Other than "Normal Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

• High-speed counter function of the specified channel is not enabled.


(Error code: 4116)

(d) Program example

The latest value is stored into CH1 Current value (SD1880, SD1881) when M0 turns on.



(2) Ring counter upper/lower limit value write instructions: ICRNGWR1(P), ICRNGWR2(P)

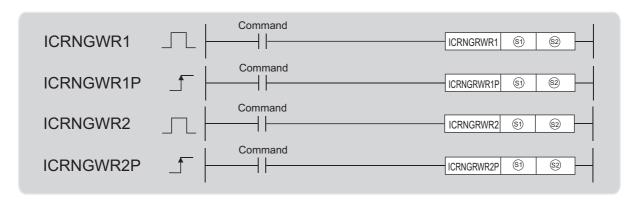

	Internal device		R, ZR		JE]/□			Constant		
Setting data	etting data Bit Word	Word	14,		Bit Word	UD/GD	Z	K, H		Others	
Bit Word	vvoru	Bit	Word	ы	Word				P		
§ 1	_	0	_	0	_	_	_	0	0	_	_
<u>\$2</u>	_	0	_	0	_	_	_	0	0	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
§ 1	Start number of the device where a ring counter lower limit value (constant) or a ring counter lower limit value is stored	• Constant: a value within -2147483648 to	Constant: BIN 32-bit
(2)	Ring counter upper limit value (constant) or start number of the device where a ring counter upper limit value is stored	2147483647 and is (⑤), ⑥)+1) ≤ (⑥), ⑥)+1) • Device: within the range of a specified device	Device: device name

(b) Function

This instruction sets the upper limit value and lower limit value of a ring counter.

The number of steps is basically three.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Ring counter lower limit value is greater than ring counter upper limit value

(Error code: 4100)

• The devices specified in $\ensuremath{\mathfrak{D}}$ and $\ensuremath{\mathfrak{D}}$ are exceeding their range.

(Error code: 4101)

• Other than "Normal Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

• Other than "Ring Counter" is selected for "Counter Format" of the specified device.


(Error code: 4116)

• High-speed counter function of the specified channel is not enabled.


(Error code: 4116)

(d) Program example

100000 is set to a ring counter lower limit value of CH1 and 100000 to a ring counter upper limit value when M0 turns on.



(3) Preset value write instructions: ICPREWR1(P), ICPREWR2(P)

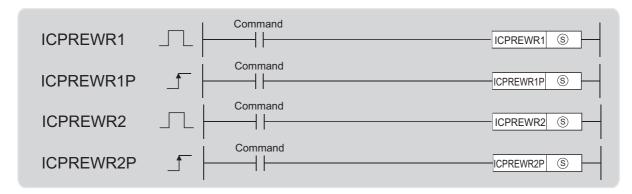

	Internal device		R, ZR		JE]\□		zo	Constant		
Setting data	Bit	Word	I, ZI	Bit Word		UD/GD	K, H		¢	Others	
	ы	Sit Word	Bit	Word	Bit W	vvoiu			к, п	Ф	
<u></u>	_	0	_	0	_	_	_	0	0	_	_

(a) Setting data

S	etting data	Setting item	Setting range	Data type
	(O)	Preset value setting (constant) Start number of the device where a value to replace is stored	Constant: -2147483648 to 2147483647 Device: within the range of a specified device	Constant: BIN 32-bit Device: device name

(b) Function

This function sets a preset value (a value to replace another).

The number of steps is basically two.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• The device specified in (s) is exceeding its range.

(Error code: 4101)

• Other than "Normal Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

· High-speed counter function of the specified channel is not enabled.


(Error code: 4116)

(d) Program example

10000 is set as the preset value of CH1 when M0 turns on.



(4) Latch counter value read instructions: ICLTHRD1(P), ICLTHRD2(P)

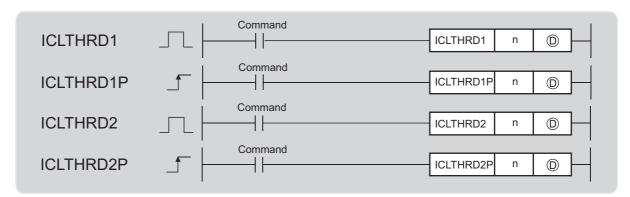

	Internal device		R, ZR		1 <u> </u>				Constant		
Setting data	Bit	Word	1.,		Bit	Word	UD/GD	Z	K, H	\$	Others
	DIL	word	Bit	Word	DIL	word			к, п	Þ	
n	_	0	_	0	_	_	_	0	0	_	_
D	1	0	_	0	_	_		0	_	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
n	Latch count value number	1, 2	BIN 16-bit
(D)	Start number of the device where a latch count value is stored	Within the range of a specified device	Device name

(b) Function

This instruction stores a latch count value n into ① and ①+1.

The number of steps is basically three.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Other than 1 or 2 is specified to n.

(Error code: 4100)

• The device specified in ① is exceeding its range.

(Error code: 4101)

• Inapplicable device is specified in D.

(Error code: 4101)

• While 1 is specified to n, other than "Latch Counter Function" or "Latch Counter/Preset Function" is selected for "Counter Function Selection".

(Error code: 4116)

• While 2 is specified to n, other than latch counter input signal is set to external input signals X8 and X9.

(Error code: 4116)

• Other than "Normal Mode" is selected for "Operation Mode Setting" of the specified channel.


(Error code: 4116)

· High-speed counter function of the specified channel is not enabled.


(Error code: 4116)

(d) Program example

The latch count value 1 of CH1 is stored into D100 and D101 when M0 turns on.



(5) Sampling count value read instructions: ICSMPRD1(P), ICSMPRD2(P)

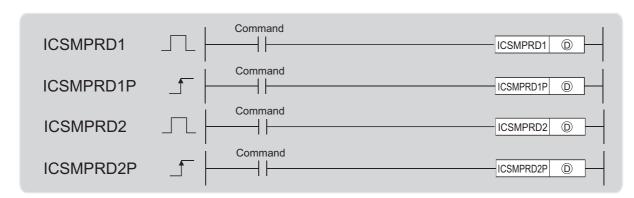

	Internal device		R, ZR		JE	J/ 🗆			Constant		
Setting data	Bit	Word	14,		Bit	Word	UD/GD	Z□	K, H	¢	Others
	ы	vvoiu	Bit	Word	Bit	word			К, П	φ	
(D)	_	0	_	0	_	_	_	0	_	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
(D)	Start number of the device where a sampling count	Within the range of a specified	Device name
	value setting is stored	device	

(b) Function

This instruction stores a sampling count value into D and D+1.

The number of steps is basically two.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Inapplicable device is specified in D.

(Error code: 4101)

• The device specified in ① is exceeding its range.

(Error code: 4101)

 Other than "Sampling Counter Function" is selected for "Counter Function Selection" of the specified device.

(Error code: 4116)

• Other than "Normal Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

• High-speed counter function of the specified channel is not enabled.


(Error code: 4116)

(d) Program example

A sampling count value of CH1 is stored into D100 and D101 when M0 turns on.



(6) Coincidence output point write instructions: ICCOVWR1(P), ICCOVWR2(P)

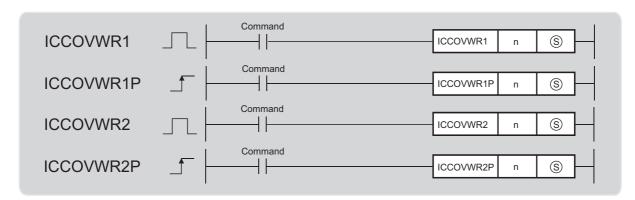

	Internal device		R, ZR		J=/=				Constant		
Setting data	Bit	Word	14,		Bit	Word	U□\G□	Z□	K, H	4	Others
	DIL	word	Bit	Word	DIL	word			к, п	Þ	
n	_	0	_	0	_	_	_	0	0	_	_
<u>s</u>	_	0	_	0	_	_	_	0	0	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
n	Coincidence output No.n point number	1, 2	BIN 16-bit
(S)	Coincidence output No.n point setting (constant) Start number of the device where Coincidence output No.n point setting is stored	Constant: -2147483648 to 2147483647 Device: within the range of a specified device	Constant: BIN 32-bit Device: device name

(b) Function

This function sets a coincidence output No.n point.

The number of steps is basically three.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Other than 1 or 2 is specified to n.

(Error code: 4100)

• Inapplicable device is specified in §.

(Error code: 4101)

• The device specified in (s) is exceeding its range.

(Error code: 4101)

• Other than "Normal Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

• High-speed counter function of the specified channel is not enabled.

(Error code: 4116)

(d) Program example

Values in D100 and D101 are set to coincidence output No.2 point setting of CH1 when M0 turns on.



(7) Frequency measurement instructions: ICFCNT1, ICFCNT2



	Interr	nal device	R	R, ZR		J/□			Constant		
Setting data	Bit	Word	14,		Bit	Word	UD/GD	Z	K, H	¢	Others
	Bit	word	Bit	Word	Bit	vvoid			к, п	Ψ	
D	_	0	_	0	_	_	_	0	_	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
	Start number of the device where a measured	Within the range of a specified	Device name
(D)	frequency value is stored	device	Device Hairie

(b) Function

This instruction measures frequencies according to the value set to "Frequency Measurement Unit Time Setting". When ICFCNT1 is executed, a measured value is stored into ① and ①+1. Frequency measurement starts at rising of the ICFCNT1 execution command and ends at falling.

The number of steps is basically two.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• The device specified in ① is exceeding its range.

(Error code: 4101)

• Other than "Frequency Measurement Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

• High-speed counter function of the specified channel is not enabled.

(Error code: 4116)

(d) Program example

Frequencies are measured at CH1 while M0 is on.



(8) Rotation speed measurement instructions: ICRCNT1, ICRCNT2



	Intern	nal device	R.	R, ZR]\□			Consta	ant	
Setting data	Bit	Word	,		Bit	Word	UD/GD	Z	К, Н	4	Others
	DIL	vvoru	Bit	Word	DIL	word			к, п	Þ	
(D)	_	0	_	0	_	_	_	0	_	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
	Start number of the device where a measured	Within the range of a specified	Device name
D	rotation speed value is stored	device	Device name

(b) Function

This instruction measures rotation speed according to the value set to "Rotation Speed Measurement Unit Time Setting". When ICRCNT1 is executed, a measured value is stored into ① and ①+1. Rotation speed measurement starts at rising of the ICRCNT1 execution command and ends at falling. The number of steps is basically two.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• The device specified in ① is exceeding its range.

(Error code: 4101)

 Other than "Rotation Speed Measurement Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

· High-speed counter function of the specified channel is not enabled.


(Error code: 4116)

(d) Program example

A measured rotation speed value of CH1 is stored into D100 and D101 while M0 is on.



(9) Measured pulse value read instructions: ICPLSRD1(P), ICPLSRD2(P)

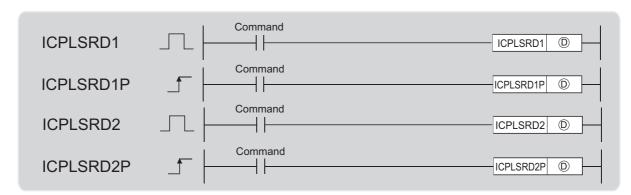

	Intern	nal device	R	R, ZR		J\ □			Constant		
Setting data	Bit	Word	11,	\	Bit	Word	UD\GD	Z□	К, Н	•	Others
	DIL	word	Bit	Word	DIL	word			к, п	Þ	
D	_	0	_	0		_	_	0	-	_	_

(a) Setting data

Setting data	Setting item	Setting range	Data type
(D)	Start number of the device where a measured pulse	Within the range of a specified	Device name
ъ	value is stored	device	Bevice name

(b) Function

This instruction stores a measured pulse into

and

+1.

The number of steps is basically two.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• The device specified in ① is exceeding its range.

(Error code: 4101)

• Other than "Pulse Measurement Mode" is selected for "Operation Mode Setting" of the specified channel.

(Error code: 4116)

• High-speed counter function of the specified channel is not enabled.


(Error code: 4116)

(d) Program example

A measured pulse value of CH1 is stored into D100 and D101 when M0 turns on.



(10)PWM output instructions: ICPWM1, ICPWM2




	Interr	nal device	R.	ZR	JE]/□			Consta	ant	
Setting data	Bit	Word	14,		Bit	Word	UD/GD	Z	K, H	¢	Others
	5	vvoru	Bit	Word	5	vvoiu			к, п	A	
§ 1	I	0	_	0	ı	_		0	0		_
<u>\$2</u>		0	_	0		_	_	0	0		_

(a) Setting data

Setting data	Setting item	Setting range	Data type
(9)	PWM output on width setting value (constant) Start number of the device where a PMW output on width setting value is stored	 Constant: 0 or a value within 10 to 10⁷ (0.1μs) and is (s₁, s₁+1) ≤ (s₂, s₂+1) Device: within the range of a specified device 	Constant: BIN 32-bit Device: device name
<u></u>	PWM output cycle setting value (constant) Start number of the device where a PWM output cycle setting value is stored	 Constant: a value within 50 to 10⁷ (0.1μs) and is (⑤), ⑥)+1) ≤ (⑥), ⑥)+1) Device: within the range of a specified device 	Constant: BIN 32-bit Device: device name

(b) Function

This instruction outputs PWM waveforms. The PWM waveform of the on width (⑤) and ⑥)+1) and cycle (⑥) and ⑥)+1) is output from the coincidence output No.1 signal while ICPWM1 is being executed. Outputting of the PWM waveform starts from the off status of the instruction.

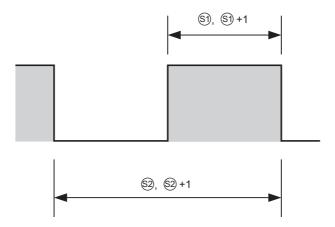

The number of steps is basically three.

(c) Error

In the following cases, an operation error occurs. Error flag (SM0) turns on and an error code is stored into SD0.

• Values outside the range are specified in §1 and §2.

(Error code: 4100)

• The data set to (s) and (s)+1 is greater than (s) and (s)+1.

(Error code: 4100)

• The devices specified in (s1) and (s2) are exceeding their range.

(Error code: 4101)

• Other than "PWM Output Mode" is selected for "Operation Mode Setting" of the specified channel.


(Error code: 4116)

· High-speed counter function of the specified channel is not enabled.

(Error code: 4116)

(d) Program example

The PWM waveform with $1\mu s$ of on width and $5\mu s$ of cycle is output from CH1 while M0 is on.



8.10.2 Precautions on dedicated instructions

This section describes the precautions for the following instructions.

- ICFCNT1
- ICRCNT1
- ICPWM1

(1) Multiple instruction executions in one scan

The instruction may not be successfully processed if it is executed to the same channel more than one time in one scan.

(2) Programs with single instruction execution

Programs do not normally processed if any of the instructions is executed in the program that is executed only once, because the off status of the execution command cannot be detected. Use the instruction in a program, such as a scan program, where the off status of an execution command can be detected.

(3) Instructions not requiring an execution command


The following instructions are executed even while the execution command is off, because they can be executed at any time. Therefore, errors can occur even while an execution command is off.

- ICFCNT1
- ICRCNT1
- ICPWM1

8.11 Programming

This section describes the programs for the high-speed counter function. When applying the program examples provided in this section to an actual system, properly verify the applicability and reliability of the control on the system.

(1) Programming procedure

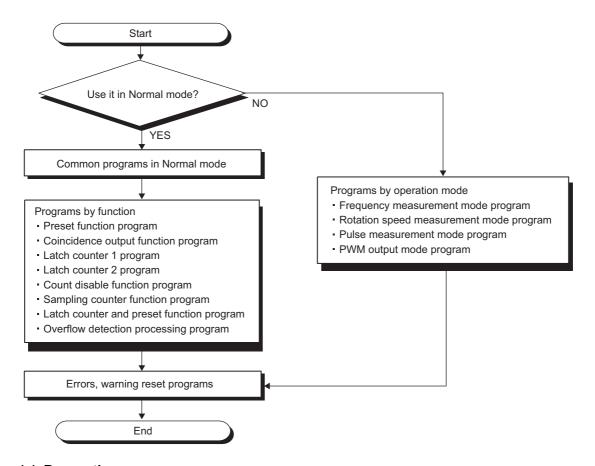

(a) Precautions

Create programs only for the functions to be used.


An error may be caused if a program for the function that is not to be used is executed.

Ex. A frequency mode program is created and executed in the normal mode.

(2) System configuration and programing condition

The following system configuration is used to introduce program examples.

(a) System configuration

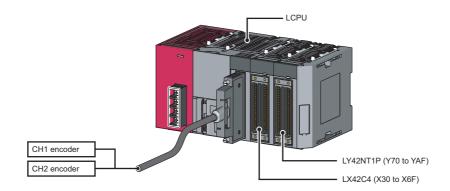

(b) Programming conditions


Device	Function			
X50	CH1 Count start signal			
X51	CH1 Count stop signal			
X52	CH1 Current value read signal			
X53	CH1 Preset command signal			
X54	CH1 Counter function execution start signal			
X55	CH1 Counter function execution stop signal			
X56	CH1 Latch 1 execution command signal			
X57	CH1 Latch count data 1 read signal			
X58	CH1 Latch count data 2 read signal			
X59	CH1 Sampling count start signal	LX42C4 (X30 to X6F)		
X5A	CH1 sampling count data read signal			
X5B	CH1 Coincidence output enable signal			
X5C	CH1 Coincidence LED clear signal			
X5D	CH1 Frequency measurement command signal			
X5E	CH1 Rotation speed measurement command signal			
X5F	CH1 Pulse measurement command signal			
X60	CH1 Measured pulse value read signal			
X61	CH1 PWM output command signal			
X62	CH1 Error reset command signal			
Y70	CH1 Coincidence confirmation LED signal	1 V 4 2 N T 4 D (V 7 0 to V A T)		
Y71	CH1 Overflow occurrence confirmation LED	LY42NT1P (Y70 to YAF)		
D2000	CH1 Current value storage			
D2001	OTTI Guitetii value siorage			
D2002	CH1 Latch count value 1 storage			
D2003	CH1 Latch count value 1 storage			
D2004	CH1 Latch count value 2 storage			
D2005	CH1 Latch count value 2 storage			
D2006	CH1 Sampling count value storage			
D2007	CH1 Sampling count value storage			

Device	Function
D2008	CH1 Measured frequency value storage
D2009	- Chi Measureu frequency value storage
D2010	CH1 Measured rotation value storage
D2011	- CITI Weasured Totalion Value Storage
D2012	CH1 Measured pulse value storage
D2013	- Chi Measureu puise value storage
D2014	CH1 Error code storage
D2015	CH1 Warning code storage
D2020	CH1 Error code acquisition
D2021	CH1 Warning code acquisition
SM1881	CH1 Counter value coincidence (No.1)
SM1887	CH1 Error
SM1888	CH1 Warning
SM1890	CH1 Coincidence signal No.1 reset command
SM1892	CH1 Coincidence output enable command
SM1893	CH1 Preset command
SM1894	CH1 Count down command
SM1895	CH1 Count enable command
SM1896	CH1 Selected counter function start command
SM1897	CH1 External preset (phase Z) request detection reset command
SM1898	CH1 Pulse measurement start command
SM1899	CH1 Error reset command
SD1880	- CH1 Current value
SD1881	OTT Guitetit value
SD1882	CH1 Status monitor
SD1887	CH1 Error code
SD1888	CH1 Warning code

(3) Program example

The following are program examples of CH1. Note that the coincidence output signal No.2 is on by default (not indicated in the examples below). Also note that when CH1 Coincidence output enable command (SM1892) turns on, Coincidence output No.2 signal also turns on.


(a) Common program in normal mode

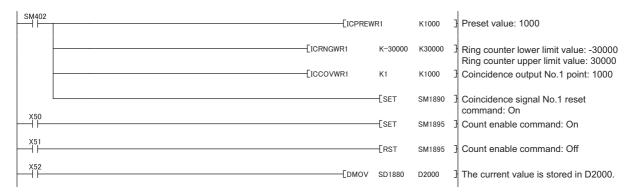

(b) Preset function program




(c) Coincidence output function program




(d) Latch counter 1 program



(e) Latch counter 2 program



(f) Count disable function program



(g) Sampling counter function program



X57 _____[ICLTHRD1 K1 D2002] A latch count value is stored in D2002.

(i) Overflow detection processing program

(h) Latch counter and preset function program



(j) Frequency measurement mode program




(k) Rotation speed measurement mode program




(I) Pulse measurement mode program



(m) PWM output mode program




(n) Error, warning reset program

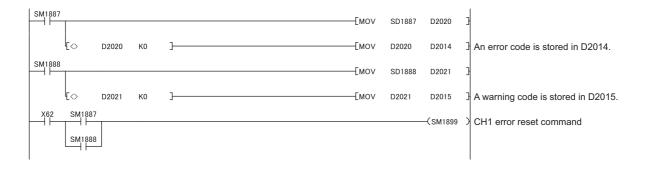

(4) Program example with the coincidence detection interrupt function

This section introduces an example of interrupt program where CH1 Counter value coincidence (No.1) (SM1881) is used. Before using an interrupt pointer, enable an interruption with the IMASK instruction. For details on the IMASK instruction, refer to the AMELSEC-Q/L Programming Manual (Common Instruction).

(a) System configuration

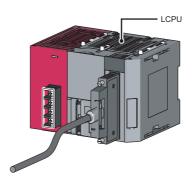


(b) Programming conditions

Provide D20 to enable an interruption of I0.

Device	Function	Setting value
D20		1
D21		0
D22		0
D23		0
D24		0
D25		0
D26		0
D27	IMA CIV in the reliant intermedian conclude flow observed devices	0
D28	IMASK instruction interruption enable flag storage device	0
D29		0
D30		0
D31		0
D32		0
D33	1	0
D34		0
D35		0

(c) Program example

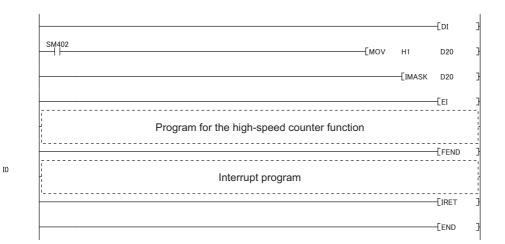

264

8.12 Errors and Warnings

This section describes errors and warnings of the high-speed counter function.

(1) Error

When an error occurs, the following operations are performed.

- The I/O ERR. LED turns on.
- · CH1 Error (SM1887) turns on.
- An error code corresponding to the error is stored to CH1 Error code (SD1887) in decimal.

Interface	Channel	No.	Name	Description
	CH1	SM1887		Indicates whether to an error has occurred in the
Special relay	CH2	SM1907	CH□ Error	high-speed counter function. Turns off when CH□ Error reset command is turned on.
	CH1	SM1899	CH□ Error reset	• Resets CH□ Error code.
	CH2	SM1919	command	Turns off CH□ Error.
	CH1	SD1887		An error code is stored upon error. The stored value
Special register	CH2	SD1907	CH□ Error code	is reset when CH□ Error reset command is turned on.

The following table lists the CH□ Error codes.

CH□ Error code (decimal)		Error name	Description	Operation at error occurrence		Corrective action
CH1	CH2			CH with an error	Other CH	
	0	Normal	_	_	_	_
3100	4100	Over/Underflow error	The value in CH1 Current value (SD1880, SD1881) has exceeded the following range. -2147483648 to 2147483647 (linear counter function only)	The linear counter function stops counting.	Not affected.	Replace the value by performing the preset function.
3200	4200	Pulse measurement range overflow error	The measurement target pulse has exceeded the measurable range (approx. 214s)	Stops measurement of pulse.		Enter the measurement target again, or turn on, off, and then on CH1 Pulse measurement start command.

Point P

- If another error occurs while an error is present, the latest error code will not be stored.
- To reset an error code, remove the error cause first and then reset with CH1 Error reset command (SM1899). If the error
 is reset without removing the error cause, it is detected again and the error code is stored.

(2) Warning

When a warning occurs, the following operations are performed.

- CH1 Warning (SM1888) turns on.
- A warning code corresponding to the warning is stored to the CH1 Warning code (SD1888) in decimal. Different from errors, occurrence of a warning does not stop the operation of CH1. The SD value is always updated with the latest warning code.

Interface	Channel	No.	Name	Description
	CH1	SM1888		Indicates whether to a warning of the high-speed
Special relay	CH2	SM1908	CH□ Warning	counter function has occurred. Turns off when CH□ Error reset command is turned on.
	CH1	SM1899	CH□ Error reset	Resets CH□ Warning code.
	CH2	SM1919	command	Turns off CH□ Warning.
	CH1	SD1888		A corresponding warning code is stored upon
Special register	CH2	SD1908	CH□ Warning code	warning. The stored value is reset when CH□ Error reset command is turned on.

The following table lists the CH□ Warning codes.

CH□ Warning code (decimal)		Name	Description	Operation at wa	_	Corrective action
CH1	CH1 CH2			CH with a warning	Other CH	
	0	Normal	_	_	_	_
3050	4050	Sampling count value overflow	The sampling count value has exceeded the following range. -2147483648 to 2147483647	Store either value of -2147483648 or 2147486347 and continue counting.	Not affected.	Check that the value obtained from "Input pulse speed (pulse/s) × sampling time" does not exceed the range.



To reset a warning code, remove the cause first and then reset with CH1 Error reset command (SM1899). If the warning is reset without removing the cause, it is detected again and the warning code is stored.

8.13 When the LCPU Stops Operation


The following shows the function status when the LCPU stopped its operation.

	Function	Operation				
Linear counter	function					
Ring counter f	unction					
Preset function						
Coincidence	Preset at coincidence output function					
output function	Coincidence detection interrupt function					
	Latch counter function	Continues the previous operation before the LCPU stopped.				
	Latch counter function					
Counter	Count disable function					
function	Sampling counter function					
selection	Count disable/preset function					
	Latch counter/preset/replace function					
	Internal clock function					
Fre	equency measurement function	Stops the frequency measurement. The frequency that has been used for moving average processing is abandoned. When the CPU module is switched to the RUN status, executing Frequency measurement instruction (ICFCNT1) starts measuring frequencies.				
Rotation speed measurement function Pulse measurement function PWM output function		Stops the rotation speed measurement. The rotation speed that has been used for moving average processing is abandoned. After the CPU module is switched to the RUN status, turning on Rotation speed measurement instruction (ICRCNT1) starts measuring rotation speed.				
		Stops the pulse measurement. When the CPU module is switched to the RUN status, this function operates according to CH1 Pulse measurement start command (SM1898).				
		Stops outputting PWM waveforms. When the CPU module is switched to the RUN status, executing PWM output instruction (ICPWM1) starts outputting PWM waveforms.				

8.14 Monitoring with a Programming Tool

When the high-speed function is executed, the operating status can be checked on the "High-Speed Counter Monitor" window of the programming tool.

[Tool] ⇒ [Built-in I/O Module Tool]

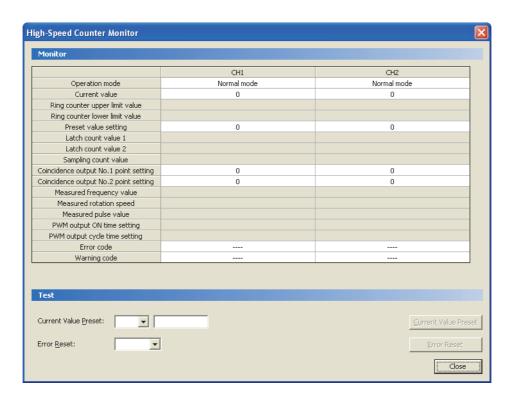

For details, refer to the A GX Works2 Version1 Operating Manual (Common).

APPENDICES

Appendix 1 Processing Time of Each Instruction

The following tables list operation processing time values of the instructions introduced in this manual. For the operation processing time of the LCPU, refer to the following.

MELSEC-Q/L Programming Manual (Common Instruction)

(1) Dedicated instructions for the positioning function

		Condition	Processing time (μs)						
Category	Instruction		L02SCPU, L02SCPU-P		L02CPU, L02CPU-P		L06CPU, L06CPU-P, L26CPU, L26CPU-P, L26CPU-BT, L26CPU-PBT		
			Minimum	Maximum	Minimum	Maximum	Minimum	Maximum	
	IPPSTRT1		18.30	18.30	9.90	9.90	7.30	7.30	
	IPPSTRT2	1	10.30	10.30	9.90	9.90	7.30	7.30	
	IPDSTRT1	_	30.80	30.80	15.60	15.60	11.90	11.90	
	IPDSTRT2		30.00	30.00	15.00	15.00	11.90	11.50	
	IPSIMUL	_	25.60	25.60	14.70	14.70	11.80	11.80	
	IPOPR1	_	30.70	30.70	15.50	15.50	11.40	11.40	
	IPOPR2								
Dedicated instruction	IPJOG1	_	44.20	44.20	21.30	21.30	16.20	16.20	
(positioning function)	IPJOG2								
(pecture migrametre)	IPABRST1	_	62.20	62.20	31.60	31.60	26.00	26.00	
	IPABRST2		02.20	02.20	31.00				
	IPSTOP1		9.50	9.50	3.80	3.80	3.10	3.10	
	IPSTOP2		9.50	9.50	5.00	3.00	3.10	3.10	
	IPSPCHG1		33.90	33.90	17.50	17.50	13.40	13.40	
	IPSPCHG2		33.30	33.90	17.50	17.50	13.40	10.40	
	IPTPCHG1		17.40	17.40	6.90	6.90	5.30	5.30	
	IPTPCHG2	_	17.40	17.40	0.90		5.30	5.50	


(2) Dedicated instructions for the high-speed counter function

			Processing time (μs)					
Category	Instruction	Condition	L02SCPU, L02SCPU-P		L02CPU, L02CPU-P		L06CPU, L06CPU-P, L26CPU, L26CPU-P, L26CPU-BT, L26CPU-PBT	
			Minimum	Maximum	Minimum	Maximum	Minimum	Maximum
	ICCNTRD1		3.70	8.70	2.10	4.60	1.60	3.80
	ICCNTRD2	_	3.70	0.70	2.10	4.00	1.00	3.00
	ICRNGWR1		6.40	13.10	3.40	6.70	2.70	5.40
	ICRNGWR2		0.40	13.10	5.40	0.70	2.70	5.40
	ICPREWR1		5.40	9.40	2.50	4.90	1.70	3.80
	ICPREWR2		5.40	5.40	2.50	4.90	1.70	3.00
	ICLTHRD1		7.60	16.50	3.60	8.90	3.20	6.30
	ICLTHRD2		7.00					
	ICSMPRD1		6.10	13.30	2.70	7.00	2.40	5.20
	ICSMPRD2						2.40	0.20
	ICCOVWR1		6.20	12.60	3.00	6.40	2.50	4.80
Dedicated instruction	ICCOVWR2			12.00	0.00	0.10		1.00
(high-speed counter	ICFCNT1	Contact off \rightarrow on	19.40	19.40	9.50	9.50	6.90	6.90
function)	ICFCNT2		10.10		0.00			
	ICRCNT1	Contact off \rightarrow	19.50	19.50	10.00	10.00	7.20	7.20
	ICRCNT2	on	10.00	10.00				
	ICPLSRD1	_	6.10	13.30	2.70	7.10	2.30	5.20
	ICPLSRD2	_	55	10.00				
	ICPWM1	Contact off → on	22.80	22.80	10.00	10.00	8.00	8.00
	IOF VVIVI I	Contact on \rightarrow on	14.90	14.90	6.90	6.90	4.60	4.60
	ICD\\\A\\	Contact off \rightarrow on	22.80	22.80	10.00	10.00	8.00	8.00
	ICPWM2	Contact on \rightarrow on	14.90	14.90	6.90	6.90	4.60	4.60

Appendix 2 Connection Examples with Servo Amplifiers


Appendix 2.1 Connection examples with servo amplifiers manufactured by Mitsubishi

(1) Connection example with MR-JN series*5

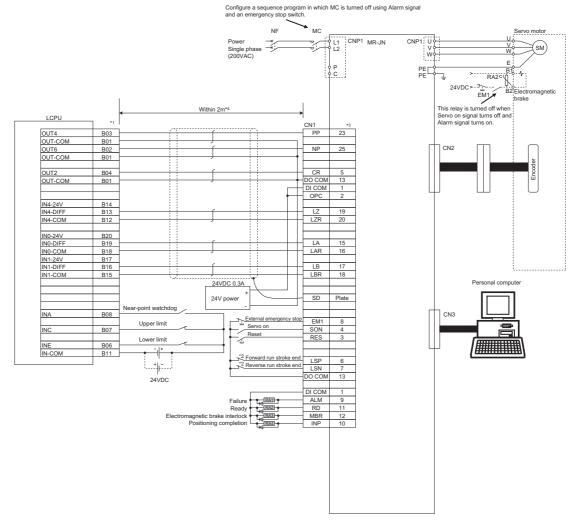

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to Page 51, Section 7.2.
- *2 These are limit switches for the servo amplifier (for stop).
- *3 For details on connection, refer to the instruction manual of the servo amplifier MR-JN.
- *4 This is a distance between the LCPU and the servo amplifier.
- *5 The L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, and L26CPU-PBT do not support this series.

(2) Connection example with MR-J3-□ A series*5

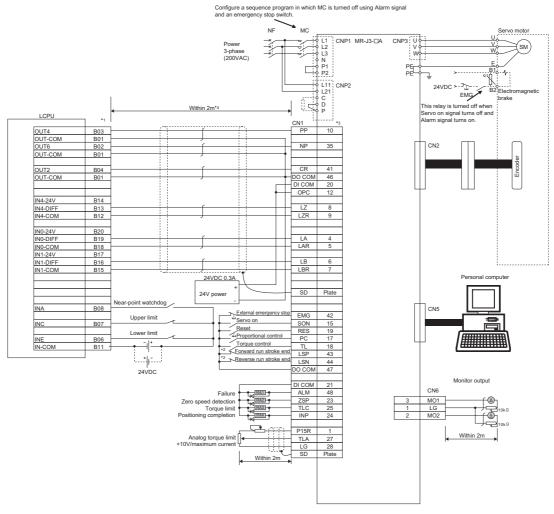


- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to Page 51, Section 7.2.
- *2 These are limit switches for the servo amplifier (for stop).
- *3 For details on connection, refer to the instruction manual of the servo amplifier MR-J3.
- *4 This is a distance between the LCPU and the servo amplifier.
- *5 The L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, and L26CPU-PBT do not support this series.

Appendix 2.2

Connection examples with stepping motors manufactured by ORIENTAL MOTOR CO.,LTD.


(1) Connection example with RK series

(a) L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT

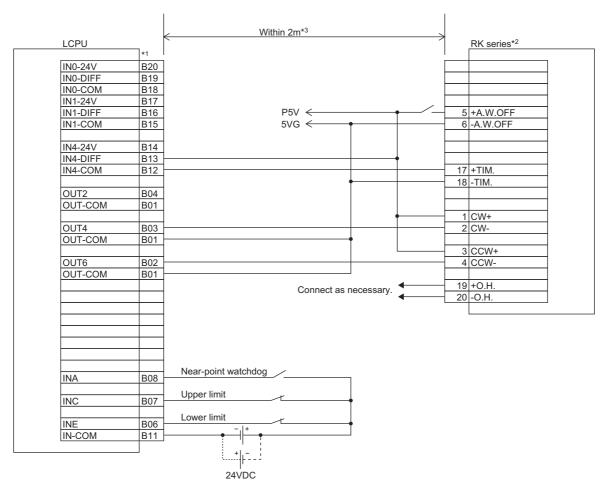

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to 🖙 Page 51, Section 7.2.
- *2 Refer to the manual of the stepping motor drive for information on the stepping motor drive side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the stepping motor.


(b) L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT

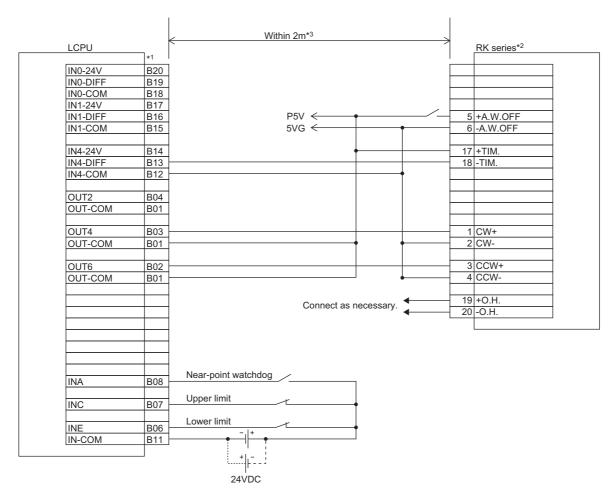

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to 🖙 Page 51, Section 7.2.
- *2 Refer to the manual of the stepping motor drive for information on the stepping motor drive side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the stepping motor.


(2) Connection example with AR series

(a) L02SCPU, L02CPU, L06CPU, L26CPU, L26CPU-BT

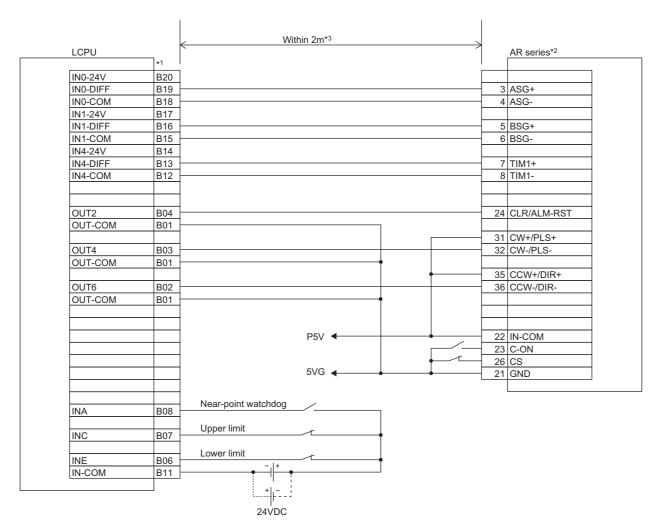

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to 🖙 Page 51, Section 7.2.
- *2 Refer to the manual of the stepping motor drive for information on the stepping motor drive side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the stepping motor.


(b) L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, L26CPU-PBT

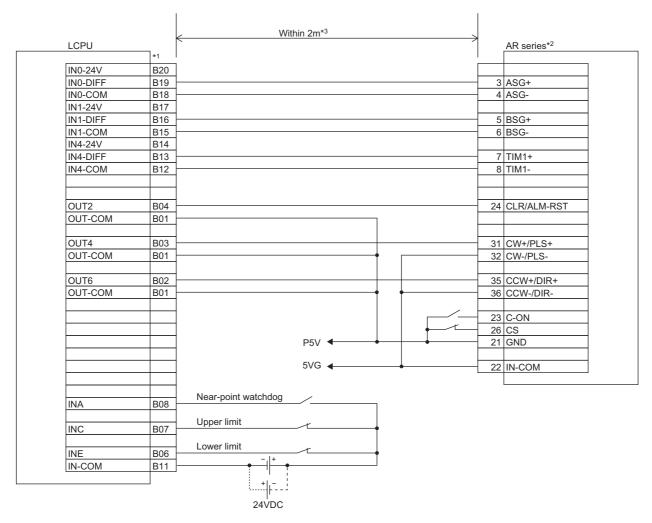

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to 🖙 Page 51, Section 7.2.
- *2 Refer to the manual of the stepping motor drive for information on the stepping motor drive side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the stepping motor.


Appendix 2.3 Connection examples with servo amplifiers manufactured by Panasonic Corporation

(1) Connection example with MINAS-A4 series*4

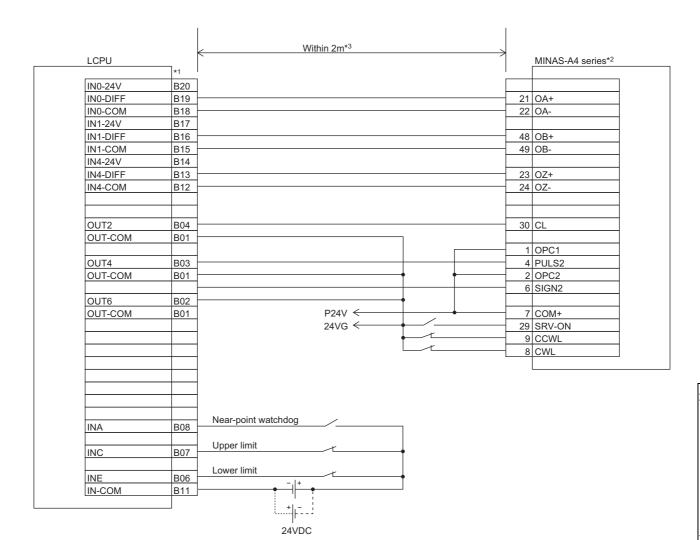

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to 🖾 Page 51, Section 7.2.
- *2 Refer to the manual of the servo amplifier for information on the servo amplifier side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the servo amplifier.
- *4 The L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, and L26CPU-PBT do not support this series.


(2) Connection example with MINAS-E series*4

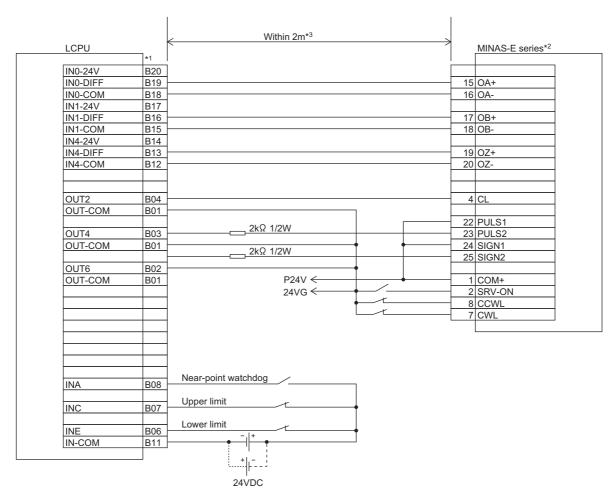

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to 🖙 Page 51, Section 7.2.
- *2 Refer to the manual of the servo amplifier for information on the servo amplifier side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the servo amplifier.
- *4 The L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, and L26CPU-PBT do not support this series.

Appendix 2.4 Connection examples with servo amplifiers manufactured by SANYODENKI CO.,LTD.

(1) Connection example with R series*4

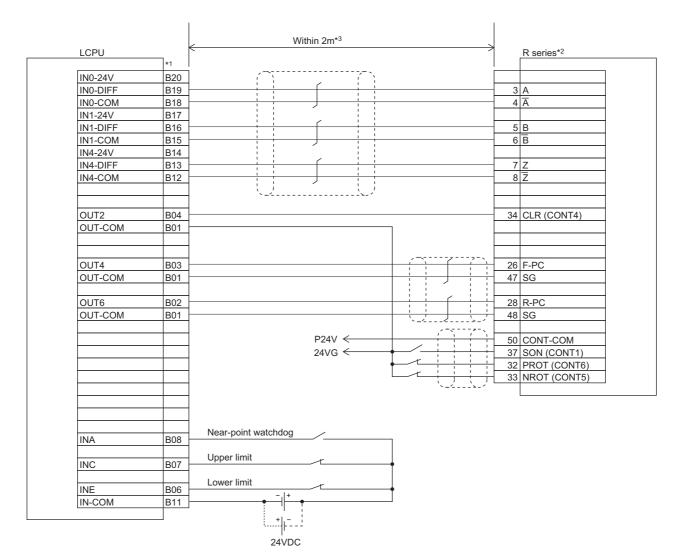


- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to 🖙 Page 51, Section 7.2.
- *2 Refer to the manual of the servo amplifier for information on the servo amplifier side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the servo amplifier.
- *4 The L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, and L26CPU-PBT do not support this series.

Appendix 2.5

Connection examples with servo amplifiers manufactured by YASKAWA Electric Corporation

(1) Connection example with Σ -V series*4

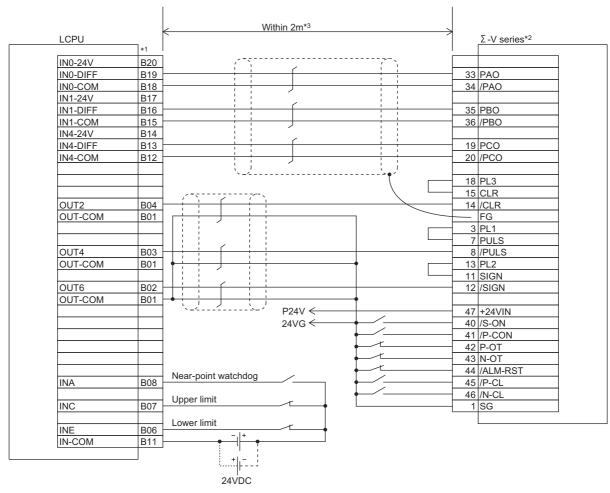

- *1 This is an example for axis 1. For the pin assignment when connecting to axis 2, refer to Page 51, Section 7.2.
- *2 Refer to the manual of the servo amplifier for information on the servo amplifier side wiring and various signal wire shields not shown above.
- *3 This is a distance between the LCPU and the servo amplifier.
- *4 The L02SCPU-P, L02CPU-P, L06CPU-P, L26CPU-P, and L26CPU-PBT do not support this series.

INDEX

0 to 9	D
1-phase multiple of 1 195 1-phase multiple of 1 (A phase only) 195 1-phase multiple of 2 195 1-phase multiple of 2(A phase only) 195 2-phase multiple of 1 196 2-phase multiple of 2 196 2-phase multiple of 4 196	DEC/STOP time at speed change
A	Drive unit ready signal
A phase/B phase mode (multiple of 1), A phase/B phase mode (multiple of 4)	Duty ratio
ABS transmission data bit 0	Encoder
B	
Bias speed at start	type encoder (24VDC)
CCW/SIGN/B phase output	F
(counter value coincidence No.n)208Coincidence output No.1 signal184Coincidence output No.2 signal184Coincidence output No.n point number250Coincidence output No.n point setting250Coincidence output time preset setting207Command pulse frequency49Command speed93,140Connectable encoders185Control system91,92,140	Feedback pulses
Count 1 83 Count 2 86 Count disable/preset function 217 Count disabling function 214 Count range of the ring counter 201 Count source selection 193 Counter type 199 Counting speed setting 197 Creep speed 68 Current feed value 63	I/O connector pin numbers and corresponding I/O signals
CW/CCW	JOG ACC time

L	Program example with the coincidence detection
Latch count value	interrupt function
	Programming tool
Latch count value number	Pulse frequency
Latch counter function	Pulse generator
Latch counter input signal	Pulse input mode
Latch counter/preset/replace function	Pulse measurement target setting 233
LCPU	Pulse output mode
Leakage current at OFF	PULSE/SIGN mode
Lower limit signal	PWM
	PWM output cycle setting value 255
M	PWM output on width setting value 255
Maximum load current	R
Maximum voltage drop at ON 23	
Measured frequency value	Rated input current
Measured pulse value	Rated input voltage
Measured rotation speed value 253	Rated load voltage
Minimum count pulse width	Response time
Movement amount per pulse	
Movement amount per pulse	Ring counter lower limit value
	Ring counter upper limit value
N	Rotation direction setting
	Rotation speed measurement unit time setting 227
Near-point dog	Rotation speed movement averaging processing count
Near-point dog method	
Near-point dog signal	
Negative logic	s
New speed value	<u> </u>
No method	CAM strake upper limit CAM strake lewer limit 50
	S/W stroke upper limit, S/W stroke lower limit 59
Number of pulses per rotation (pulse) 227	Sampling count value
	Sampling counter function
0	Sampling time setting
	S-curve acceleration/deceleration 60
OFF voltage/OFF current	Servo amplifier
ON voltage/ON current	Servo motor
OP address	Servo on
Operation mode setting	Setting of movement amount after near-point dog ON
Operations of the linear counter	
Operations of the ring counter	Signal assignment of the connector for external
•	devices
OPR acceleration/deceleration time	Signal loaded from the servo amplifier
OPR deceleration stop time	Signal output to the servo amplifier
OPR direction	
OPR dwell time	Specification of JOG operation direction 149
OPR method	Speed limit value
OPR method and I/O signal 71	Standby address
OPR methods and OPR parameters 67	Stepping motor
OPR speed	Stop setting time
Original position return type	Stopper 1
Output signal assignment	Stopper 2
Output waveform setting	Stopper 3
Output wavelorm setting	
P	Т
	Township about 150
Phase A	Target position change value
Phase B	Trapezoid acceleration/deceleration 60
Phase Z	
Position loop gain	U
Positioning address/movement amount 94,140	
Positioning data No	Upper limit signal
Preset by a program	Sppor minicolgrida i i i i i i i i i i i i i i i i i i
Preset by phase Z input	
Preset value setting	1

W

_	Warning	22,23 22,23
	Z phase settings	

INSTRUCTION INDEX

ICCNTRD1(P), ICCNTRD2(P)	
ICCOVWR1(P), ICCOVWR2(P)	
ICFCNT1, ICFCNT2	252
ICLTHRD1(P), ICLTHRD2(P)	246
ICPLSRD1(P), ICPLSRD2(P)	254
ICPREWR1(P), ICPREWR2(P)	245
ICPWM1, ICPWM2	255
ICRCNT1, ICRCNT2	253
ICRNGWR1(P), ICRNGWR2(P)	243
ICSMPRD1(P), ICSMPRD2(P)	248
IPABRST1, IPABRST2	
IPDSTRT1(P), IPDSTRT2(P)	
IPJOG1, IPJOG2	149
IPOPR1(P), IPOPR2(P)	146
IPPSTRT1(P), IPPSTRT2(P)	
IPSIMUL(P)	
IPSPCHG1(P), IPSPCHG2(P)	
IPSTOP1, IPSTOP2	
IPTPCHG1(P), IPTPCHG2(P)	159

П

REVISIONS

*The manual number is given on the bottom left of the back cover.

Print date	*Manual number	Revision
January 2010	SH(NA)-080892ENG-A	First edition
October 2010	SH(NA)-080892ENG-B	Revised due to changes in PWM output specifications
July 2011	SH(NA)-080892ENG-C	Descriptions regarding the L02CPU-P and L26CPU-PBT are added.
September 2011	SH(NA)-080892ENG-D	Descriptions regarding the L6EXB, L6EXE, LC06E, LC10E, and LC30E are added.
February 2013	SH(NA)-080892ENG-E	Descriptions regarding the L02SCPU, L06CPU, and L26CPU are added.
May 2013	SH(NA)-080892ENG-F	Descriptions regarding the L02SCPU-P, L06CPU-P, and L26CPU-P are added.
September 2014	SH(NA)-080892ENG-G	[Partial correction]
		Section 8.11
May 2016	SH(NA)-080892ENG-H	[Partial correction]
•	, ,	Chapter 2, 3, 5, 6, Section 7.4, 8.9
July 2019	SH(NA)-080892ENG-I	[Partial correction]
		Chapter 2, 3, 5, 6, 8

Japanese manual version SH-080876-J

This manual confers no industrial property rights or any rights of any other kind, nor does it confer any patent licenses. Mitsubishi Electric Corporation cannot be held responsible for any problems involving industrial property rights which may occur as a result of using the contents noted in this manual.

© 2010 MITSUBISHI ELECTRIC CORPORATION

WARRANTY

Please confirm the following product warranty details before using this product.

1. Gratis Warranty Term and Gratis Warranty Range

If any faults or defects (hereinafter "Failure") found to be the responsibility of Mitsubishi occurs during use of the product within the gratis warranty term, the product shall be repaired at no cost via the sales representative or Mitsubishi Service Company.

However, if repairs are required onsite at domestic or overseas location, expenses to send an engineer will be solely at the customer's discretion. Mitsubishi shall not be held responsible for any re-commissioning, maintenance, or testing on-site that involves replacement of the failed module.

[Gratis Warranty Term]

The gratis warranty term of the product shall be for one year after the date of purchase or delivery to a designated place. Note that after manufacture and shipment from Mitsubishi, the maximum distribution period shall be six (6) months, and the longest gratis warranty term after manufacturing shall be eighteen (18) months. The gratis warranty term of repair parts shall not exceed the gratis warranty term before repairs.

[Gratis Warranty Range]

- (1) The range shall be limited to normal use within the usage state, usage methods and usage environment, etc., which follow the conditions and precautions, etc., given in the instruction manual, user's manual and caution labels on the product.
- (2) Even within the gratis warranty term, repairs shall be charged for in the following cases.
 - 1. Failure occurring from inappropriate storage or handling, carelessness or negligence by the user. Failure caused by the user's hardware or software design.
 - 2. Failure caused by unapproved modifications, etc., to the product by the user.
 - 3. When the Mitsubishi product is assembled into a user's device, Failure that could have been avoided if functions or structures, judged as necessary in the legal safety measures the user's device is subject to or as necessary by industry standards, had been provided.
 - 4. Failure that could have been avoided if consumable parts (battery, backlight, fuse, etc.) designated in the instruction manual had been correctly serviced or replaced.
 - 5. Failure caused by external irresistible forces such as fires or abnormal voltages, and Failure caused by force majeure such as earthquakes, lightning, wind and water damage.
 - 6. Failure caused by reasons unpredictable by scientific technology standards at time of shipment from Mitsubishi.
 - 7. Any other failure found not to be the responsibility of Mitsubishi or that admitted not to be so by the user.

2. Onerous repair term after discontinuation of production

- (1) Mitsubishi shall accept onerous product repairs for seven (7) years after production of the product is discontinued. Discontinuation of production shall be notified with Mitsubishi Technical Bulletins, etc.
- (2) Product supply (including repair parts) is not available after production is discontinued.

3. Overseas service

Overseas, repairs shall be accepted by Mitsubishi's local overseas FA Center. Note that the repair conditions at each FA Center may differ.

4. Exclusion of loss in opportunity and secondary loss from warranty liability

Regardless of the gratis warranty term, Mitsubishi shall not be liable for compensation to:

- (1) Damages caused by any cause found not to be the responsibility of Mitsubishi.
- (2) Loss in opportunity, lost profits incurred to the user by Failures of Mitsubishi products.
- (3) Special damages and secondary damages whether foreseeable or not, compensation for accidents, and compensation for damages to products other than Mitsubishi products.
- (4) Replacement by the user, maintenance of on-site equipment, start-up test run and other tasks.

5. Changes in product specifications

The specifications given in the catalogs, manuals or technical documents are subject to change without prior notice.

TRADEMARKS

Microsoft and Windows are either registered trademarks or trademarks of Microsoft Corporation in the United States and/or other countries.

The company names, system names and product names mentioned in this manual are either registered trademarks or trademarks of their respective companies.

In some cases, trademark symbols such as '™, or '®, are not specified in this manual.

288 SH(NA)-080892ENG-I

SH(NA)-080892ENG-I(1907)MEE MODEL: LCPU-U-IO-E

MODEL CODE: 13JZ38

MITSUBISHI ELECTRIC CORPORATION

HEAD OFFICE : TOKYO BUILDING, 2-7-3 MARUNOUCHI, CHIYODA-KU, TOKYO 100-8310, JAPAN NAGOYA WORKS : 1-14 , YADA-MINAMI 5-CHOME , HIGASHI-KU, NAGOYA , JAPAN

When exported from Japan, this manual does not require application to the Ministry of Economy, Trade and Industry for service transaction permission.

Specifications subject to change without notice.